

PROBLEM SUMMARY

Sample Rating Trend

ISO


8004772 (S/N 1068)

Component

Compressor

NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

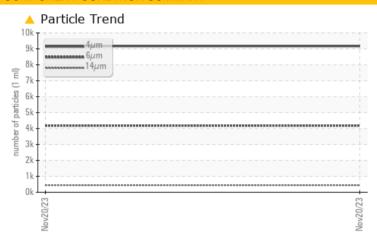

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	4183						
Particles >14µm	ASTM D7647	>80	448						
Particles >21µm	ASTM D7647	>20	4 98						
Oil Cleanliness	ISO 4406 (c)	>/17/13	20/19/16						

Customer Id: 4FRKEN Sample No.: KCPA007251 Lab Number: 06027170 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO

8004772 (S/N 1068)

Component

Compressor

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

▲ Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Nov2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA007251		
Sample Date		Client Info		20 Nov 2023		
Machine Age	hrs	Client Info		4206		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	2		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	7		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		6		
Calcium	ppm	ASTM D5185m		<1		
Phosphorus	ppm	ASTM D5185m		0		
Zinc	ppm	ASTM D5185m		45		
Sulfur	ppm	ASTM D5185m		18302		
			11 11 11		111	1111
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
Water	%	ASTM D6304	>0.05	0.006		
ppm Water	ppm	ASTM D6304	>500	65		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		9173		
Particles >6µm		ASTM D7647	>1300	4183		
Particles >14μm		ASTM D7647	>80	448		
Particles >21µm		ASTM D7647	>20	<u>^</u> 98		
Particles >38μm		ASTM D7647	>4	3		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	20/19/16		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2


Acid Number (AN)

mg KOH/g ASTM D8045

0.37



OIL ANALYSIS REPORT

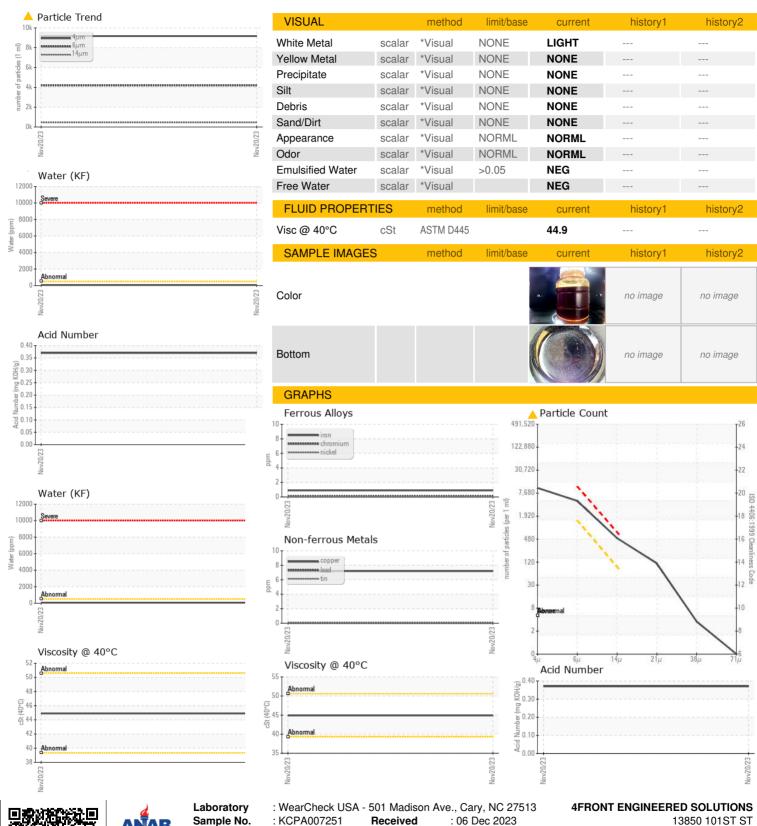





Sample No. Lab Number **Unique Number**

: KCPA007251 : 06027170

: 10776961

Received Diagnosed

: 08 Dec 2023

Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) 13850 101ST ST KENOSHA, WI US 53142

Contact: A/P

4front.kenoshaap@4frontes.com T:

F:

Contact/Location: A/P ? - 4FRKEN