

PROBLEM SUMMARY

Sample Rating Trend

WEAR




INGERSOLL RAND CBV112571 - CAROLINA LINEN


Component

Compressor

PS-200 (--- GAL)

COMPONENT CONDITION SUMMARY

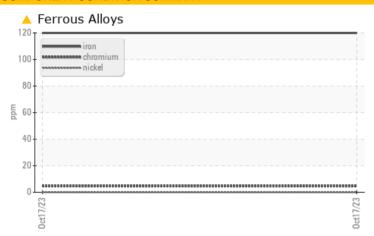

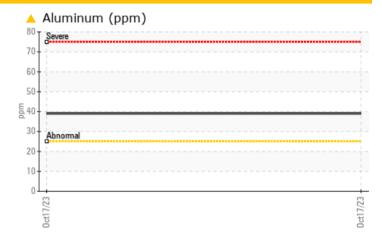

RECOMMENDATION

No corrective action is recommended at this time. We recommend an early resample to monitor this condition. Please submit a sample of the new (unused) oil to establish a baseline.

PROBLEMATIC	TEST R	ESULTS			
Sample Status				ABNORMAL	
Iron	ppm	ASTM D5185m	>50	<u> </u>	
Aluminum	nnm	ΔSTM D5185m	\25	A 30	

Customer Id: PALFOU Sample No.: WC0845230 Lab Number: 06027839 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Resample			?	We recommend an early resample to monitor this condition. Please submit a sample of the new (unused) oil to establish a baseline.		

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

WEAR



Machine Id

INGERSOLL RAND CBV112571 - CAROLINA LINEN

Component

Compressor

PS-200 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. We recommend an early resample to monitor this condition. Please submit a sample of the new (unused) oil to establish a baseline.

Wear

The iron level is abnormal. The aluminum level is abnormal.

Contamination

There is no indication of any contamination in the oil

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

				·		
				Oct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0845230		
Sample Date		Client Info		17 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	120		
Chromium	ppm	ASTM D5185m	>10	5		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	4 39		
Lead	ppm	ASTM D5185m	>25	<1		
Copper	ppm	ASTM D5185m	>50	6		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		3		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		10		

Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		10		
Phosphorus	ppm	ASTM D5185m		417		
Zinc	ppm	ASTM D5185m		6		
Sulfur	ppm	ASTM D5185m		817		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	9		
Sodium	ppm	ASTM D5185m		23		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	ma KOH/a	ASTM D8045		0.26		



OIL ANALYSIS REPORT

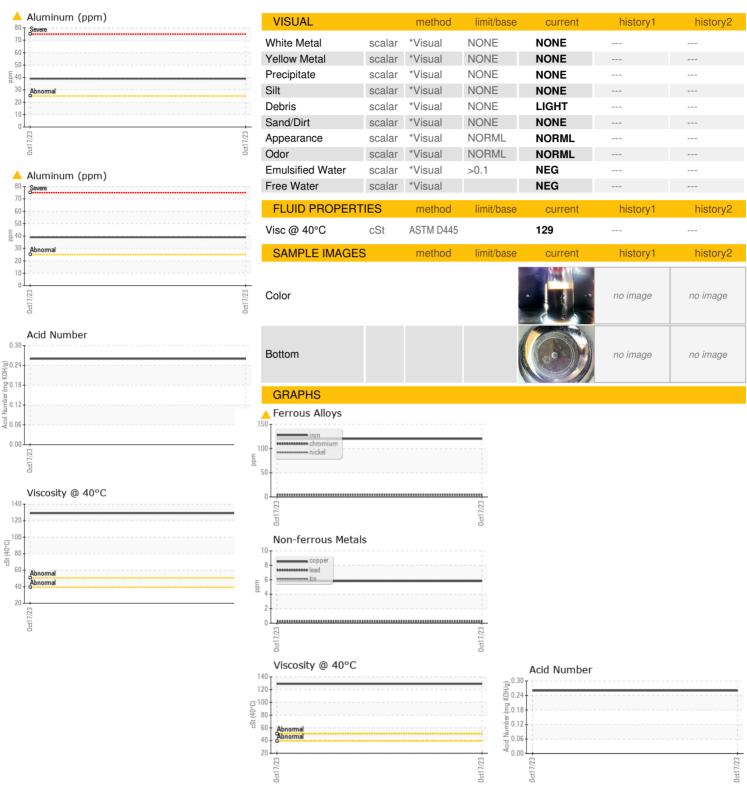





Certificate L2367

Laboratory

Sample No. Lab Number **Unique Number**

: WC0845230 : 06027839 : 10777630 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 07 Dec 2023 Diagnosed : 09 Dec 2023

: Don Baldridge Diagnostician

ELEVATED INDUSTRIAL SOLUTIONS - EIS 302 HUGHES ST FOUNTAIN INN, SC

US 29644 Contact: DARRIN WARD dward@elevatedindustrial.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (864)862-7653 Contact/Location: DARRIN WARD - PALFOU

T: