


OIL ANALYSIS REPORT

CS-46 [PM6-2506856] ATLAS COPCO AII124634 - VICTORY WOODWORKING

Component

Compressor

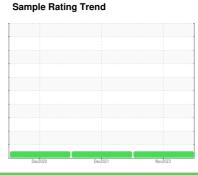



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the component.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Des	2020	Dec2021 Nov202	3	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06027873	UCH05445828	UCH05162537
Sample Date		Client Info		15 Nov 2023	28 Dec 2021	27 Dec 2020
Machine Age	hrs	Client Info		38911	36788	34965
Oil Age	hrs	Client Info		0	2895	0
Oil Changed		Client Info		Not Changd	Not Changd	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water	•	WC Method		NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
	10 10 100	ASTM D5185m	>50	0	•	0
Iron	ppm				<1	
Chromium	ppm	ASTM D5185m	>5	0	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m		0	0	0
Lead	ppm	ASTM D5185m	>65	0	0	<1
Copper	ppm	ASTM D5185m	>65	<1	0	0
Tin	ppm	ASTM D5185m	>10	0	0	0
Antimony	ppm	ASTM D5185m			0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	1.5	0	<1	<1
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m	0.3	<1	0	0
Magnesium	ppm	ASTM D5185m	0	0	0	0
Calcium	ppm	ASTM D5185m	0	0	0	0
Phosphorus	ppm	ASTM D5185m	406	187	151	168
Zinc	ppm	ASTM D5185m	0	0	0	0
Sulfur	ppm	ASTM D5185m	1283	262	240	138
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	0	1	<1
Sodium	ppm	ASTM D5185m		2	0	0
Potassium	ppm	ASTM D5185m	>20	0	0	0
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.463	0.077	0.143	0.081



OIL ANALYSIS REPORT

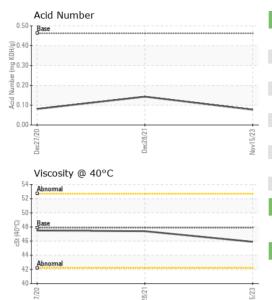


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	MODER
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	47.9	45.9	47.4	47.5
SAMPLE IMAGES		method	limit/base	current	history1	history2

Color



Bottom

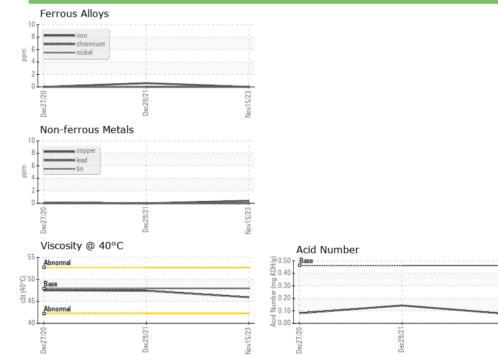





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package : IND 2

: 10777664

: UCH06027873 : 06027873

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received Diagnosed

: 07 Dec 2023 : 11 Dec 2023 Diagnostician : Jonathan Hester

CISCO AIR SYSTEMS 214 27TH ST SACRAMENTO, CA US 95816 Contact: BARRY FRKOVICH barryfrkovich@ciscoair.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (916)444-2525 F: x: