

PROBLEM SUMMARY

KAESER 6893788


Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

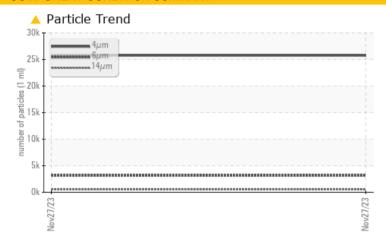

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	△ 3143						
Particles >14µm	ASTM D7647	>80	526						
Particles >21µm	ASTM D7647	>20	149						
Particles >38µm	ASTM D7647	>4	<u>^</u> 6						
Oil Cleanliness	ISO 4406 (c)	>/17/13	<u>22/19/16</u>						

Customer Id: BERKEN Sample No.: KCPA009425 Lab Number: 06029388 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

KAESER 6893788

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

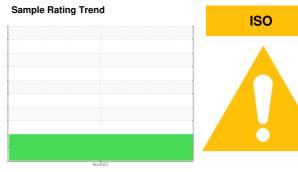

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Nov2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA009425		
Sample Date		Client Info		27 Nov 2023		
Machine Age	hrs	Client Info		1941		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>3	<1		
Titanium	ppm	ASTM D5185m	>3	<1		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	2		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	1		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	43		
Molybdenum	ppm	ASTM D5185m	0	<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	84		
Calcium	ppm	ASTM D5185m	0	2		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	23500	21499		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	14		
Water	%	ASTM D6304	>0.05	0.043		
ppm Water	ppm	ASTM D6304	>500	432		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		25763		
Particles >6µm		ASTM D7647	>1300	<u>▲</u> 3143		
Particles >14μm		ASTM D7647	>80	<u>▲</u> 526		
Particles >21µm		ASTM D7647	>20	<u> 149</u>		
Particles >38μm		ASTM D7647	>4	<u>^</u> 6		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	22/19/16		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.35		



OIL ANALYSIS REPORT





Sample No. Lab Number **Unique Number**

: KCPA009425 : 06029388 : 10779179

Received : 08 Dec 2023 Diagnosed

: 12 Dec 2023 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

7575 COBB INTERNATIONAL BLVD KENNESAW, GA

US 30152 Contact: CARLOS JURADO

carlos.jurado@bergerlogistics.com

T: F: