


OIL ANALYSIS REPORT

CFG-546 [CAC3188334] Machine Id QUINCY UN119979 - DAIRY FARMERS OF AMERICA-TURLOCK

Component

Compressor

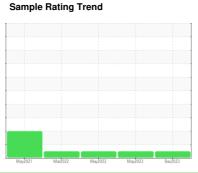



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		May2021	Mar2022	May2022 May2023	Dec2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06061296	UCH05861975	UCH05602953
Sample Date		Client Info		27 Dec 2023	17 May 2023	20 May 2022
Machine Age	hrs	Client Info		66668	64498	60948
Oil Age	hrs	Client Info		2168	7735	4184
Oil Changed		Client Info		Not Changd	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	<1	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		<1	<1	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	2	<1	<1
Lead	ppm	ASTM D5185m	>25	0	0	<1
Copper	ppm	ASTM D5185m	>50	<1	<1	0
Tin	ppm	ASTM D5185m	>15	<1	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	<1	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	0
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m	0	0	<1	0
Magnesium	ppm	ASTM D5185m	1.2	0	0	0
Calcium	ppm	ASTM D5185m	0	0	0	0
Phosphorus	ppm	ASTM D5185m	295	269	81	193
Zinc	ppm	ASTM D5185m	0	0	0	0
Sulfur	ppm	ASTM D5185m	253	941	958	564
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	<1	0
Sodium	ppm	ASTM D5185m		0	<1	0
Potassium	ppm	ASTM D5185m	>20	<1	<1	<1
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.252	0.16	0.17	0.33



OIL ANALYSIS REPORT

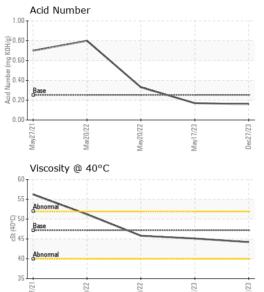

VISUAL		method	limit/base	ourront	history1	history2
VISUAL		method	IIIIII/Dase	current	HISTORY	HISTOLYZ
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	47.16	44.2	45.1	45.8
SAMPLE IMAGES		method	limit/base	current	history1	history2

Ferrous Alloys Non-ferrous Metals Viscosity @ 40°C Acid Number (B_{1.00} 0.80 0.80 55 €0.60 흔 0.40 ₹ 0.20 0.00 PG 35 May17/23.





Laboratory Sample No. Lab Number **Unique Number** Test Package : IND 2

: 10832678

Color

Bottom

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06061296 : 06061296

Recieved Diagnosed

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

: 16 Jan 2024 : 17 Jan 2024 Diagnostician : Don Baldridge

US 95816 Contact: BARRY FRKOVICH

CISCO AIR SYSTEMS

SACRAMENTO, CA

barryfrkovich@ciscoair.com T: (916)444-2525

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

F: x:

214 27TH ST