


OIL ANALYSIS REPORT

PALATEK Machine Id PALATEK 21EE002149 - ESS

Component

Compressor

{not provided} (--- GAL)

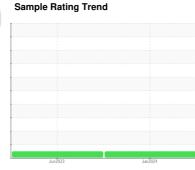



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Moor

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UAC06063705	UCH05876897	
Sample Date		Client Info		12 Jan 2024	12 Jun 2023	
Machine Age	hrs	Client Info		849	0	
Oil Age	hrs	Client Info		543	216	
Oil Changed		Client Info		Changed	Changed	
Sample Status				NORMAL	NORMAL	
CONTAMINATIO	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m		0	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>25	0	0	
Lead	ppm	ASTM D5185m	>25	0	0	
Copper	ppm	ASTM D5185m	>50	<1	0	
Tin	ppm	ASTM D5185m	>15	0	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	<1	
Magnesium	ppm	ASTM D5185m		0	0	
Calcium	ppm	ASTM D5185m		0	0	
Phosphorus	ppm	ASTM D5185m		319	662	
Zinc	ppm	ASTM D5185m		2	0	
Sulfur	ppm	ASTM D5185m		1213	1571	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1	2	
Sodium	ppm	ASTM D5185m		2	<1	
Potassium	ppm	ASTM D5185m	>20	<1	<1	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.072	0.061	



OIL ANALYSIS REPORT

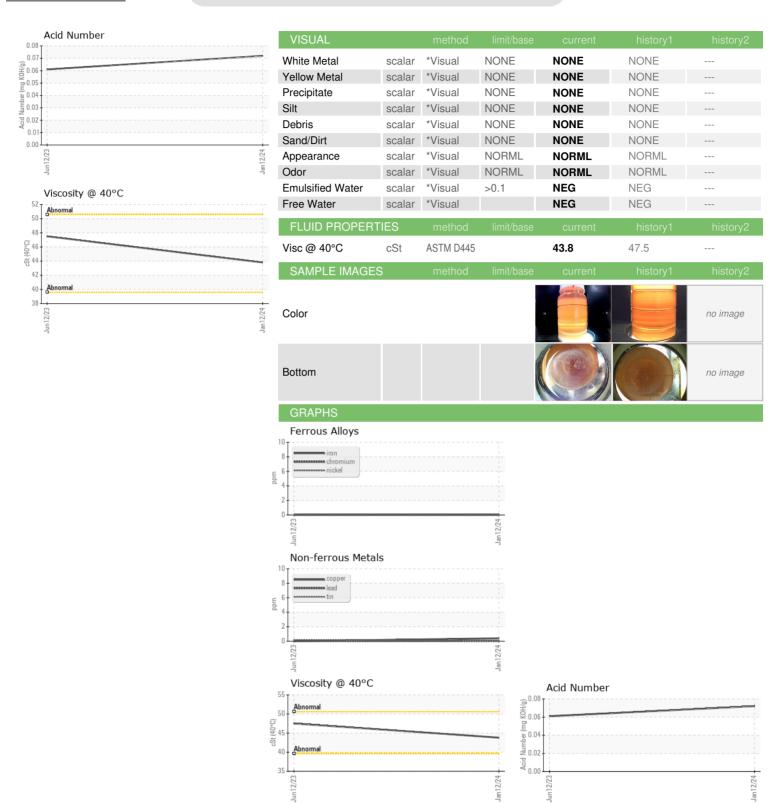





Certificate L2367

Laboratory Sample No.

Lab Number **Unique Number**

: UAC06063705 : 06063705 : 10835087 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 17 Jan 2024

Diagnosed : 19 Jan 2024 : Don Baldridge Diagnostician

ATLANTIC COMPRESSORS 2144 SALEM INDUSTRIAL DRIVE

SALEM, VA US 24153

Contact: BILL RIMER bill@atlanticcompressors.com

T: (540)728-1147

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCATLSAL [WUSCAR] 06063705 (Generated: 01/20/2024 04:22:47) Rev: 1

Contact/Location: BILL RIMER - UCATLSAL

F: (757)216-0134