


# **OIL ANALYSIS REPORT**

JCB 512-56 3267715

Component

**Hydraulic System** 

AW HYDRAULIC OIL IS

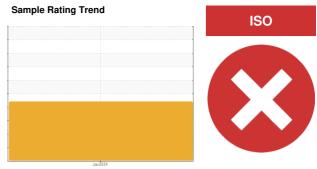

## DIAGNOSIS

#### Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation.

#### Wear

All component wear rates are normal.

#### Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.


### **Fluid Condition**

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

00.46 ( 0.41)						
SO 46 ( GAL)				Jan 2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		JCB004984		
Sample Date		Client Info		18 Jan 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				SEVERE		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>75	1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0		
Barium	ppm	ASTM D5185m	5	0		
Molybdenum	ppm	ASTM D5185m	5	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	25	<1		
Calcium	ppm	ASTM D5185m	200	45		
Phosphorus	ppm	ASTM D5185m	300	304		
Zinc	ppm	ASTM D5185m	370	390		
Sulfur	ppm	ASTM D5185m	2500	2906		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>51635</b>		
Particles >6µm		ASTM D7647	>1300	<b>13481</b>		
Particles >14µm		ASTM D7647	>160	<b>444</b>		
Particles >21µm		ASTM D7647	>40	<b>4</b> 74		
Particles >38µm		ASTM D7647	>10	2		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	23/21/16		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.57	0.37		



## **OIL ANALYSIS REPORT**

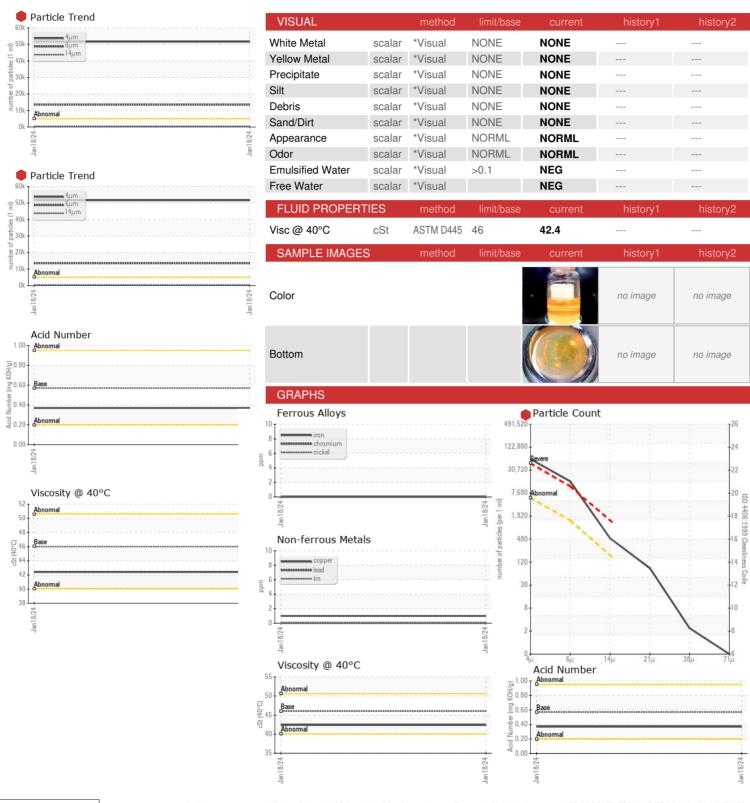





Laboratory Sample No. Lab Number Unique Number

: JCB004984 : 06065537 : 10836919 Test Package : MOB 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 19 Jan 2024 Recieved : 23 Jan 2024 Diagnosed : Wes Davis Diagnostician

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

JCB OF SOUTH TEXAS - ENERCO LLC - SAN ANTONIO

803 SE LOOP 410 SAN ANTONIO, TX US 78220

Contact: GARRETT BREWER garrett.brewer@bossjcb.com

T: (210)542-5288

Contact/Location: GARRETT BREWER - JCBSAN