


OIL ANALYSIS REPORT

Area CS 46 **QUINCY XP1164612 - GRAPHIC PKG**

Compressor

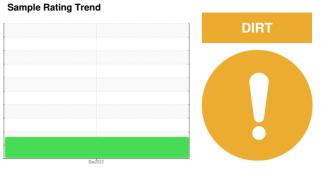

Recommendation

No corrective action is recommended at this time. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

Elemental level of silicon (Si) above normal.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06136492		
Sample Date		Client Info		15 Dec 2023		
Machine Age	hrs	Client Info		46838		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
CONTAMINATIO	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	0		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	1.5	0		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	0.3	0		
Magnesium	ppm	ASTM D5185m	0	0		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	406	103		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	1283	973		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	373		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.463	0.09		



OIL ANALYSIS REPORT







Certificate 12367

Laboratory Sample No.

Lab Number : 06136492

Test Package : IND 2

: UCH06136492 Unique Number : 10955957

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 02 Apr 2024 **Tested** : 03 Apr 2024

Diagnosed

: 05 Apr 2024 - Jonathan Hester

US 95816 Contact: BARRY FRKOVICH barryfrkovich@ciscoair.com T: (916)444-2525

CISCO AIR SYSTEMS

SACRAMENTO, CA

214 27TH ST

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCCISSAC [WUSCAR] 06136492 (Generated: 04/05/2024 23:02:51) Rev: 1

Contact/Location: BARRY FRKOVICH - UCCISSAC

F: x: