


OIL ANALYSIS REPORT

Sample Rating Trend

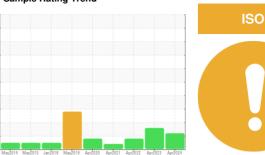

Machine Id

FALK REFINERY VAC PAN 1

Gearbox

MOBIL SHC 630 (10 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Due to an abnormal test result it is recommended to contact Stauff Corp at (201)-444-7800 for help resolving the issue.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

May2014 May2015 Jan2016 May2013 Apr2020 Apr2021 Apr2022 Apr2022 Apr2022 Apr2024						
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		ST43726	ST44861	ST42835
Sample Date		Client Info		03 Apr 2024	13 Apr 2023	20 Apr 2022
Machine Age	mths	Client Info		0	0	0
Oil Age	mths	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	ABNORMAL	ATTENTION
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	1	<1	<1
Chromium	ppm	ASTM D5185m	>15	0	0	0
Nickel	ppm	ASTM D5185m	>15	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	<1
Aluminum	ppm	ASTM D5185m	>25	0	0	<1
Lead	ppm	ASTM D5185m	>100	0	0	0
Copper	ppm	ASTM D5185m	>200	0	0	<1
Tin	ppm	ASTM D5185m	>25	0	0	0
Antimony	ppm	ASTM D5185m	>5			
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	<1
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	<1	0
Magnesium	ppm	ASTM D5185m		0	<1	0
Calcium	ppm	ASTM D5185m		4	0	0
Phosphorus	ppm	ASTM D5185m		332	372	374
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m		328	150	173
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	7	14	19
Sodium	ppm	ASTM D5185m		<1	0	0
Potassium	ppm	ASTM D5185m	>20	0	0	<1
Water	%	ASTM D6304	>0.2	0.005	0.010	0.00
ppm Water	ppm	ASTM D6304	>2000	53	108.3	0.00
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>1300	2333	<u>▲</u> 7412	2210
Particles >6µm		ASTM D7647	>320	632	<u>^</u> 2641	559
Particles >14μm		ASTM D7647	>80	49	△ 93	10
Particles >21µm		ASTM D7647	>20	11	8	0
Particles >38µm		ASTM D7647	>4	0	1	0
Particles >71µm		ASTM D7647	>3	0	1	0
Oil Cleanliness		ISO 4406 (c)	>17/15/13	18/16/13	<u>^</u> 20/19/14	18/16/10
FLUID DEGRADA	TION	method	limit/base	current	history1	history2



OIL ANALYSIS REPORT

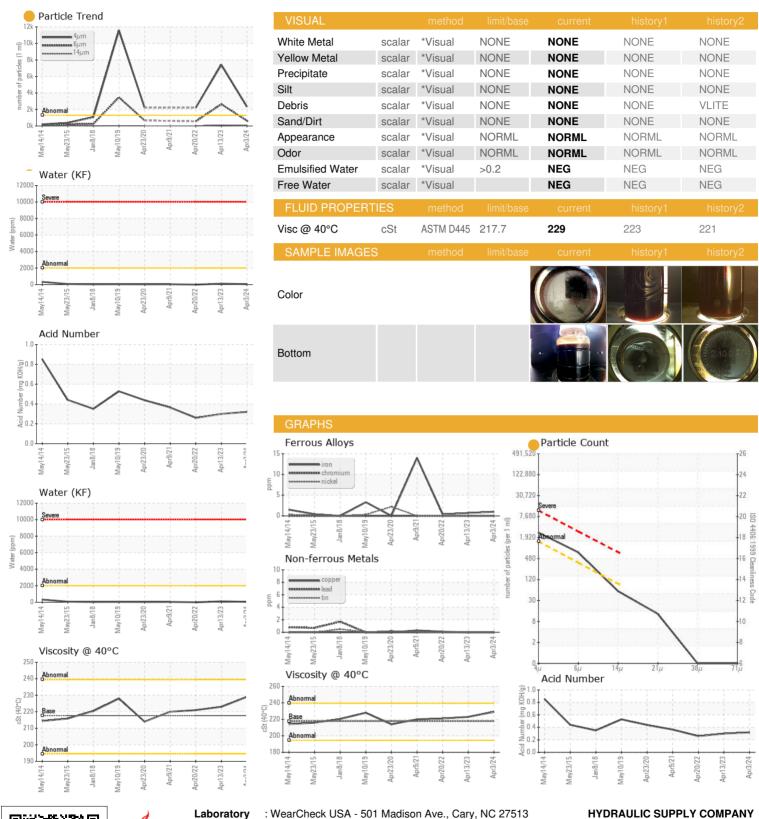





Certificate 12367

Laboratory Sample No.

: ST43726 Lab Number : 06143066

Unique Number : 10967874

Received **Tested** Diagnosed

: 11 Apr 2024 - Jonathan Hester Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

 st - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

HYDRAULIC SUPPLY COMPANY

326 SE 1ST ST BELLE GLADE, FL US 33430

Contact: ROBERT RETALEATO r.retaleato@hydraulic-supply.com;rsr@hydraulic-supply.com

T: (561)996-4431 F: (561)996-8531

Contact/Location: ROBERT RETALEATO - HYDBELFL

: 09 Apr 2024

: 10 Apr 2024