


# **OIL ANALYSIS REPORT**

SYNOIL 8K

# INGERSOLL RAND UP6 CBV510847 - RYDER TRUCK

Component

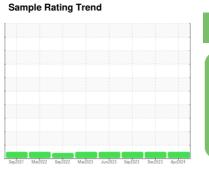



### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCZ06145317	UCZ06055957	UCZ05961347
Sample Date		Client Info		04 Apr 2024	21 Dec 2023	20 Sep 2023
Machine Age	hrs	Client Info		33825	31400	29185
Oil Age	hrs	Client Info		6770	4345	2130
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1	0	0
Chromium	ppm	ASTM D5185m	>5	0	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>15	2	0	0
Lead	ppm	ASTM D5185m	>65	0	0	0
Copper	ppm	ASTM D5185m	>65	4	3	2
Tin	ppm	ASTM D5185m	>10	<1	0	<1
Vanadium	ppm	ASTM D5185m		0	0	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0.3	0	0	0
Barium	ppm	ASTM D5185m	0.3	<1	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m	0.9	0	0	<1
Magnesium	ppm	ASTM D5185m	0.2	<1	<1	0
Calcium	ppm	ASTM D5185m	0.1	4	<1	0
Phosphorus	ppm	ASTM D5185m	429	271	321	335
Zinc	ppm	ASTM D5185m	0.3	56	89	56
Sulfur	ppm	ASTM D5185m	1336	299	273	345
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	0	0	3
Sodium	ppm	ASTM D5185m		9	8	3
Potassium	ppm	ASTM D5185m	>20	2	0	0
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.622	0.34	0.34	0.36



## **OIL ANALYSIS REPORT**

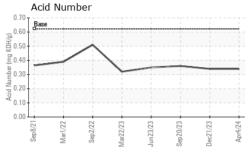

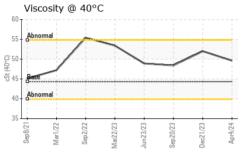

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	LIGHT	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID DDODEDT	150	ام مالم مما	li.ee it/le = = =		la i a t a un urd	histom O


FLUID FROFER HES		memou			HISTORY	HISTOLA	
Visc @ 40°C	cSt	ASTM D445	44.32	49.6	52.0	48.4	


SAMPLE IMAGES


Color


**Bottom** 



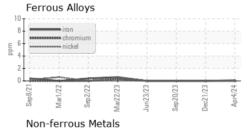





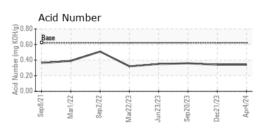





Certificate 12367

Laboratory Sample No.

Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06145317

: UCZ06145317 Unique Number : 10970125

Received **Tested** Diagnosed

: 10 Apr 2024 : 12 Apr 2024

: 14 Apr 2024 - Don Baldridge

**ZORN COMP & EQUIPMENT CO (GB)** 733 POTTS AVE GREEN BAY, WI US 54304 Contact: DEAN SCHAD

dean.schad@zornair.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

T: (920)391-8121 F: (920)499-1168

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) Report Id: UCZORGRE [WUSCAR] 06145317 (Generated: 04/14/2024 10:26:09) Rev: 1

Contact/Location: DEAN SCHAD - UCZORGRE