

# **OIL ANALYSIS REPORT**

Sample Rating Trend



**NORMAL** 



Machine Id

# DAIKIN HERSHEY CHILLER 1 (S/N STNU131200027)

Refrigeration Compressor

**MOBIL EAL ARTIC ISO 46 (--- GAL)** 

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**


Confirm oil type. The AN level is acceptable for this fluid. The condition of the oil is suitable for further


TORREST TORREST STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET,						
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0812167	WC0487283	WC0430703
Sample Date		Client Info		13 Mar 2024	30 Sep 2022	10 Mar 2022
Machine Age	hrs	Client Info		50850	42110	0
Oil Age	hrs	Client Info		50850	0	0
Oil Changed		Client Info		Not Changd	Not Changd	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	6	2	1
Chromium	ppm	ASTM D5185m	>2	0	0	0
Nickel	ppm	ASTM D5185m		0	<1	0
Titanium	ppm	ASTM D5185m		0	<1	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>50	<1	2	3
Lead	ppm	ASTM D5185m	>2	0	0	0
Copper	ppm	ASTM D5185m	>100	12	21	<1
Tin	ppm	ASTM D5185m	>4	0	1	14
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		0	<1	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	<1	0
Manganese	ppm	ASTM D5185m		0	<1	0
Magnesium	ppm	ASTM D5185m		<1	2	0
Calcium	ppm	ASTM D5185m		4	0	0
Phosphorus	ppm	ASTM D5185m		11	9	0
Zinc	ppm	ASTM D5185m		19	11	9
Sulfur	ppm	ASTM D5185m		53	0	0
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	43	47	6
Sodium	ppm	ASTM D5185m		0	2	0
Potassium	ppm	ASTM D5185m	>20	<1	<1	0
Water	%	ASTM D6304	>0.02	0.022	0.013	0.00
ppm Water	ppm	ASTM D6304	>250	223	132.0	0.00
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974	0.1	0.028	0.015	0.086



## **OIL ANALYSIS REPORT**

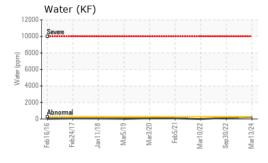

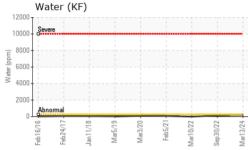

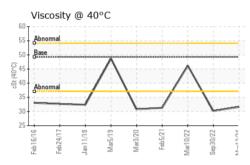


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.02	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG

I LOID I NOI LIN	IILO	memou			HISTOLAL	HISTOLYZ
Visc @ 40°C	cSt	ASTM D445	49.2	31.6	30.2	46.2


SAMPL	E IMAG	ES


Color


**Bottom** 

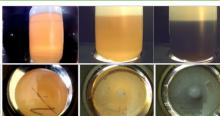


### **GRAPHS**

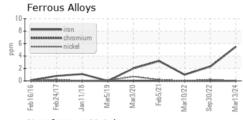

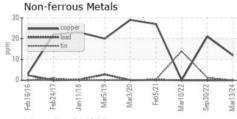

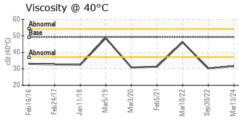

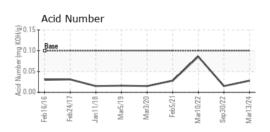





Certificate 12367

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0812167 Lab Number : 06147398

Unique Number : 10977476 Test Package : IND 2

Received : 12 Apr 2024 **Tested** : 15 Apr 2024

Diagnosed

: 16 Apr 2024 - Don Baldridge

US 23228 Contact: AMANDA CARRIER amanda.carrier@daikinapplied.com

T: (804)747-4822 F: (804)747-6686

**DAIKIN APPLIED-RICHMOND** 

8991 OLD STAPLES MILL ROAD

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

HENRICO, VA