


OIL ANALYSIS REPORT

NOT GIVEN [SR3318624] ATLAS COPCO API323254 - SIERRA COLLISION

Component Compressor



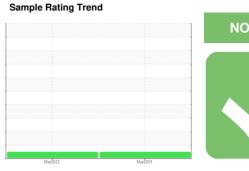

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06147461	UCH05506565	
Sample Date		Client Info		20 Mar 2024	01 Mar 2022	
Machine Age	hrs	Client Info		26645	27414	
Oil Age	hrs	Client Info		1350	0	
Oil Changed		Client Info		Changed	N/A	
Sample Status				NORMAL	NORMAL	
CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>0.8	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	
Chromium	ppm	ASTM D5185m	>5	0	0	
Nickel	ppm	ASTM D5185m		0	<1	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	<1	
Aluminum	ppm	ASTM D5185m	>15	0	<1	
Lead	ppm	ASTM D5185m	>65	0	0	
Copper	ppm	ASTM D5185m	>65	0	<1	
Tin	ppm	ASTM D5185m	>10	0	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	0	3	
Barium	ppm	ASTM D5185m	525	203	0	
Molybdenum	ppm	ASTM D5185m	10	0	0	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m	5	0	0	
Calcium	ppm	ASTM D5185m	10	0	0	
Phosphorus	ppm	ASTM D5185m	250	82	30	
Zinc	ppm	ASTM D5185m	100	12	25	
Sulfur	ppm	ASTM D5185m	400	617	69	
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	1	0	
Sodium	ppm	ASTM D5185m		<1	3	
Potassium	ppm	ASTM D5185m	>20	0	0	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2


0.12

0.061

Acid Number (AN) mg KOH/g ASTM D8045



OIL ANALYSIS REPORT

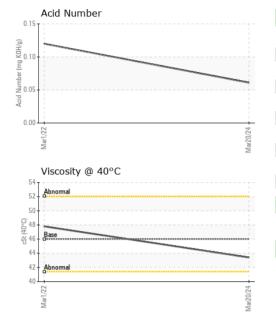











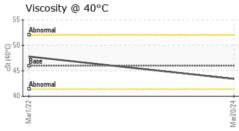

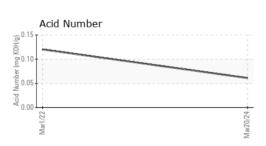





Laboratory Sample No. Lab Number : 06147461

: UCH06147461 Unique Number : 10977539

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 12 Apr 2024 **Tested** : 15 Apr 2024

Diagnosed

: 16 Apr 2024 - Sean Felton

SACRAMENTO, CA US 95816 Contact: BARRY FRKOVICH barryfrkovich@ciscoair.com T: (916)444-2525

CISCO AIR SYSTEMS

214 27TH ST

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: x: