


# **OIL ANALYSIS REPORT**

### Sample Rating Trend



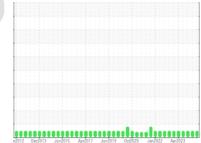

Machine Id

# FRICK TYSOTT 1 LTF (S/N X0265)

Refrigeration Compressor

USPI 1009-68 SC (--- QTS)



### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable.


### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP0006764	USP0004857	USP0001073
Sample Date		Client Info		08 Apr 2024	15 Jan 2024	16 Oct 2023
Machine Age	hrs	Client Info		51913	49907	47723
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	0	0	0
Chromium	ppm	ASTM D5185m	>2	<1	<1	0
Nickel	ppm	ASTM D5185m		<1	0	0
Titanium	ppm	ASTM D5185m		<1	<1	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>3	0	0	0
Lead	ppm	ASTM D5185m	>2	<1	<1	0
Copper	ppm	ASTM D5185m	>8	<1	<1	<1
Tin	ppm	ASTM D5185m	>4	<1	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		<1	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	<1	0
Molybdenum	ppm	ASTM D5185m		<1	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m		<1	<1	0
Calcium	ppm	ASTM D5185m		0	<1	<1
Phosphorus	ppm	ASTM D5185m		0	0	<1
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m	50	0	5	0
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2	<1	<1
Sodium	ppm	ASTM D5185m		0	0	<1
Potassium	ppm	ASTM D5185m	>20	<1	<1	0
Water	%	ASTM D6304	>0.01	0.004	0.003	0.003
ppm Water	ppm	ASTM D6304	>100	49	28	38.7
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000	670	654	2498
Particles >6µm		ASTM D7647	>2500	121	152	693
Particles >14µm		ASTM D7647	>320	8	16	37
Particles >21µm		ASTM D7647	>80	2	5	9
Particles >38µm		ASTM D7647	>20	0	0	1
Particles >71µm		ASTM D7647	>4	0	0	0
Oil Cleanliness		ISO 4406 (c)	>20/18/15	17/14/10	17/14/11	18/17/12
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974	0.005	0.014	0.015	0.015





## **OIL ANALYSIS REPORT**

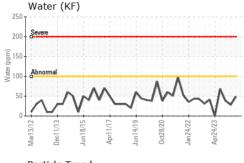


0k -		ım ım µm			1		
5k - Abn	ormal				1	1	
5k -			٨	M	IV.	1	~ .
Ok L	A m	Jun18/15		Jun14/19	Oct28/20	Jan24/22	Apr24/23

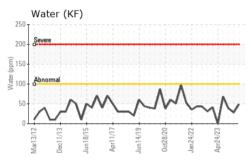

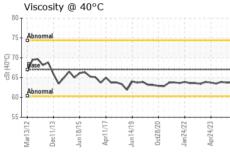


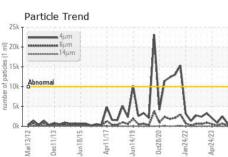


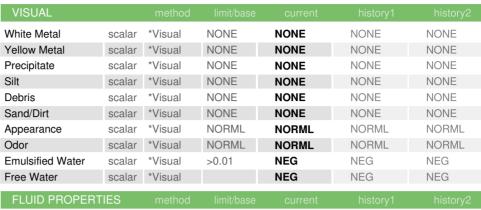


Visc @ 40°C	cSt	ASTM D445	67	63.8	63.7	63.9
04451514465						

Color

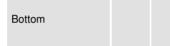

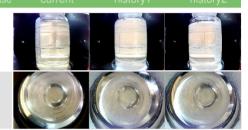

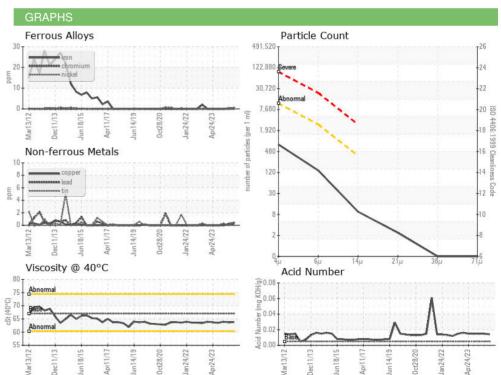





Certificate 12367

Laboratory Sample No.

: USP0006764 Lab Number : 06148104 Unique Number : 10978182 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 12 Apr 2024 **Tested** : 15 Apr 2024

Diagnosed : 15 Apr 2024 - Doug Bogart OTTAWA FORWARD FREEZER

OTTAWA, IL US Contact: RICK DUVAL

**TYSON -OTTAWA-USP** 

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: TYSOTT [WUSCAR] 06148104 (Generated: 04/15/2024 21:50:27) Rev: 1

Contact/Location: RICK DUVAL - TYSOTT

T:

F: