


OIL ANALYSIS REPORT

PALEXTRA 44 **SULLIVAN PALATEK 1506180018 - AKRON ARIEL**

Component Compressor

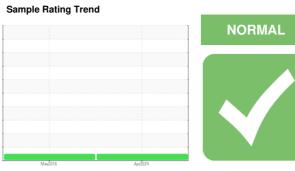

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


			mayeoro	TOTAL T		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCS06152130	UCS03991391	
Sample Date		Client Info		05 Apr 2024	19 May 2016	
Machine Age	hrs	Client Info		34859	4444	
Oil Age	hrs	Client Info		1337	4444	
Oil Changed		Client Info		Not Changd	Not Changd	
Sample Status				NORMAL	NORMAL	
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m		0	<1	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>25	<1	<1	
Lead	ppm	ASTM D5185m	>25	0	<1	
Copper	ppm	ASTM D5185m	>50	<1	<1	
Tin	ppm	ASTM D5185m	>15	<1	0	
Antimony	ppm	ASTM D5185m			2	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	
Barium	ppm	ASTM D5185m	0.3	0	0	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m	0.3	<1	0	
Magnesium	ppm	ASTM D5185m	0.4	0	<1	
Calcium	ppm	ASTM D5185m	0	<1	<1	
Phosphorus	ppm	ASTM D5185m	689	574	632	
Zinc	ppm	ASTM D5185m	0	0	<1	
Sulfur	ppm	ASTM D5185m	1237	1135	973	
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	3	10	
Sodium	ppm	ASTM D5185m		1	<1	
Potassium	ppm	ASTM D5185m	>20	2	2	
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.135	0.093	0.189	


Sullivan


OIL ANALYSIS REPORT

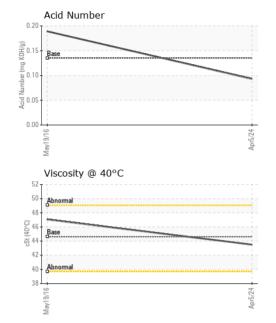



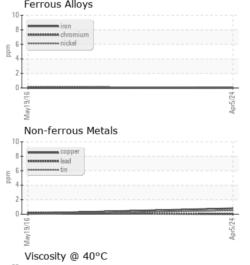

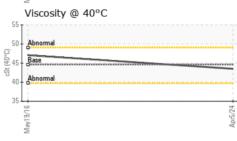

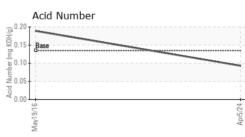





Certificate 12367

Report Id: UCAKRHAR [WUSCAR] 06152130 (Generated: 04/19/2024 16:21:48) Rev: 1

Laboratory

Sample No.

: UCS06152130 Lab Number : 06152130 Unique Number : 10982208

Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 17 Apr 2024 **Tested** : 18 Apr 2024

Diagnosed

: 19 Apr 2024 - Sean Felton

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

US 44632 Contact: BRIAN RITENOUR PARTS@AKRONAIR.COM

T: (330)877-4376 F: (330)877-4902

AKRON AIR PRODUCTS

715 POWELL AVE SE

HARTVILLE, OH

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: BRIAN RITENOUR - UCAKRHAR