


OIL ANALYSIS REPORT

Sample Rating Trend

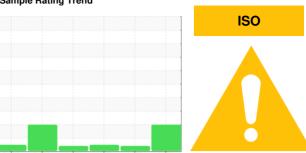

Machine Id

KAESER AIRCENTER SK 20 5856674 (S/N 1957)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Sep2017	Nov2018 Aug2021	Junž022 Aprž023	Apr2024	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA017141	KCP53048	KCP41344
Sample Date		Client Info		03 Apr 2024	14 Apr 2023	10 Jun 2022
Machine Age	hrs	Client Info		60712	55203	44817
Oil Age	hrs	Client Info		3000	3000	0
Oil Changed		Client Info		Changed	Changed	Changed
Sample Status				ABNORMAL	ABNORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	0
Titanium	ppm	ASTM D5185m	>3	<1	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>10	0	0	<1
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm	ASTM D5185m	>50	21	12	8
Tin	ppm	ASTM D5185m	>10	0	0	0
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	90	0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	<1	0
Magnesium	ppm	ASTM D5185m	90	6	19	20
Calcium	ppm	ASTM D5185m	2	0	<1	0
Phosphorus	ppm	ASTM D5185m		<1	<1	4
Zinc	ppm	ASTM D5185m		40	33	17
Sulfur	ppm	ASTM D5185m		20182	21127	20366
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1	0	<1
Sodium	ppm	ASTM D5185m		0	4	4
Potassium	ppm	ASTM D5185m	>20	<1	0	1
Water	%	ASTM D6304	>0.05	0.004	0.012	0.015
ppm Water	ppm	ASTM D6304	>500	42	125.5	156.7
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
FLUID CLEANLIN Particles >4μm	IESS	method ASTM D7647	limit/base	current 25049	history1	history2 4251
	IESS					
Particles >4μm	IESS	ASTM D7647		25049		4251
Particles >4μm Particles >6μm	IESS	ASTM D7647 ASTM D7647	>1300	25049 2 9271		4251 871
Particles >4μm Particles >6μm Particles >14μm	ESS	ASTM D7647 ASTM D7647 ASTM D7647	>1300 >80	25049 9271 753		4251 871 58
Particles >4μm Particles >6μm Particles >14μm Particles >21μm	ESS	ASTM D7647 ASTM D7647 ASTM D7647 ASTM D7647	>1300 >80 >20	25049 9271 753 179		4251 871 58 21
Particles >4μm Particles >6μm Particles >14μm Particles >21μm Particles >38μm	ESS	ASTM D7647 ASTM D7647 ASTM D7647 ASTM D7647 ASTM D7647	>1300 >80 >20 >4	25049		4251 871 58 21



OIL ANALYSIS REPORT

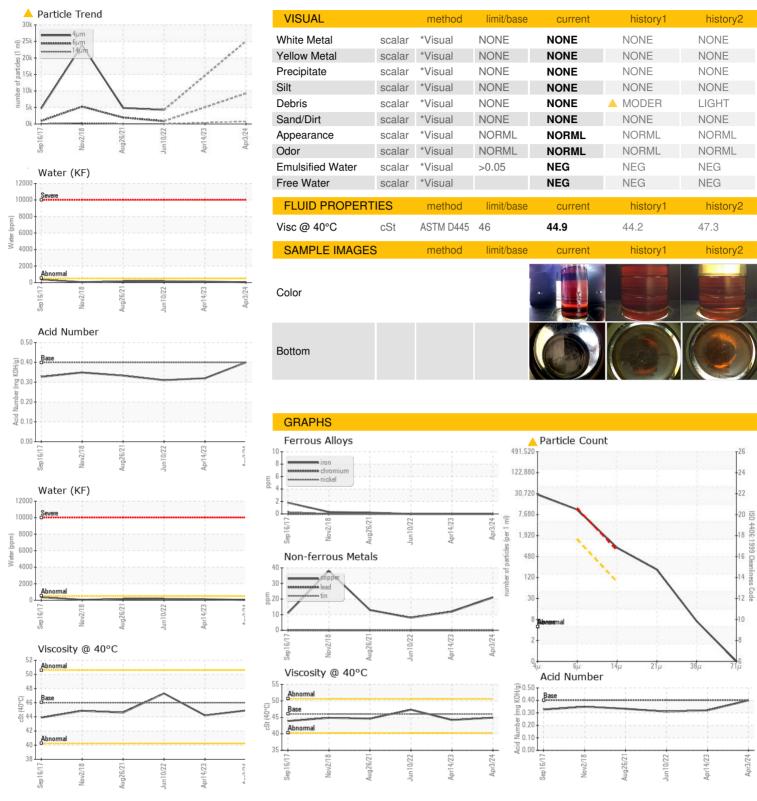





Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : KCPA017141 Lab Number : 06155959 Unique Number : 10991382

Received **Tested** Diagnosed

: 22 Apr 2024 : 23 Apr 2024 : 24 Apr 2024 - Don Baldridge **SAINT-GOBAIN NORTH AMERICA** 7201 DISTRIBUTION DR LOUISVILLE, KY

US 40258

Contact: Service Manager

Test Package : IND 2 (Additional Tests: KF, PrtCount) Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: SAILOUKC [WUSCAR] 06155959 (Generated: 04/24/2024 18:08:30) Rev: 1

Contact/Location: Service Manager - SAILOUKC

T:

F: