

Machine Id
GOODYEAR AKRON TEST 45
 Component
Hydraulic System
 Fluid
CONOCO MEGAFLOW AW 46 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. Due to an abnormal test result it is recommended to contact Stauff Corp at (201)-444-7800 for help resolving the issue.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			ST46151	ST44346	---
Sample Date	Client Info			21 Apr 2024	02 Jan 2023	---
Machine Age	hrs	Client Info		0	0	---
Oil Age	hrs	Client Info		0	0	---
Oil Changed	Client Info			N/A	N/A	---
Sample Status				ABNORMAL	ABNORMAL	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	2	2	---
Chromium	ppm	ASTM D5185m	>20	<1	0	---
Nickel	ppm	ASTM D5185m	>20	<1	0	---
Titanium	ppm	ASTM D5185m		<1	0	---
Silver	ppm	ASTM D5185m		0	0	---
Aluminum	ppm	ASTM D5185m	>20	2	0	---
Lead	ppm	ASTM D5185m	>20	<1	0	---
Copper	ppm	ASTM D5185m	>20	12	11	---
Tin	ppm	ASTM D5185m	>20	<1	0	---
Vanadium	ppm	ASTM D5185m		<1	0	---
Cadmium	ppm	ASTM D5185m		<1	0	---






ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	---
Barium	ppm	ASTM D5185m		<1	0	---
Molybdenum	ppm	ASTM D5185m		<1	0	---
Manganese	ppm	ASTM D5185m		0	0	---
Magnesium	ppm	ASTM D5185m		<1	0	---
Calcium	ppm	ASTM D5185m		24	20	---
Phosphorus	ppm	ASTM D5185m		343	288	---
Zinc	ppm	ASTM D5185m		350	284	---
Sulfur	ppm	ASTM D5185m		866	806	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1	<1	---
Sodium	ppm	ASTM D5185m		<1	1	---
Potassium	ppm	ASTM D5185m	>20	1	0	---
Water	%	ASTM D6304	>0.05	0.00	0.006	---
ppm Water	ppm	ASTM D6304	>500	0	63.4	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>640	▲ 8045	▲ 22819	---
Particles >6µm		ASTM D7647	>160	▲ 1651	▲ 6383	---
Particles >14µm		ASTM D7647	>20	▲ 148	▲ 534	---
Particles >21µm		ASTM D7647	>4	▲ 52	▲ 159	---
Particles >38µm		ASTM D7647	>3	▲ 6	▲ 14	---
Particles >71µm		ASTM D7647	>3	0	1	---
Oil Cleanliness		ISO 4406 (c)	>16/14/11	▲ 20/18/14	▲ 22/20/16	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.38	0.31	0.28	---


OIL ANALYSIS REPORT

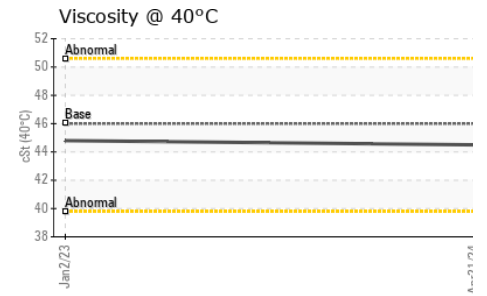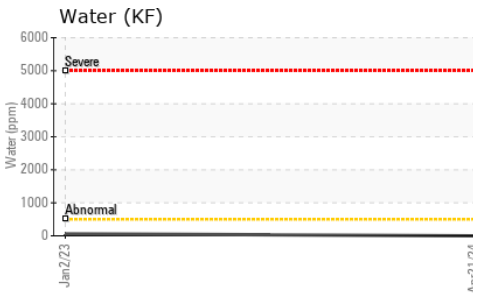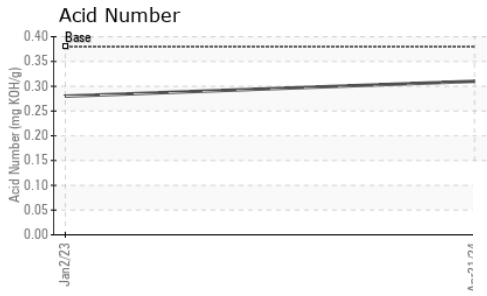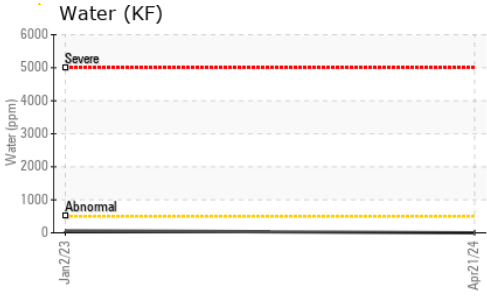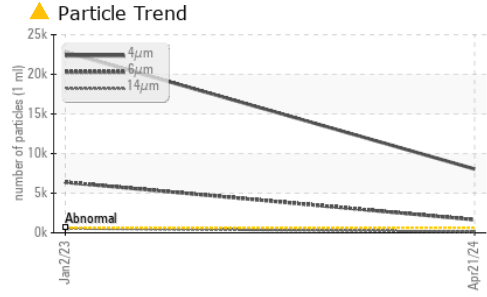





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46	44.5	44.8

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

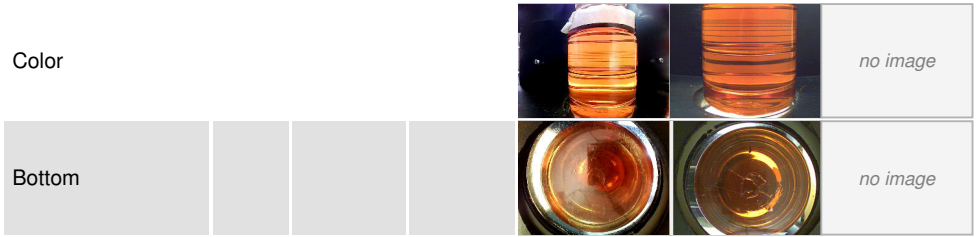

GRAPHS

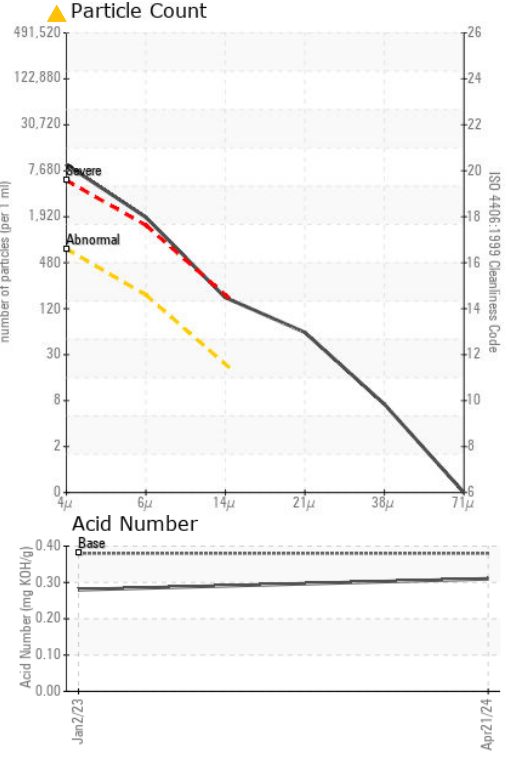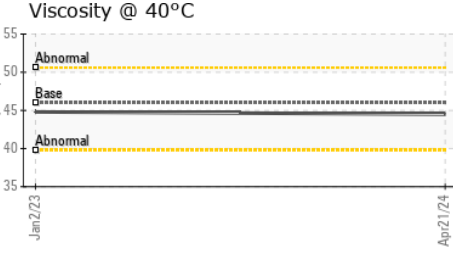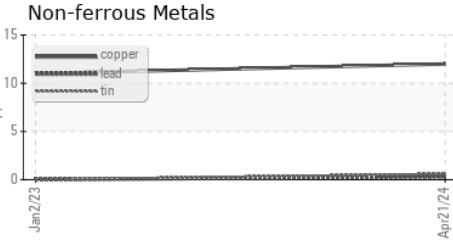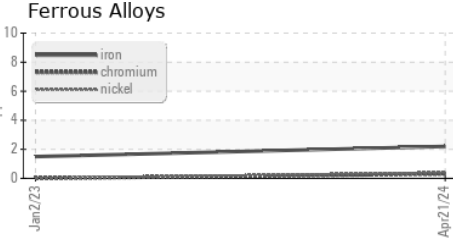

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : ST46151
Lab Number : 06155985
Unique Number : 10991408
Test Package : IND 2 (Additional Tests: KF)
Received : 22 Apr 2024
Tested : 23 Apr 2024
Diagnosed : 24 Apr 2024 - Jonathan Hester

FLUID POWER SOLUTIONS
 4400 Edgewyn Ave.
 Hilliard, OH
 US 43026

Contact: SCOTT ROGERS
 srogers@fluid-power-solutions.com
 T: (614)777-8954
 F: (614)777-8640