


OIL ANALYSIS REPORT



OKLAHOMA/102/EG - DOZER 35.103L [OKLAHOMA^102^EG - DOZER]

Right Final Drive

MOBIL MOBILTRANS HD 50 (108 GAL)

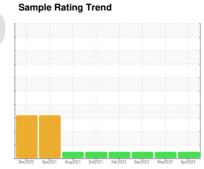



Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: 5340 hrs)

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
	,, (11OIV		mmodasc			
Sample Number		Client Info		WC0864433 09 Apr 2024	WC0864262 14 Mar 2024	WC0848938
Sample Date Machine Age	bro	Client Info		5340	5272	01 Sep 2023 4880
· ·	hrs					
Oil Age	hrs	Client Info		3495	3495	500
Oil Changed		Client Info		N/A	N/A	Not Change
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	1	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>800	70	86	63
Chromium	ppm	ASTM D5185m	>10	4	5	4
Nickel	ppm	ASTM D5185m	>5	0	2	<1
Titanium	ppm	ASTM D5185m	>15	<1	1	<1
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>75	5	6	5
_ead	ppm	ASTM D5185m	>10	0	1	0
Copper	ppm	ASTM D5185m	>75	0	<1	0
Tin	ppm	ASTM D5185m	>8	<1	<1	0
Vanadium	ppm	ASTM D5185m		0	<1	0
Cadmium	ppm	ASTM D5185m		0	<1	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		8	6	6
Barium	ppm	ASTM D5185m		0	1	0
Molybdenum	ppm	ASTM D5185m		4	6	3
Manganese	ppm	ASTM D5185m		1	2	<1
Magnesium	ppm	ASTM D5185m		32	31	35
Calcium	ppm	ASTM D5185m		3040	3499	3318
Phosphorus	ppm	ASTM D5185m		1084	1108	1089
Zinc	ppm	ASTM D5185m		1291	1355	1347
Sulfur	ppm	ASTM D5185m		14250	13797	14678
	рріні		1			
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>400	37	42	35
Sodium	ppm	ASTM D5185m		2	0	2
Potassium	ppm	ASTM D5185m	>20	1	4	3
VISUAL		method	limit/base	current	history1	history
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal		** " I	NONE	NONE	NONE	NONE
	scalar	*Visual				
Yellow Metal Precipitate Silt	scalar scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate Silt				NONE NONE	NONE NONE	NONE
Precipitate Silt Debris	scalar	*Visual	NONE			
Precipitate Silt Debris Sand/Dirt	scalar scalar	*Visual *Visual	NONE NONE	NONE	NONE	NONE
Precipitate Silt Debris Sand/Dirt Appearance	scalar scalar scalar	*Visual *Visual *Visual	NONE NONE	NONE NONE	NONE NONE	NONE NONE
Precipitate	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NONE NORML	NONE NONE NORML	NONE NONE NORML	NONE NONE NORML




OIL ANALYSIS REPORT

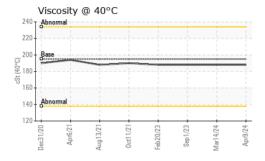



FLUID PROPE	RTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	195	188	188	188
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color				no image	no image	no image
Bottom				no image	no image	no image
GRAPHS						

Ferrous Alloys

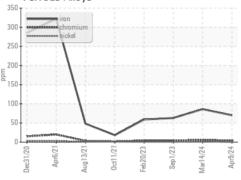

Non-ferrous Metals

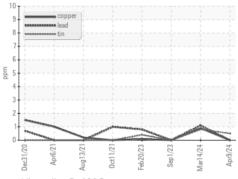

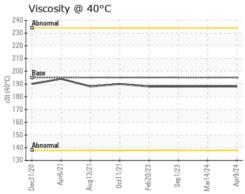





Certificate 12367

Laboratory

Sample No. : WC0864433 Lab Number : 06156363 Unique Number : 10991786 Test Package : CONST

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 22 Apr 2024 **Tested** Diagnosed

: 23 Apr 2024 : 24 Apr 2024 - Sean Felton

SHERWOOD CONSTRUCTION CO INC 3219 WEST MAY ST

WICHITA, KS US 67213

Contact: DOUG KING doug.king@sherwood.net T: (316)617-3161

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: SHEWIC [WUSCAR] 06156363 (Generated: 04/24/2024 18:20:31) Rev: 1

F: x: