


## **OIL ANALYSIS REPORT**

## NOT GIVEN **SULLAIR 201305100092 - GOLDEN ALTOS**

Component Compressor

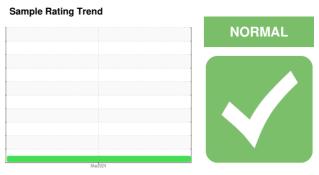

## DIAGNOSIS

## Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the


## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCS06159233		
Sample Date		Client Info		30 Mar 2024		
Machine Age	hrs	Client Info		33129		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>25	<1		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		415		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		4		
Phosphorus	ppm	ASTM D5185m		12		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		1380		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	NOITA	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.067		


# **Sullivan**


## **OIL ANALYSIS REPORT**

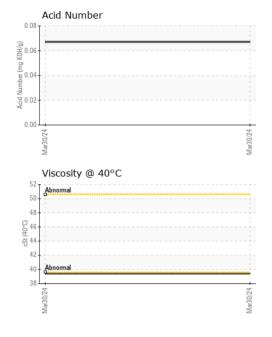



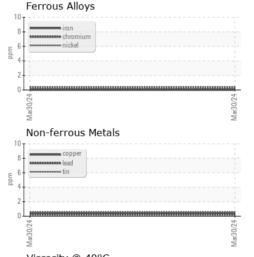

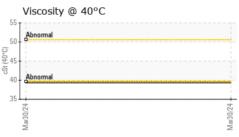

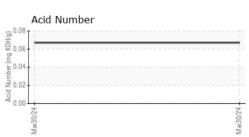

**COMPLETE ENGINEERED SOLUTIONS - CES** 





Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06159233 Unique Number : 10994656

: UCS06159233

Received **Tested** Diagnosed

: 24 Apr 2024 : 25 Apr 2024 : 26 Apr 2024 - Jonathan Hester

4772 FRONTIER WAY UNIT 400

STOCKTON, CA US 95215 Contact: CHRISTO GINGRAS

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

 $^st$  - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (800)701-3196 F: (209)753-4211

christo@complete-es.net