


OIL ANALYSIS REPORT

NOT GIVEN [SR3236563] ATLAS COPCO ITJ532911 - DOUGLAS CO PUBLIC WORKS

Component Compressor



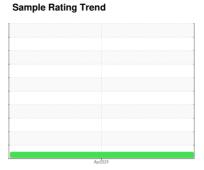

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06160491		
Sample Date		Client Info		18 Apr 2024		
Machine Age	hrs	Client Info		2540		
Oil Age	hrs	Client Info		2540		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	1		
Chromium	ppm	ASTM D5185m	>5	<1		
Nickel	ppm	ASTM D5185m		2		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	2		
Lead	ppm	ASTM D5185m	>65	<1		
Copper	ppm	ASTM D5185m	>65	<1		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		376		
Zinc	ppm	ASTM D5185m		31		
Sulfur	ppm	ASTM D5185m		514		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	5		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.23		




OIL ANALYSIS REPORT

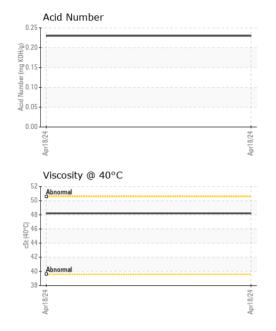






10	Non-ferrous Metals
8	copper sassassassas lead
mdd .	enancement tin
H 4	
2	ļ
0	
	Apr18/24

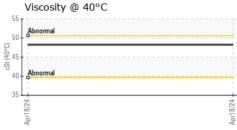

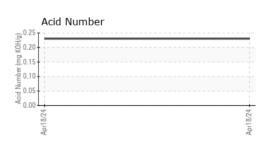





Certificate 12367

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06160491 Unique Number : 10995914

Test Package : IND 2

: UCH06160491

Received : 25 Apr 2024 **Tested** : 26 Apr 2024

Diagnosed : 26 Apr 2024 - Sean Felton

To discuss this sample report, contact Customer Service at 1-800-237-1369.

US 95816 Contact: BARRY FRKOVICH barryfrkovich@ciscoair.com T: (916)444-2525

CISCO AIR SYSTEMS

SACRAMENTO, CA

214 27TH ST

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCCISSAC [WUSCAR] 06160491 (Generated: 04/26/2024 14:02:30) Rev: 1

F: x: