

### **OIL ANALYSIS REPORT**

Sample Rating Trend



Machine Id

# JSF TCCEAU7211

Component Hydraulic System Fluid ANDEROL ROYCO 500 (30 GAL)

#### DIAGNOSIS

#### Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

#### Contamination

The system cleanliness is acceptable for your target cleanliness. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. Counts X100.

#### Fluid Condition

The condition of the oil is suitable for further service.


				Apr2024		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0928507		
Sample Date		Client Info		25 Apr 2024		
Machine Age	mls	Client Info		0		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	J	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	0		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm		>20	0		
Tin	ppm	ASTM D5185m	>20	<1		
Vanadium	ppm	ASTM D5185m	20	0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES	ppm		limit/base			
ADDITIVE5		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		963		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		0		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	8400		
Particles >6µm		ASTM D7647	>1300	2800		
Particles >14µm		ASTM D7647	>160	400		
Particles >21µm		ASTM D7647	>40	100		
Particles >38µm		ASTM D7647	>10	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	14/12/9		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.06	0.25		
31.03) Boy: 1	0 - 0					


Report Id: EATBET [WUSCAR] 06161405 (Generated: 04/29/2024 14:31:03) Rev: 1

Contact/Location: REINALDO CASTILLA - EATBET



## **OIL ANALYSIS REPORT**

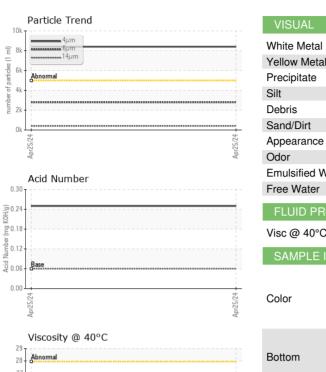

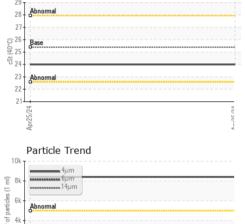

41 2

0k Apr25/24

NONE \*Visual NONE scalar Yellow Metal \*Visual NONE NONE scalar NONE scalar \*Visual NONE scalar \*Visual NONE NONE \*Visual NONE scalar NONE NONE NONE scalar \*Visual NORML NORML scalar \*Visual \*Visual NORML NORML scalar \*Visual **Emulsified Water** scalar >0.05 NEG scalar \*Visual NEG FLUID PROPERTIES Visc @ 40°C cSt ASTM D445 25.4 24.0 SAMPLE IMAGES no image no image no image no imade GRAPHS Ferrous Alloys Particle Count 491,52 122,88 mac 30.72 7.68 vpr25/24 (per 1 i 4406 1.92 :1999 Cle Non-ferrous Metals 480 120 14 31 214 Viscosity @ 40°C Acid Number 30 (<sup>0.30</sup> (<sup>0</sup>/HOX) Abno 28 () 26 Ê 0.18 zz 24 · 문 0.12 Abnormal 22 Ba Acid Ni 0.06 20 0.00 Apr25/24 . Apr/25/74 : WearCheck USA - 501 Madison Ave., Cary, NC 27513 EATON AEROSPACE LLC : WC0928507 Received : 26 Apr 2024 15 DURANT AVE Lab Number : 06161405 Tested : 29 Apr 2024 BETHEL, CT Unique Number : 10996828 Diagnosed : 29 Apr 2024 - Doug Bogart US 06801 Test Package : IND 2 Contact: REINALDO CASTILLA

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: EATBET [WUSCAR] 06161405 (Generated: 04/29/2024 14:31:04) Rev: 1

Certificate 12367

Laboratory

Sample No.

Contact/Location: REINALDO CASTILLA - EATBET

E:

T: (203)240-2520

reinaldocastilla@eaton.com