


OIL ANALYSIS REPORT

Sample Rating Trend

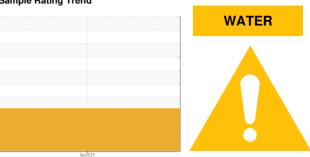

Machine Id

COMP A - MIDSOUTH (S/N STNU140900159)

Refrigeration Compressor

{not provided} (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

All component wear rates are normal.

Contamination

There is a trace of moisture present in the oil. Elemental level of silicon (Si) above normal indicating ingress of dirt/seal material.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0910528		
Sample Date		Client Info		18 Apr 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	0		
Chromium	ppm	ASTM D5185m	>2	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>3	0		
Lead	ppm	ASTM D5185m	>2	0		
Copper	ppm	ASTM D5185m	>8	<1		
Tin	ppm	ASTM D5185m	>4	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		249		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		53		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<u> </u>		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.01	<u> </u>		
opm Water	ppm	ASTM D6304	>100	<u> </u>		


0.015

Acid Number (AN)

mg KOH/g ASTM D974



OIL ANALYSIS REPORT

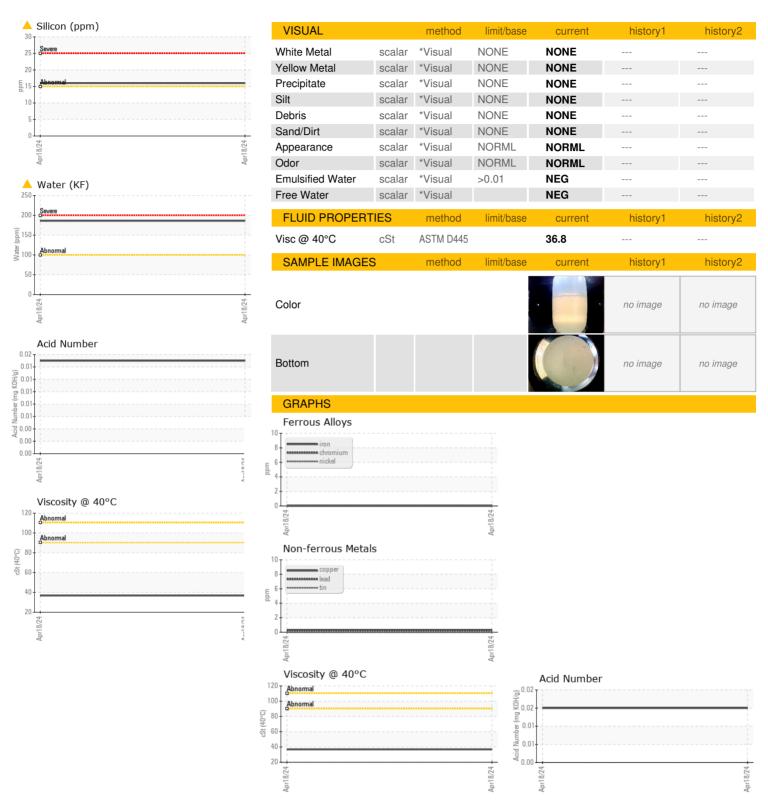





Certificate 12367

Laboratory Sample No.

: WC0910528 Lab Number : 06161590 Unique Number : 10997013 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 26 Apr 2024 **Tested** : 30 Apr 2024 Diagnosed

: 30 Apr 2024 - Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369. st - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Contact: JACK BLURTON jack.blurton@daikinapplied.com T: (504)206-8283

DAIKIN APPLIED - HARAHAN

1000 RIVERBEND DR

SAINT ROSE, LA

US 70087

F: x:

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) Report Id: MCQHAR [WUSCAR] 06161590 (Generated: 04/30/2024 20:41:13) Rev: 1

Contact/Location: JACK BLURTON - MCQHAR