


OIL ANALYSIS REPORT

AEON SP 900 GARDNER DENVER S416674 - TRAIL EZE

Component Compressor

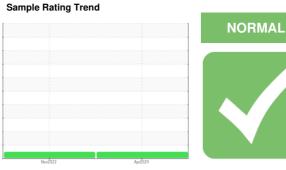

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			1012022	TOTAL T		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCS06161615	UCS05694111	
Sample Date		Client Info		17 Apr 2024	09 Nov 2022	
Machine Age	hrs	Client Info		23605	19942	
Oil Age	hrs	Client Info		4000	10000	
Oil Changed		Client Info		Not Changd	Changed	
Sample Status				NORMAL	NORMAL	
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	4	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m		0	0	
Titanium	ppm	ASTM D5185m		<1	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>25	0	<1	
Lead	ppm	ASTM D5185m	>25	0	0	
Copper	ppm	ASTM D5185m	>50	0	0	
Tin	ppm	ASTM D5185m	>15	0	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	<1	
Barium	ppm	ASTM D5185m	0	0	0	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m		<1	<1	
Magnesium	ppm	ASTM D5185m	0	0	0	
Calcium	ppm	ASTM D5185m	0	0	<1	
Phosphorus	ppm	ASTM D5185m	800	773	730	
Zinc	ppm	ASTM D5185m	0	0	<1	
Sulfur	ppm	ASTM D5185m	0	0	23	
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	0	
Sodium	ppm	ASTM D5185m		2	2	
Potassium	ppm	ASTM D5185m	>20	0	0	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	.170	0.41	0.60	

Sullivan


OIL ANALYSIS REPORT

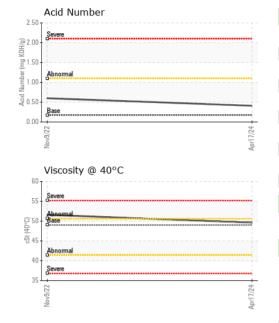





GRAPHS

Bottom

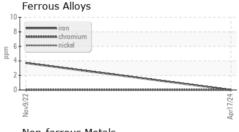



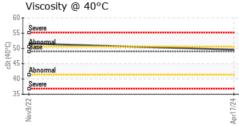

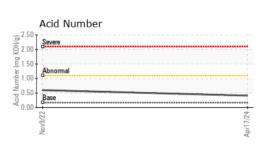





Certificate 12367

Laboratory Sample No.

Lab Number : 06161615

: UCS06161615 Unique Number : 10997038 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received **Tested**

Diagnosed : 30 Apr 2024 - Sean Felton

: 26 Apr 2024 : 29 Apr 2024

> US 57104 Contact: REUBEN tim@liftproequipment.com T: (605)339-6494

LIFT PRO EQUIPMENT CO

SIOUX FALLS, SD

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCLIFSIO [WUSCAR] 06161615 (Generated: 04/30/2024 11:52:24) Rev: 1

Contact/Location: REUBEN - UCLIFSIO

no image