


OIL ANALYSIS REPORT

CRESLINE PLASTIC PIPE DISTRIBUTION 2 - CRESLINE PLASTIC PIPE

Gearbox

GEAR OIL ISO 460 (--- QTS)

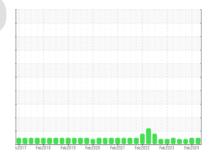

Sample Rating Trend



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0892722	WC0877709	WC0843832
Sample Date		Client Info		07 May 2024	01 Feb 2024	01 Nov 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	ABNORMAL
CONTAMINATIO	V	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	79	50	42
Chromium	ppm	ASTM D5185m	>15	<1	<1	<1
Nickel	ppm	ASTM D5185m	>15	<1	<1	<1
Titanium	ppm	ASTM D5185m		<1	<1	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	<1	1	<1
Lead	ppm	ASTM D5185m	>100	1	<1	<1
Copper	ppm	ASTM D5185m	>200	1	<1	<1
Tin	ppm	ASTM D5185m	>25	1	<1	0
Vanadium	ppm	ASTM D5185m		<1	<1	0
Cadmium	ppm	ASTM D5185m		<1	<1	<1
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	50	0	<1	<1
Barium	ppm	ASTM D5185m	15	0	0	2
Molybdenum	ppm	ASTM D5185m	15	1	<1	<1
Manganese	ppm	ASTM D5185m		1	<1	0
Magnesium	ppm	ASTM D5185m	50	<1	0	<1
Calcium	ppm	ASTM D5185m	50	0	0	2
Phosphorus	ppm	ASTM D5185m	350	413	314	263
Zinc	ppm	ASTM D5185m	100	0	0	0
Sulfur	ppm	ASTM D5185m	12500	2107	1244	1108
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	6	4	3
Sodium	ppm	ASTM D5185m		0	2	<1
Potassium	ppm	ASTM D5185m	>20	4	2	3
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.85	0.77	0.70	0.79



OIL ANALYSIS REPORT

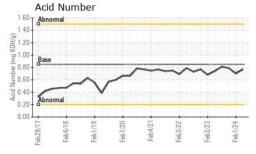

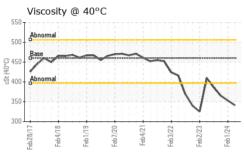


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	LIGHT	▲ MODER
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
	TEO.	ام مالم میر	li.ee i4/le e e e		المراجعة والمراجعة	histow.O


FLUID PHOPENTIES		memod			riistory i	HISTORYZ
Visc @ 40°C	cSt	ASTM D445	460	341	353	365


SAMPLE IMAGES


Color


Bottom

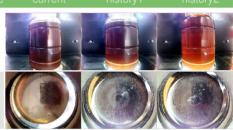

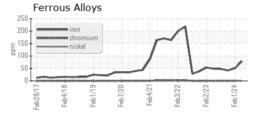

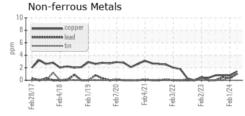

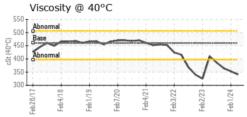

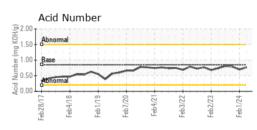





Certificate 12367

Laboratory Sample No.

Test Package : IND 2

: WC0892722 Lab Number : 06174001 Unique Number : 11020054

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 09 May 2024 **Tested** : 10 May 2024

Diagnosed : 12 May 2024 - Don Baldridge **MOTOR TECHNOLOGY INC**

515 WILLOW SPRINGS LN YORK, PA US 17406

Contact: Bill Trimmer btrimmer@motortechnologyinc.com

T: (717)266-4045

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: MOTYOR [WUSCAR] 06174001 (Generated: 05/12/2024 09:48:36) Rev: 1

Submitted By: Bill Trimmer