


OIL ANALYSIS REPORT

Sample Rating Trend

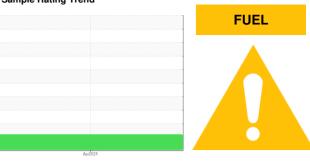

Machine Id

16E0007105

Diesel Engine

Fluid

{not provided} (--- GAL)

DIAGNOSIS

Recommendation

We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. The fluid was not specified, however, a fluid match indicates that this fluid is SAE 30 Diesel Engine Oil. Please confirm the oil type and grade, and specify the brand of the oil on your next sample. Please specify the component make and model with your next sample.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

				Apr2024		
CAMPLE INFORM	AATION		11 11 11			
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0911415		
Sample Date		Client Info		24 Apr 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	6		
Chromium	ppm	ASTM D5185m	>20	<1		
Nickel	ppm	ASTM D5185m	>4	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>20	<1		
Lead	ppm	ASTM D5185m	>40	3		
Copper	ppm	ASTM D5185m	>330	4		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		2		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		3		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		287		
Calcium	ppm	ASTM D5185m		2644		
Phosphorus	ppm	ASTM D5185m		1134		
Zinc	ppm	ASTM D5185m		1341		
Sulfur	ppm	ASTM D5185m		4952		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	4		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	0		
Fuel	%	ASTM D3524	>5	<u> </u>		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.1		
Nitration	Abs/cm	*ASTM D7624	>20	5.9		
Sulfation	Abs/.1mm	*ASTM D7415	>30	16.3		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	13.4		
Oxidation Base Number (BN)	Abs/.1mm mg KOH/g	*ASTM D7414 ASTM D2896	>25	13.4 10.5		



OIL ANALYSIS REPORT

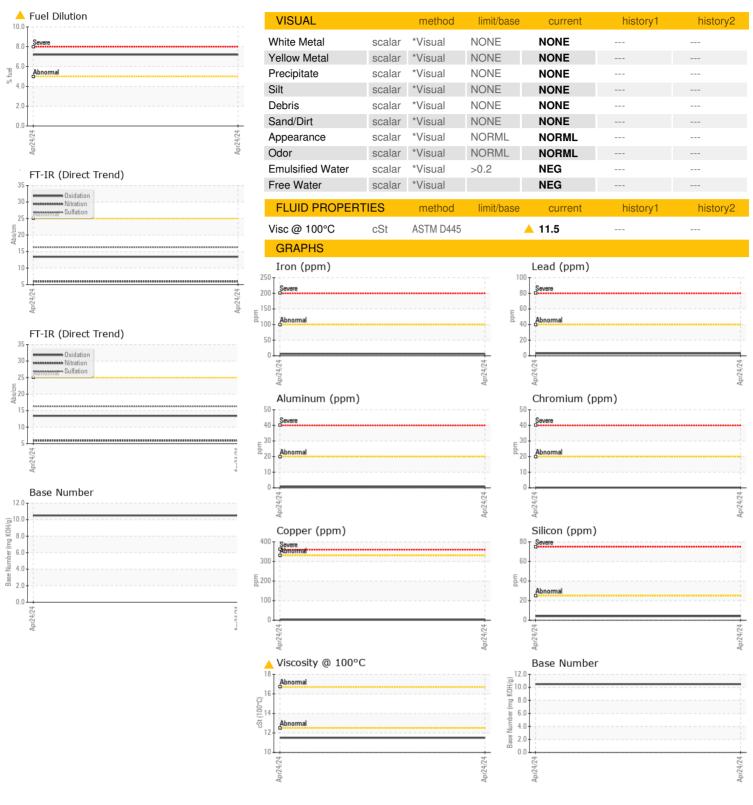





Certificate 12367

Laboratory

Sample No.

: WC0911415 Lab Number : 06193525

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Unique Number : 11050277

Received **Tested** Diagnosed

: 29 May 2024 : 31 May 2024

: 31 May 2024 - Wes Davis Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel, TBN)

5204 BEAR CREEK CT IRVING, TX US 75061 Contact: Service Manager

LOFTIN EQUIPMENT

servicemid@loftinequip.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. st - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: