


OIL ANALYSIS REPORT

S46 [286827] PNEUTECH AK100018474 - MSR PRECISION

Component Compressor

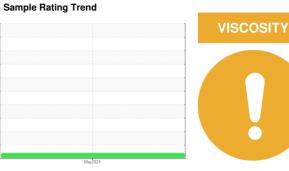

Recommendation

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The oil viscosity is higher than normal. The AN level is acceptable for this fluid.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UFD0001323		
Sample Date		Client Info		20 May 2024		
Machine Age	hrs	Client Info		7404		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ATTENTION		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0.9	0		
Barium	ppm	ASTM D5185m	0.1	1		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	0.2	0		
Magnesium	ppm	ASTM D5185m	0.9	<1		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	224	194		
Zinc	ppm	ASTM D5185m	0	13		
Sulfur	ppm	ASTM D5185m	273	272		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.103	0.23		





OIL ANALYSIS REPORT

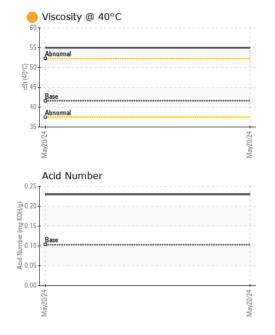

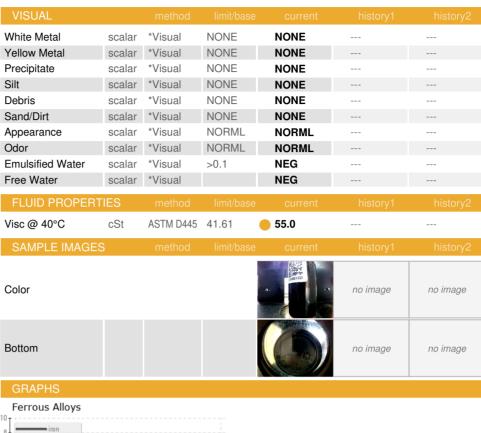

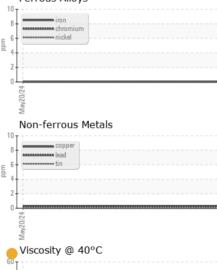

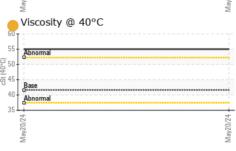

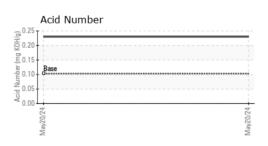





Certificate 12367

Laboratory Sample No.

Lab Number : 06202912

: UFD0001323 Unique Number : 11070373 Test Package : IND 2

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 07 Jun 2024 **Tested** : 10 Jun 2024

Diagnosed

: 10 Jun 2024 - Don Baldridge

US 60143 Contact: ED DIENER ed.diener@fluidairedynamics.com

FLUID-AIRE DYNAMICS

225 SPRING LAKE DR

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: ED DIENER - UCFLUSCH

T: (847)678-8388

ITASCA, IL