


OIL ANALYSIS REPORT

Sample Rating Trend



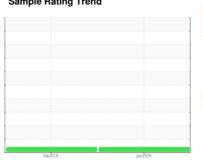

Machine Id

BLOWER 3

Component Compressor

CHEVRON CAPELLA OIL WF 68 (--- GAL)

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition


Viscosity of sample indicates oil is within ISO 46 range, advise investigate. Confirm oil type. The AN level is acceptable for this fluid.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0898044	WCI2345130	
Sample Date		Client Info		23 Jun 2024	19 Feb 2019	
Machine Age	hrs	Client Info		0	0	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		N/A	N/A	
Sample Status				ATTENTION	ATTENTION	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m		0	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>25	0	0	
Lead	ppm	ASTM D5185m	>25	0	1	
Copper	ppm	ASTM D5185m	>50	13	10	
Tin	ppm	ASTM D5185m	>15	0	0	
Antimony	ppm	ASTM D5185m			0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m	0	0	<1	
Calcium	ppm	ASTM D5185m		22	18	
Phosphorus	ppm	ASTM D5185m		320	283	
Zinc	ppm	ASTM D5185m		408	359	
Sulfur	ppm	ASTM D5185m		4227	4316	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	3	12	
Sodium	ppm	ASTM D5185m		2	<1	
Potassium	ppm	ASTM D5185m	>20	0	<1	
Water	%	ASTM D6304	>0.1	NEG	NEG	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.40	0.471	




OIL ANALYSIS REPORT

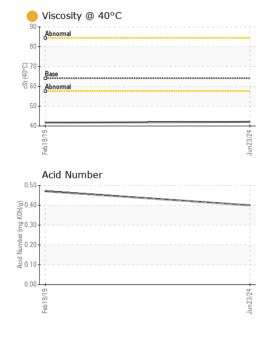

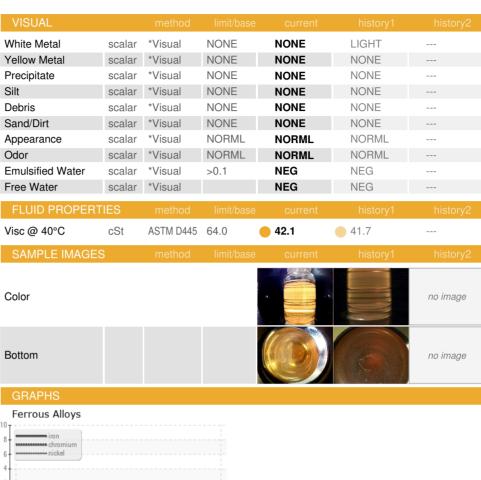

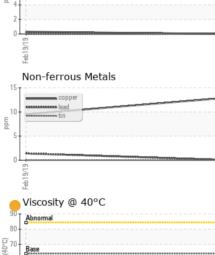

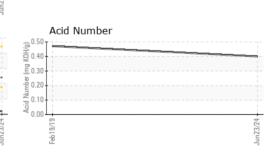





Laboratory Sample No.

: WC0898044 Lab Number : 06218346

Feb19/18

50

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received **Tested** Unique Number : 11096543

: 24 Jun 2024 Diagnosed

: 26 Jun 2024 : 26 Jun 2024 - Don Baldridge

LAMB WESTON/RDO PO BOX 552 PARK RAPIDS, MN US 56470 Contact: MICHAEL GRUIS

michael.gruis@lambweston.com

T: (218)732-2188 F: (218)732-2175

Test Package : IND 2 (Additional Tests: KF) Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

 st - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: LAMPAR [WUSCAR] 06218346 (Generated: 06/30/2024 14:34:40) Rev: 1

Contact/Location: MICHAEL GRUIS - LAMPAR