

## FUEL REPORT

### Area HIGHLANDS CASHIERS HOSPITAL [17711] [HIGHLANDS CASHIERS HOSPITAL] HVAC

Diesel Fuel Fluid

No.2 DIESEL FUEL (ULTRALOW SULPHUR) (12000 GAL)

#### DIAGNOSIS

#### Recommendation

We advise that you follow the water drain-off procedure for this component, and use off-line filtration to improve the cleanliness of the system fluid. We were unable to perform a particle count due to a high concentration of particles present in this sample.

#### Corrosion


All metal levels are normal indicating no corrosion in the system.

#### Contaminants

Free water present. Moderate concentration of visible dirt/debris present in the fuel. There is no bacteria or fungus (yeast and/or mold) present in the sample.

#### **Fuel Condition**

Sulfur value derived by ASTM D5453 method for ULSD validation. Sulfur level is acceptable for ULSD specification.

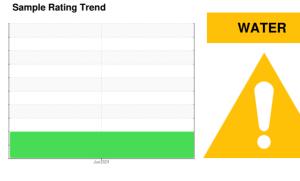


SAMPLE INFORM	<b>IATION</b>	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0957792		
Sample Date		Client Info		23 Jun 2024		
Machine Age	hrs	Client Info		0		
Sample Status				ABNORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
Fuel Color	text	*Visual Screen	Yllow	Red		
ASTM Color	scalar	*ASTM D1500		L4.0		
Visc @ 40°C	cSt	ASTM D445	3.0	2.36		
Pensky-Martens Flash Point	°C	*PMCC Calculated	52	59		
SULFUR CONTER	NT	method	limit/base	current	history1	history2
Sulfur		ASTM D5185m	10	0	motory	motory
Sulfur (UVF)	ppm	ASTM D5185III ASTM D5453	10	7		
	ppm	ASTIVI D0400		1		
DISTILLATION		method	limit/base	current	history1	history2
Initial Boiling Point	°C	ASTM D86	165	170		
5% Distillation Point	°C	ASTM D86		190		
10% Distill Point	°C	ASTM D86	201	200		
15% Distillation Point	°C	ASTM D86		208		
20% Distill Point	°C	ASTM D86	216	215		
30% Distill Point	°C	ASTM D86	230	230		
40% Distill Point	°C	ASTM D86	243	244		
50% Distill Point	°C	ASTM D86	255	258		
60% Distill Point	°C	ASTM D86	267	272		
70% Distill Point	°C	ASTM D86	280	287		
80% Distill Point	°C	ASTM D86	295	303		
85% Distillation Point	°C	ASTM D86		314		
90% Distill Point	°C	ASTM D86	310	325		
95% Distillation Point	°C	ASTM D86		343		
Final Boiling Point	°C	ASTM D86	341	357		
IGNITION QUALIT	ΓY	method	limit/base	current	history1	history2
API Gravity		ASTM D7777	37.7	37		
Cetane Index		ASTM D4737	<40.0	49		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	1		
Potassium	ppm	ASTM D5185m	<0.1	<1		
Water	%	ASTM D6304	< 0.05	0.005		
ppm Water	ppm	ASTM D6304	<500	55		
% Gasoline	%	*In-House	<0.50	0.0		
% Biodiesel	%	*In-House	<20.0	0.0		
MICROBIAL		method	limit/base	current	history1	history2
Bacteria	CFU/ml	WC-Method	>=100000	0		
Yeast	CFU/ml	WC-Method	>=100000	0		
Mold	Colonies	WC-Method	MODER			



# **FUEL REPORT**

1200	Water (KF)	
1000	Severe	
(E 800		
Water (ppm)	Abnormal	
\$ 400 200		
0	4	4
	Jun23/24	Jun23/24
	Viscosity @ 40°C	



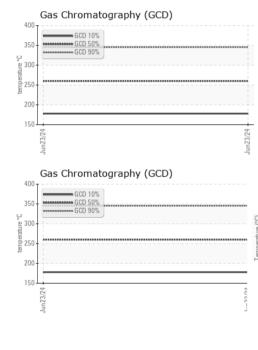


HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	0		
Nickel	ppm	ASTM D5185m	<0.1	<1		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	0		
Iron	ppm	ASTM D5185m	<0.1	0		
Calcium	ppm	ASTM D5185m	<0.1	0		
Magnesium	ppm	ASTM D5185m	<0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	0		
Zinc	ppm	ASTM D5185m	<0.1	0		

limit/base


method


Color

SAMPLE IMAGES

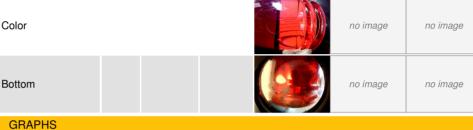


current

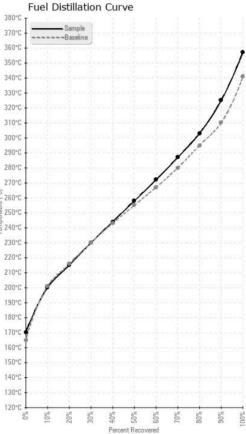

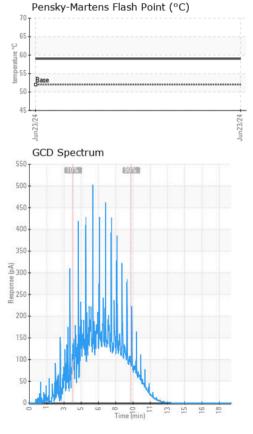

history1

history2

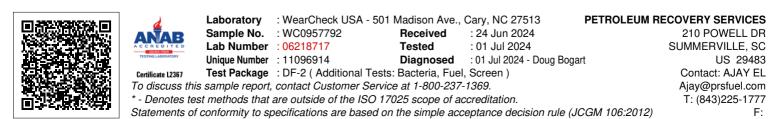

Report Id: PETSUM [WUSCAR] 06218717 (Generated: 07/02/2024 04:14:28) Rev: 1

Contact/Location: AJAY EL - PETSUM

Page 2 of 2