

# **PROBLEM SUMMARY**


Sample Rating Trend

**DEGRADATION** 

# **BRABAZON FG 8000 SULLAIR VS200SL 201108260009 - PROAMPAC**

Component Compressor



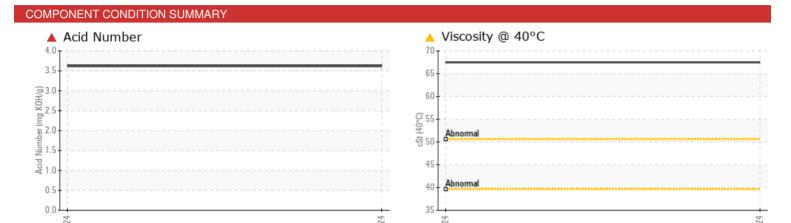

#### RECOMMENDATION

We advise that you check for a possible overheat condition. Recommend drain oil if not already done and flush with cleaner before refilling with oil. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS									
Sample Status				SEVERE					
Acid Number (AN)	mg KOH/g	ASTM D8045		<b>▲</b> 3.62					
Visc @ 40°C	cSt	ASTM D445		<b>67.5</b>					

Customer Id: UCZORGRE Sample No.: UCZ06220414 Lab Number: 06220414 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	Recommend drain oil if not already done and flush with cleaner before refilling with oil.		
Flush System			?	Recommend drain oil if not already done and flush with cleaner before refilling with oil.		
Resample			?	We recommend an early resample to monitor this condition.		
Check For Overheating			?	We advise that you check for a possible overheat condition.		


# HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

# **BRABAZON FG 8000** SULLAIR VS200SL 201108260009 - PROAMPAC

Component Compressor

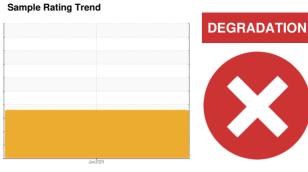



### DIAGNOSIS

#### ▲ Recommendation

We advise that you check for a possible overheat condition. Recommend drain oil if not already done and flush with cleaner before refilling with oil. We recommend an early resample to monitor this condition.

#### Wear

All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the


#### ▲ Fluid Condition

The oil viscosity is higher than normal. The AN level is above the recommended limit. TAN level indicates possible presence of varnish.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCZ06220414		
Sample Date		Client Info		20 Jun 2024		
Machine Age	hrs	Client Info		94708		
Oil Age	hrs	Client Info		3522		
Oil Changed		Client Info		N/A		
Sample Status				SEVERE		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	5		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		287		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		116		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	<1		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	2		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		▲ 3.62		



## **OIL ANALYSIS REPORT**

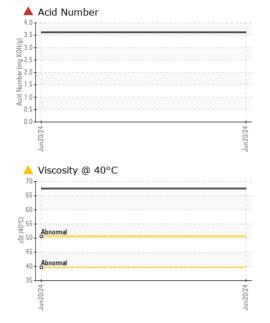






Color no image no image **Bottom** no image no image **GRAPHS** 

# Ferrous Alloys



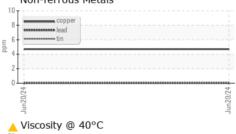

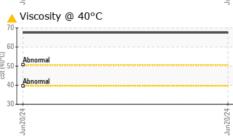

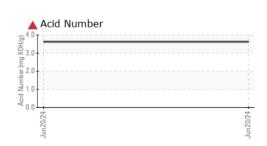





Certificate 12367

Laboratory Sample No.

Lab Number : 06220414

: UCZ06220414 Unique Number : 11098611

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 25 Jun 2024 **Tested** : 26 Jun 2024 Diagnosed

: 27 Jun 2024 - Angela Borella

**ZORN COMP & EQUIPMENT CO (GB)** 733 POTTS AVE GREEN BAY, WI US 54304

Contact: DEAN SCHAD dean.schad@zornair.com

> T: (920)391-8121 F: (920)499-1168

Contact/Location: DEAN SCHAD - UCZORGRE

Test Package : IND 2 To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)