


# **OIL ANALYSIS REPORT**

Sample Rating Trend

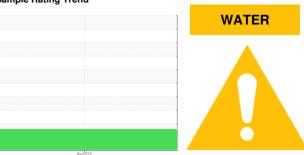

Machine Id

# DAIKIN YONDER CH 5 COMP 2 (S/N STNU230200195)

Component
Refrigeration Compressor

{not provided} (--- GAL)

### DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is a light concentration of water present in the oil. The amount and size of particulates present in the system are acceptable.

### **Fluid Condition**

Viscosity of sample indicates oil is within ISO 68 range, advise investigate. Confirm oil type. The condition of the oil is acceptable for the time in service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0798528		
Sample Date		Client Info		24 Apr 2024		
Machine Age	hrs	Client Info		5		
Oil Age	hrs	Client Info		5		
Oil Changed		Client Info		Not Changd		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	0		
Chromium	ppm	ASTM D5185m	>2	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>50	2		
Lead	ppm	ASTM D5185m	>2	0		
Copper	ppm	ASTM D5185m	>100	<1		
Tin	ppm	ASTM D5185m	>4	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		<1		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		1396		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		0		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	34		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.02	<u> </u>		
ppm Water	ppm	ASTM D6304	>250	<b>409</b>		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2


Acid Number (AN)

mg KOH/g ASTM D974

0.014



## **OIL ANALYSIS REPORT**

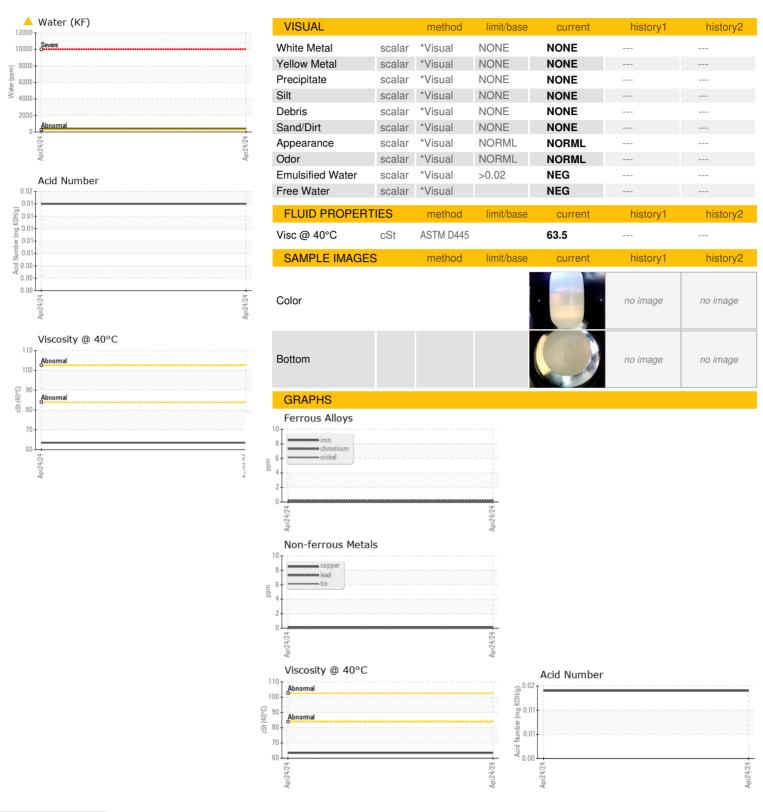





Certificate 12367

Laboratory Sample No.

Lab Number : 06221313 Unique Number : 11099510

: WC0798528 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 26 Jun 2024 **Tested** 

Diagnosed

: 27 Jun 2024 : 28 Jun 2024 - Angela Borella

**DAIKIN APPLIED** 5021 HOWERTON WAY SUITE P BOWIE, MD US 20715

Contact: ANDREW TURLINGTON andrew.turlington@daikinapplied.com T: (301)735-1440

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (301)735-1838 Contact/Location: ANDREW TURLINGTON - MCQUPP