

PROBLEM SUMMARY

Sample Rating Trend


ISO

KAESER SK15 7520895 (S/N 1647)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

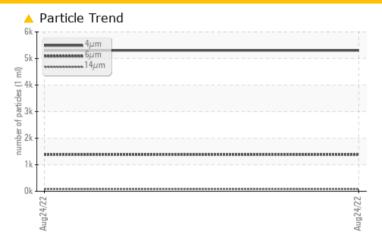

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS Sample Status **ATTENTION** Particles >6µm ASTM D7647 >1300 **1380** Particles >14µm ASTM D7647 >80 ISO 4406 (c) >--/17/13 **20/18/14** Oil Cleanliness

Customer Id: OMRDFW Sample No.: KCP48394 Lab Number: 05633635 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample

Sample Rating Trend

ISO

Maabina la

KAESER SK15 7520895 (S/N 1647)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug2022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP48394		
Sample Date				24 Aug 2022		
Machine Age	hrs			1978		
Oil Age	hrs			1978		
Oil Changed				Not Changd		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	<1		
Copper	ppm	ASTM D5185m	>50	2		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	8		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	90	36		
Calcium	ppm	ASTM D5185m	2	1		
Phosphorus	ppm	ASTM D5185m		5		
Zinc	ppm	ASTM D5185m		4		
Sulfur	ppm	ASTM D5185m		18165		
CONTAMINANTS	3	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	17		
Water	%	ASTM D6304	>0.05	0.024		
ppm Water	ppm	ASTM D6304	>500	243.6		
FLUID CLEANLIN	IESS	method	limit/base	current	history 1	history 2
Particles >4µm		ASTM D7647		5302		
Particles >6µm		ASTM D7647	>1300	1380		
Particles >14µm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	15		
Particles >38µm		ASTM D7647	>4	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/18/14		
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2
A : 1 N	1/011/	ACTM DODAE		0.20		


Acid Number (AN)


mg KOH/g ASTM D8045 0.4

0.30



OIL ANALYSIS REPORT

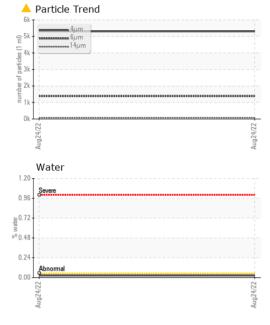

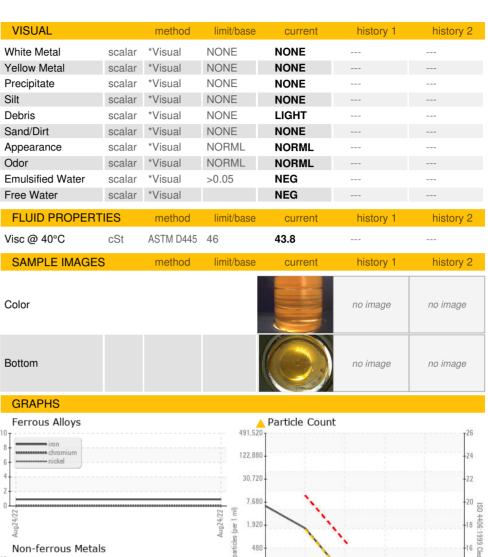

120

0.50 W 0.40 E 0.30 월 0.20 0.10 0.00

Acid Number





Laboratory Sample No. Lab Number **Unique Number**

: KCP48394 : 05633635 : 10118156

Viscosity @ 40°C

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 02 Sep 2022 : 06 Sep 2022 Diagnosed

Diagnostician : Doug Bogart Test Package : IND 2 (Additional Tests: KF, PrtCount)

DFW AIRPORT, TX USA 75261 Contact: Service Manager

2801 ROCHELLE RD

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

OMRA

T: F: