

PROBLEM SUMMARY

KAESER AS 36 3610604


Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

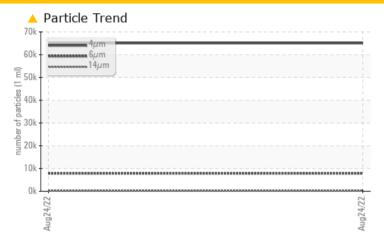

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6μm	ASTM D7647	>1300	^ 7864						
Particles >14μm	ASTM D7647	>80	239						
Particles >21µm	ASTM D7647	>20	<u>^</u> 24						
Oil Cleanliness	ISO 4406 (c)	>/17/13	23/20/15						

Customer Id: BRELAM Sample No.: KC102936 Lab Number: 05636556 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter			?	We recommend you service the filters on this component.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO

Machine Id

KAESER AS 36 3610604

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug ² 022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KC102936		
Sample Date				24 Aug 2022		
Machine Age	hrs			123127		
Oil Age	hrs			2336		
Oil Changed				Not Changd		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	2		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	3		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m	>10	0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES	' '	method	limit/base	current	history 1	history 2
Boron	nnm	ASTM D5185m	minu bass	0		
Barium	ppm	ASTM D5185m	90	0		
	ppm		90	0		
Monganasa	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m	90	-		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		394		
Zinc	ppm	ASTM D5185m		25		
CONTAMINANTS		method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.008		
ppm Water	ppm	ASTM D6304	>500	80.5		
FLUID CLEANLIN	IESS	method	limit/base	current	history 1	history 2
Particles >4µm		ASTM D7647		65038		
Particles >6µm		ASTM D7647	>1300	^ 7864		
Particles >14μm		ASTM D7647	>80	239		
Particles >21µm		ASTM D7647	>20	<u>^</u> 24		
Particles >38µm		ASTM D7647	>4	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	23/20/15		
FLUID DEGRADA	TION	method	limit/base	current	history 1	history 2
A stat Nicosale au (ANI)	1/011/	AOTH DOOLS	0.4			


0.19


Acid Number (AN)


mg KOH/g ASTM D8045 0.4



OIL ANALYSIS REPORT

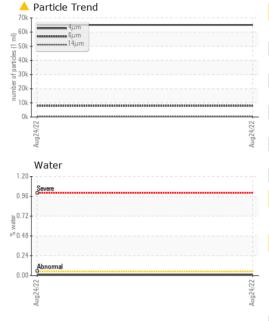

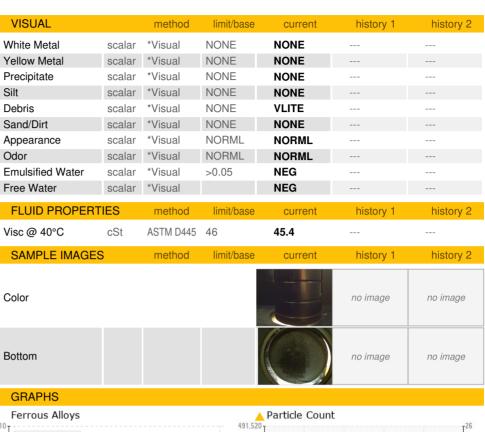

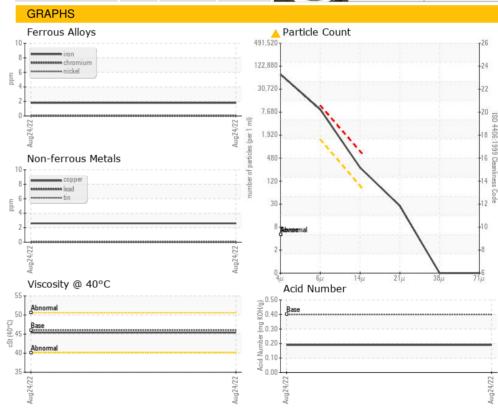



Certificate L2367

Laboratory Sample No. Lab Number

Unique Number Test Package : IND 2

: KC102936 : 05636556 : 10126086

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 08 Sep 2022 : 09 Sep 2022 : Don Baldridge Diagnostician

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

BREEN COLOR 11 KARI DR LAMBERTVILLE, NJ USA 08530

Contact:

T: F: