

PROBLEM SUMMARY


Sample Rating Trend

WEAR

KAESER SK 15T 5648101 (S/N 1698)


Compressor

KAESER SIGMA (OEM) FG-460 (--- GAL)

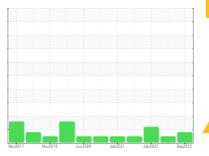



COMPONENT CONDITION SUMMARY

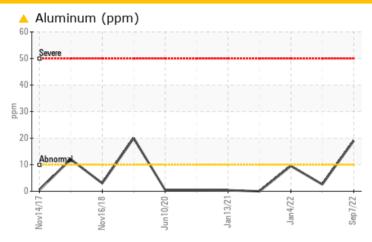

RECOMMENDATION

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS							
Sample Status				ABNORMAL	NORMAL	ATTENTION	
Aluminum	ppm	ASTM D5185m	>10	<u> </u>	3	10	

Customer Id: BALENG Sample No.: KC89536 Lab Number: 05646071 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Fluid			?	Oil and filter change at the time of sampling has been noted.
Change Filter			?	Oil and filter change at the time of sampling has been noted.

HISTORICAL DIAGNOSIS

06 May 2022 Diag: Don Baldridge

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



04 Jan 2022 Diag: Doug Bogart

ISO



No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

03 May 2021 Diag: Jonathan Hester

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend



KAESER SK 15T 5648101 (S/N 1698)

Compressor

KAESER SIGMA (OEM) FG-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

The aluminum level is abnormal. All other component wear rates are normal.

Contamination

There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Nov2017	Nov2018 Jun2020	Jan 2021 Jan 2022	Sep2022	
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KC89536	KC95508	KC89553
Sample Date				07 Sep 2022	06 May 2022	04 Jan 2022
Machine Age	hrs			13175	10306	10304
Oil Age	hrs			2870	3	5010
Oil Changed				Changed	Changed	Changed
Sample Status				ABNORMAL	NORMAL	ATTENTION
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	12	0	4
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	<1	0
Titanium	ppm	ASTM D5185m	>3	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>10	<u> </u>	3	10
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm	ASTM D5185m	>50	2	0	<1
Tin	ppm	ASTM D5185m	>10	0	<1	0
Antimony	ppm	ASTM D5185m				0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m		0	<1	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	0	<1
Magnesium	ppm	ASTM D5185m		0	6	2
Calcium	ppm	ASTM D5185m		0	2	<1
Phosphorus	ppm	ASTM D5185m	500	452	451	424
Zinc	ppm	ASTM D5185m		263	8	74
CONTAMINANTS	3	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	0	0	0
Sodium	ppm	ASTM D5185m		0	<1	4
Potassium	ppm	ASTM D5185m	>20	0	0	0
Water	%	ASTM D6304	>0.05	0.005	0.006	0.003
ppm Water	ppm	ASTM D6304	>500	53.6	67.6	33.4
FLUID CLEANLIN	IESS	method	limit/base	current	history 1	history 2
Particles >4µm		ASTM D7647		2516	1003	5423
Particles >6µm		ASTM D7647	>1300	522	401	<u>▲</u> 1394
Particles >14µm		ASTM D7647	>80	20	70	<u> </u>
Particles >21µm		ASTM D7647	>20	3	19	<u>▲</u> 41
Particles >38µm		ASTM D7647	>4	1	2	3
Particles >71µm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>/17/13	19/16/11	17/16/13	<u>▲</u> 18/14
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.5	0.99	1.65	1.244



OIL ANALYSIS REPORT

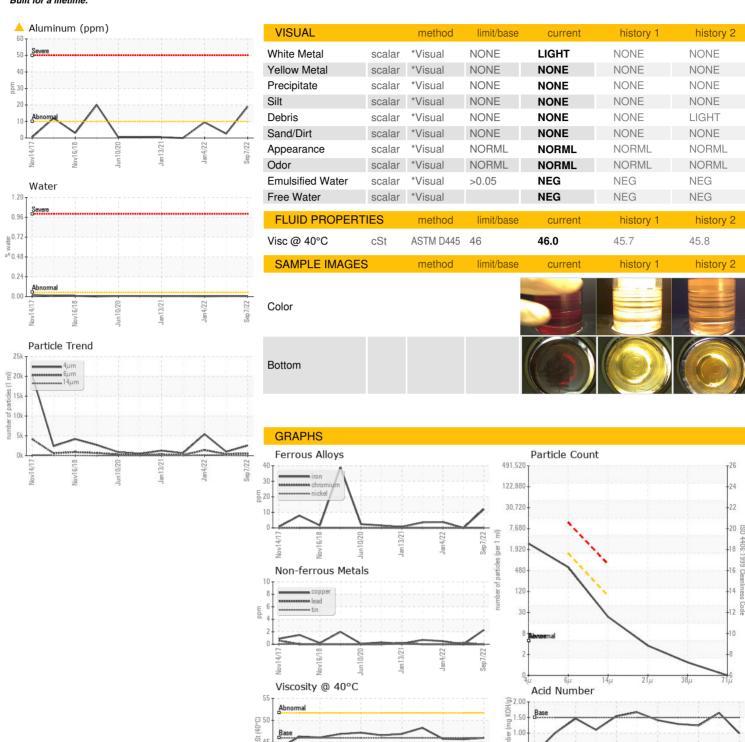





Certificate L2367

Laboratory Sample No.

Lab Number **Unique Number**

: KC89536 : 05646071 : 10140610 Test Package : IND 2

(2.0+) tS 45

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 20 Sep 2022 Received Diagnosed : 21 Sep 2022

Jan 13/21.

Jan 4/22

Diagnostician : Doug Bogart

00.00 PG

Sep7/22 -

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) **BALTHAZER BAKERY**

214 S DEAN ST ENGLEWOOD, NJ USA 07631

Contact:

T:

F: