

PROBLEM SUMMARY

Sample Rating Trend

ISO


7173666 (S/N 1006)

Component

Compressor

KAESER SIGMA (OEM) FG-460 (--- GAL)

COMPONENT CONDITION SUMMARY

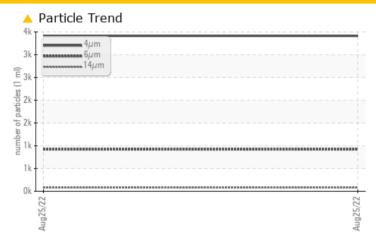

RECOMMENDATION

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC T	EST RESULTS				
Sample Status			ATTENTION	 	
Particles >14μm	ASTM D7647	>80	<u>▲</u> 81	 	
Oil Cleanliness	ISO 4406 (c)	>/17/13	19/17/14	 	

Customer Id: ENVLEV Sample No.: KCP51743 Lab Number: 05648341 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	Oil and filter change at the time of sampling has been noted.		
Change Filter			?	Oil and filter change at the time of sampling has been noted.		

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

7173666 (S/N 1006)

Compressor

KAESER SIGMA (OEM) FG-460 (--- GAL)

Sample Rating Trend ISO

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of particulates present in the oil.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug2022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP51743		
Sample Date				25 Aug 2022		
Machine Age	hrs			5805		
Oil Age	hrs			5805		
Oil Changed				Changed		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	6		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	<1		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	3		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	19		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m	500	174		
Zinc	ppm	ASTM D5185m		181		
Sulfur	ppm	ASTM D5185m		7872		
CONTAMINANTS	3	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.008		
ppm Water	ppm	ASTM D6304	>500	87.8		
FLUID CLEANLIN	NESS	method	limit/base	current	history 1	history 2
Particles >4μm		ASTM D7647		3413		
Particles >6µm		ASTM D7647	>1300	922		
Particles >14μm		ASTM D7647	>80	<u>▲</u> 81		
Particles >21µm		ASTM D7647	>20	17		
Particles >38μm		ASTM D7647	>4	2		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u> </u>		
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.5	0.49		



OIL ANALYSIS REPORT

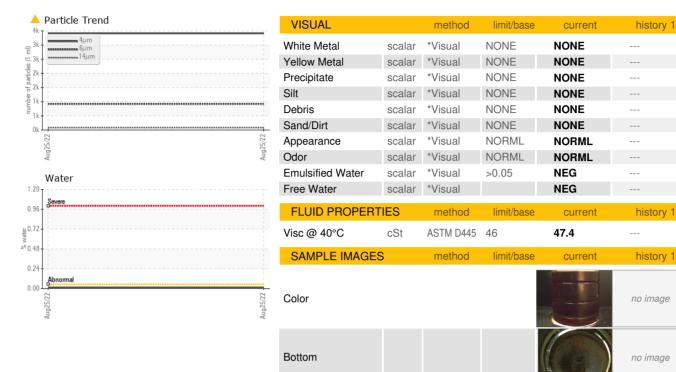

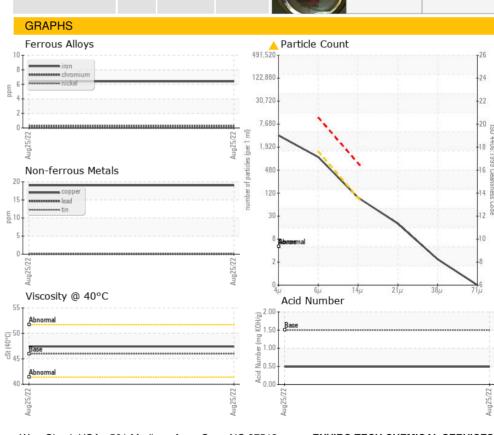





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KCP51743 : 05648341 : 10142880

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 22 Sep 2022 Diagnosed

: 24 Sep 2022 Diagnostician : Doug Bogart

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ENVIRO TECH CHEMICAL SERVICES

2119 PROGRESSIVE PL LEVELLAND, TX

USA 79336

history 2

history

history 2

no image

no image

Contact: Service Manager

T:

F: