

PROBLEM SUMMARY

Sample Rating Trend

ISO

KAESER BSD 60 7266230 (S/N 1607)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)





COMPONENT CONDITION SUMMARY



RECOMMENDATION

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL	ABNORMAL					
Particles >6μm	ASTM D7647	>1300	4 3925						
Particles >14μm	ASTM D7647	>80	4 347						
Particles >21µm	ASTM D7647	>20	48						
Oil Cleanliness	ISO 4406 (c)	>/17/13	2 1/19/16						

Customer Id: AMELOC Sample No.: KCP49267 Lab Number: 05648939 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Fluid			?	Oil and filter change at the time of sampling has been noted.			
Change Filter			?	Oil and filter change at the time of sampling has been noted.			

HISTORICAL DIAGNOSIS

04 Oct 2021 Diag: Doug Bogart

VIS DERRIS



No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend



KAESER BSD 60 7266230 (S/N 1607)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			Oct2021	Sep 2022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP49267	KCP39353	
Sample Date				09 Sep 2022	04 Oct 2021	
Machine Age	hrs			7544	3745	
Oil Age	hrs			3184	3745	
Oil Changed	1113			Changed	Changed	
Sample Status				ABNORMAL	ABNORMAL	
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	nnm	ASTM D5185m	>50	<1	<1	
Chromium	ppm	ASTM D5185m	>10	<1	0	
Nickel		ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m	>3	0	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm		>10	0	<1	
	ppm	ASTM D5185m ASTM D5185m	>10	4		
Lead	ppm			•	<1	
Copper	ppm	ASTM D5185m	>50	2	1	
Tin	ppm	ASTM D5185m	>10	<1	<1	
Antimony	ppm	ASTM D5185m			0	
Vanadium	ppm	ASTM D5185m		<1	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	0	<1	
Barium	ppm	ASTM D5185m	90	0	4	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m		<1	<1	
Magnesium	ppm	ASTM D5185m	100	56	72	
Calcium	ppm	ASTM D5185m	0	<1	0	
Phosphorus	ppm	ASTM D5185m	0	9	4	
Zinc	ppm	ASTM D5185m	0	2	0	
Sulfur	ppm	ASTM D5185m	23500	14783	15797	
CONTAMINANTS	İ	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	1	<1	
Sodium	ppm	ASTM D5185m		10	13	
Potassium	ppm	ASTM D5185m	>20	10	6	
Water	%	ASTM D6304	>0.05	0.034	0.026	
ppm Water	ppm	ASTM D6304	>500	340.8	267.4	
FLUID CLEANLIN	IESS	method	limit/base	current	history 1	history 2
Particles >4μm		ASTM D7647		11252		
Particles >6µm		ASTM D7647	>1300	4 3925		
Particles >14μm		ASTM D7647	>80	4 347		
Particles >21µm		ASTM D7647	>20	48		
Particles >38µm		ASTM D7647	>4	1		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	2 1/19/16		
FLUID DEGRADA	TION	method	limit/base	current	history 1	history 2
Acid Number (AN)	ma K∩⊔/a	VSTM D804E	1.0	0.42	0.357	



OIL ANALYSIS REPORT

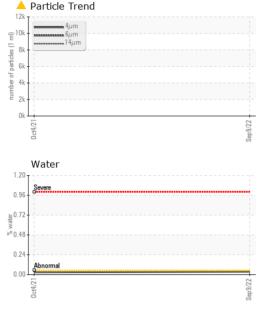

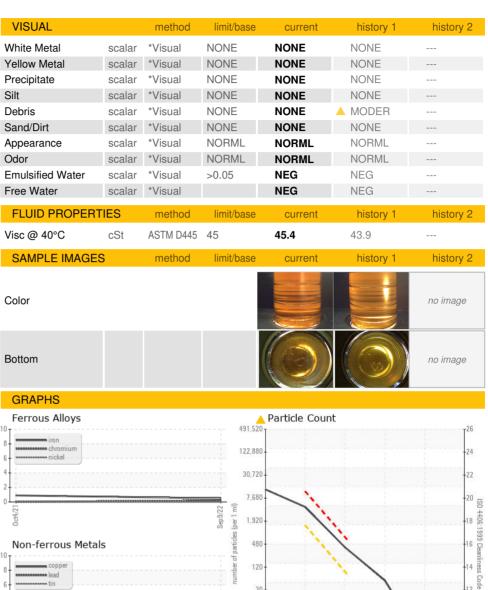





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KCP49267 : 05648939 : 10143478

ද්දු 45

40

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

: 22 Sep 2022 Diagnosed

: 26 Sep 2022 Diagnostician : Jonathan Hester

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

Viscosity @ 40°C

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) **AMERISOURCE BERGEN**

6301 LA SALLE DR LOCKBOURNE, OH USA 43137

Contact: Service Manager

T: F:

Acid Number

(B) 1.20 0.96 € 0.72

은 0.48

0.24 0.00