



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area  
**(GMN 477) City Of Mount Pearl [After 3 G2F]**  
Machine Id  
**INTERNATIONAL Dual Arm Garbage Truck, 20-14G**  
Component  
**Hydraulic System**  
Fluid  
**PETRO CANADA HYDREX AW 32 (239 LTR)**

**RECOMMENDATION**

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>OF0000322</b>	OF0000321	OF0000333
Sample Date		Client Info		<b>18 Oct 2021</b>	29 Jun 2021	12 Apr 2021
Machine Age	hrs	Client Info		<b>1027</b>	690	454
Oil Age	hrs	Client Info		<b>1027</b>	690	454
Filter Age	hrs	Client Info		<b>337</b>	236	167
Oil Changed		Client Info		<b>Not Chngd</b>	Not Chngd	Not Chngd
Filter Changed		Client Info		<b>Changed</b>	Changed	Changed
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>20	<b>2</b>	2	2
Chromium	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185(m)		<b>0</b>	0	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Lead	ppm	ASTM D5185(m)	>10	<b>0</b>	<1	<1
Copper	ppm	ASTM D5185(m)	>75	<b>2</b>	2	2
Tin	ppm	ASTM D5185(m)	>10	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**








The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185(m)	>20	<b>1</b>	1	4
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Water		WC Method	>0.1	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>5000	<b>1425</b>	711	1945
Particles >6µm		ASTM D7647	>1300	<b>230</b>	163	362
Particles >14µm		ASTM D7647	>160	<b>17</b>	10	25
Particles >21µm		ASTM D7647	>40	<b>5</b>	2	5
Particles >38µm		ASTM D7647	>10	<b>0</b>	0	0
Particles >71µm		ASTM D7647	>3	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>18/15/11</b>	17/15/10	18/16/12
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Boron	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	<1	<1
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	<1	<1
Calcium	ppm	ASTM D5185(m)	50	<b>44</b>	45	46
Phosphorus	ppm	ASTM D5185(m)	330	<b>318</b>	322	323
Zinc	ppm	ASTM D5185(m)	430	<b>389</b>	390	394
Sulfur	ppm	ASTM D5185(m)	760	<b>727</b>	727	722
Visc @ 40°C	cSt	ASTM D7279(m)	31.5	<b>31.6</b>	31.7	31.8

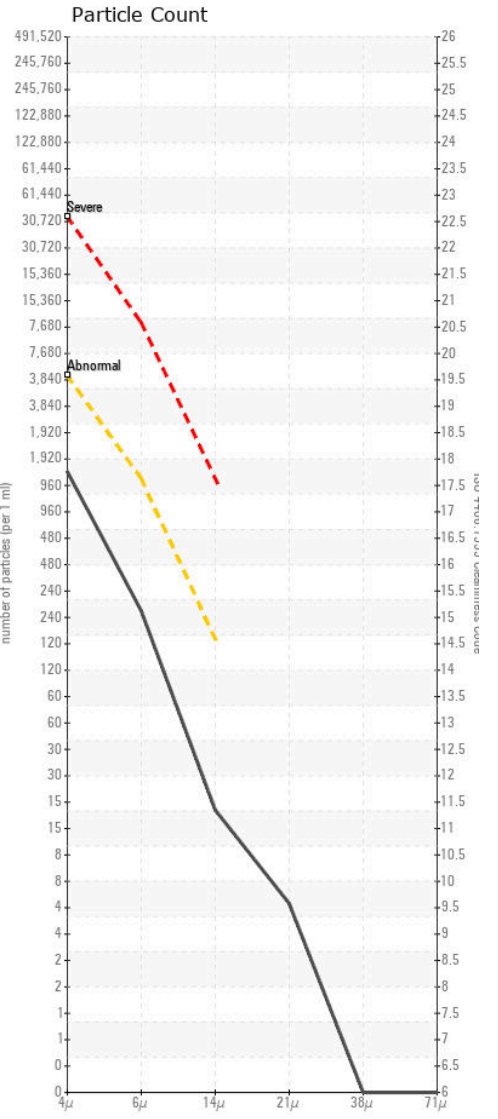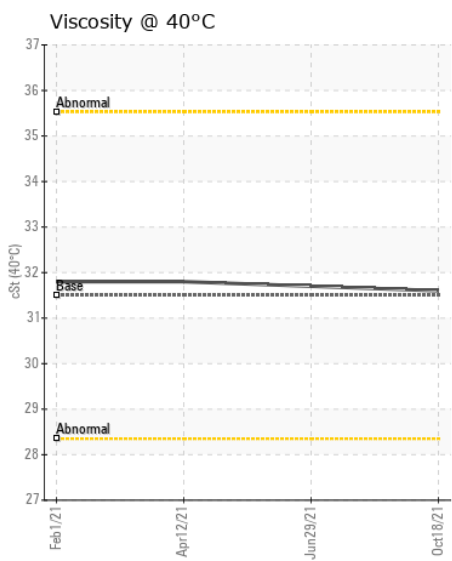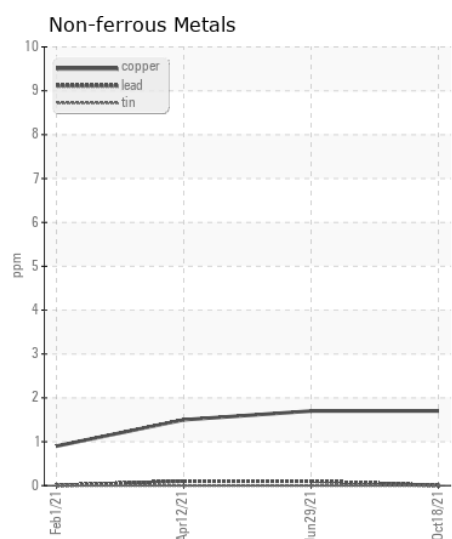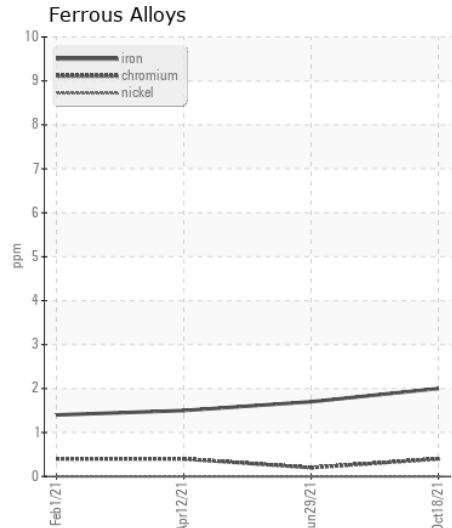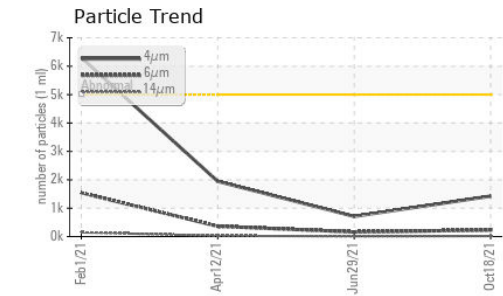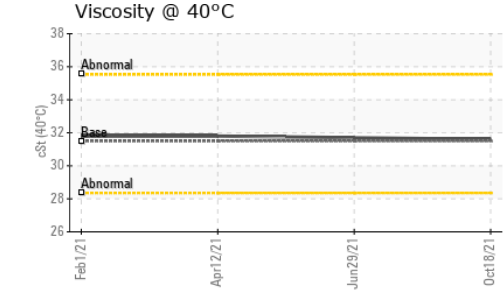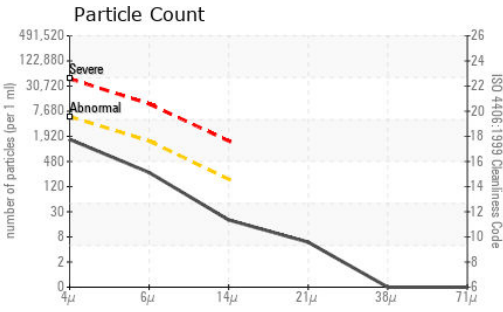

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : OF0000322 **Received** : 08 Apr 2022  
**Lab Number** : **02482420** **Tested** : 11 Apr 2022  
**Unique Number** : 5383357 **Diagnosed** : 11 Apr 2022 - Wes Davis  
**Test Package** : MOB 2

**Oil Filtration Solutions Ltd.**  
 PO BOX 16125  
 CONCEPTION BAY SOUTH, NL  
 CA A1X 2E2  
 Contact: BILL BUTLER  
 BBUTLER@OILFILTRATIONSOLUTIONS.COM  
 T: (709)834-8433  
 F: (709)834-8435

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.