
**WEAR** CONTAMINATION **FLUID CONDITION** 

**NORMAL NORMAL NORMAL** 

Machine Id

## 930 HORTOP PUMP #4 Component Diesel Engine

RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
Confirm the source of the lubricant being utilized for top-up/fill.  Resample at the next service interval to monitor. Please specify the component make and model with your next sample.	Sample Number		Client Info		wc		
	Sample Date		Client Info		29 Mar 2023		
	Machine Age	yrs	Client Info		0		
	Oil Age	yrs	Client Info		0		
	Filter Age	yrs	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				NORMAL		
VEAR	Iron	nnm	ASTM D5185(m)	>100	6		
All component wear rates are normal.	Chromium	ppm	ASTM D5185(III) ASTM D5185(m)		0		
	Nickel	ppm	ASTM D5185(m)		0		
	Titanium	ppm	ASTM D5185(m)	7	1		
	Silver	ppm	ASTM D5185(m)	>3	0		
	Aluminum	ppm	ASTM D5185(m)		<1		
	Lead	ppm	ASTM D5185(m)		2		
	Copper	ppm	ASTM D5185(m)		4		
	Tin	ppm	ASTM D5185(m)		<1		
	Vanadium	ppm	ASTM D5185(m)		0		
CONTAMINATION	Silicon	ppm	ASTM D5185(m)		4		
There is no indication of any contamination in the oil.	Potassium	ppm	ASTM D5185(m)		0		
	Fuel		WC Method		<1.0		
	Water		WC Method	>0.2	NEG		
	Glycol		WC Method		NEG		
	Soot %	%	ASTM D7844*		0		
	Nitration	Abs/cm	ASTM D7624*	>20	3.9		
	Sulfation	Abs/.1mm	ASTM D7415*	>30	15.4		
	Emulsified Water	scalar	Visual*	>0.2	NEG		
LUID CONDITION	Sodium	ppm	ASTM D5185(m)		<1		
Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.	Boron	ppm	ASTM D5185(m)	1	12		
	Barium	ppm	ASTM D5185(m)	1	0		
	Molybdenum	ppm	ASTM D5185(m)	1	4		
	Manganese	ppm	ASTM D5185(m)		0		
	Magnesium	ppm	ASTM D5185(m)	10	1202		
	Calcium	ppm	ASTM D5185(m)	3032	474		
	Phosphorus	ppm	ASTM D5185(m)	1054	1078		
	Zinc	ppm	ASTM D5185(m)	1332	1152		
	Sulfur	ppm	ASTM D5185(m)	3985	8897		
	Oxidation	Abs/.1mm	ASTM D7414*	>25	5.0		
	Visc @ 100°C	cSt	ASTM D7279(m)	15.4	14.8		

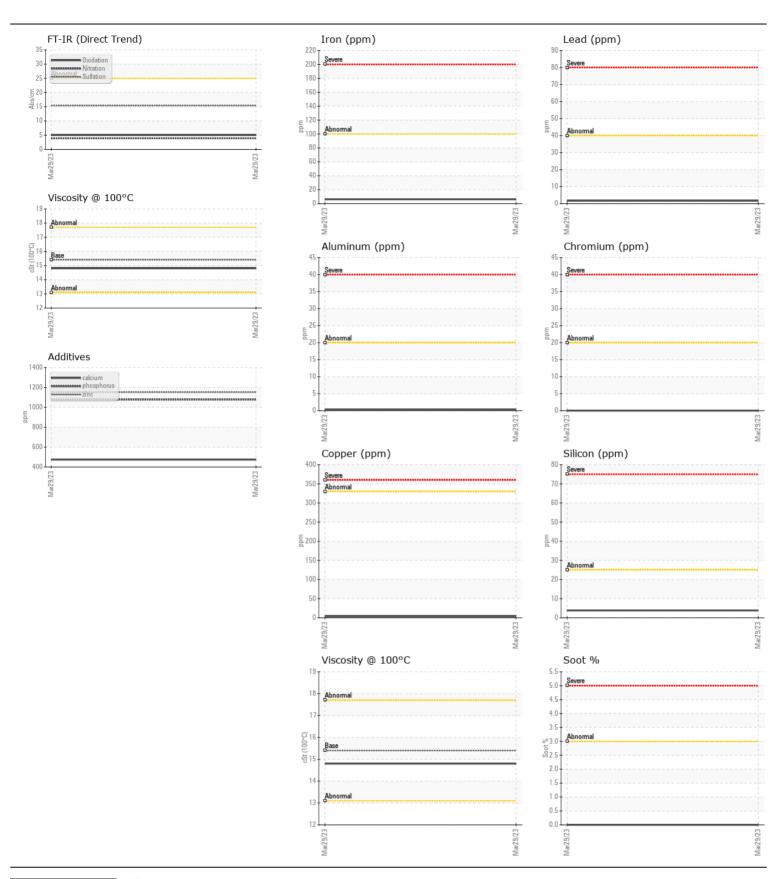



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC Lab Number : 02548600 Unique Number : 5553610 Test Package : MOB 1

Received **Tested** Diagnosed

: 30 Mar 2023 : 30 Mar 2023

: 31 Mar 2023 - Kevin Marson

NORTHERN GENERATOR CO. LTD. 80 ASHBRIDGE CIRCLE,, UNIT #1 & 2

WOODBRIDGE, ON CA L4L 3R5

Contact: Selome Afework selome@northerngenerator.com T: (905)264-9744

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied. F: (905)264-9714