



# OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>ABNORMAL</b>

Area  
**[6175285]**  
 Machine Id  
**5005-PR05-TAB05**  
 Component  
**Gearbox**  
 Fluid  
**DAVLEY DARMEX RPL-NT0140 (--- GAL)**

## RECOMMENDATION

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>CB0031470</b>	CB	CB
Sample Date		Client Info		<b>01 Sep 2023</b>	15 Sep 2022	13 Oct 2021
Machine Age	hrs	Client Info		<b>0</b>	0	0
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>N/A</b>	N/A	N/A
Filter Changed		Client Info		<b>N/A</b>	N/A	N/A
Sample Status				<b>ABNORMAL</b>	ABNORMAL	ABNORMAL

## WEAR

All component wear rates are normal.

PQ		ASTM D8184*		<b>0</b>	0	0
Iron	ppm	ASTM D5185(m)	>200	<b>1</b>	2	1
Chromium	ppm	ASTM D5185(m)	>15	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>15	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	<b>0</b>	0	0
Lead	ppm	ASTM D5185(m)	>100	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m)	>200	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>25	<b>0</b>	0	<1
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

## CONTAMINATION











The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Silicon	ppm	ASTM D5185(m)	>50	<b>2</b>	5	8
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	0	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Particles >4µm		ASTM D7647	>20000	<b>2936</b>	2016	17353
Particles >6µm		ASTM D7647	>5000	<b>421</b>	525	3191
Particles >14µm		ASTM D7647	>640	<b>20</b>	29	186
Particles >21µm		ASTM D7647	>160	<b>6</b>	5	41
Particles >38µm		ASTM D7647	>40	<b>0</b>	0	2
Particles >71µm		ASTM D7647	>10	<b>0</b>	0	0
Oil Cleanliness		ISO 4406 (c)	>21/19/16	<b>19/16/11</b>	18/16/12	21/19/15
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>VLITE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

## FLUID CONDITION

Viscosity of sample indicates oil is within ISO 220 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Boron	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)		<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Calcium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Phosphorus	ppm	ASTM D5185(m)		<b>150</b>	143	149
Zinc	ppm	ASTM D5185(m)		<b>11</b>	14	9
Sulfur	ppm	ASTM D5185(m)		<b>172</b>	53	99
Acid Number (AN)	mg KOH/g	ASTM D974*		<b>0.53</b>	0.45	0.47
Visc @ 40°C	cSt	ASTM D7279(m)	441	<b>▲ 260</b>	▲ 131	▲ 131

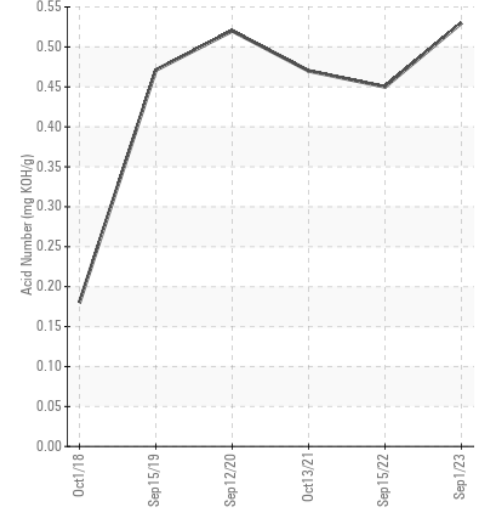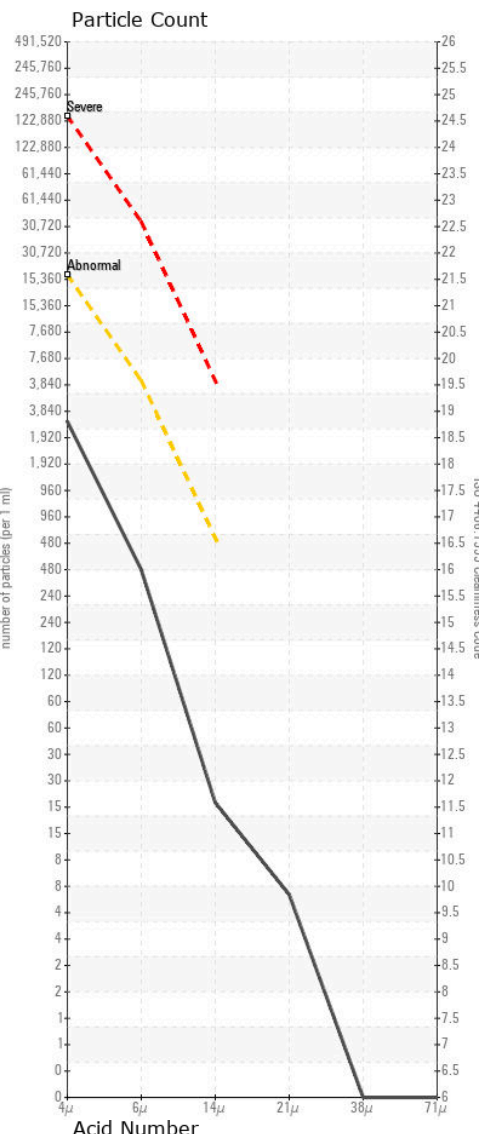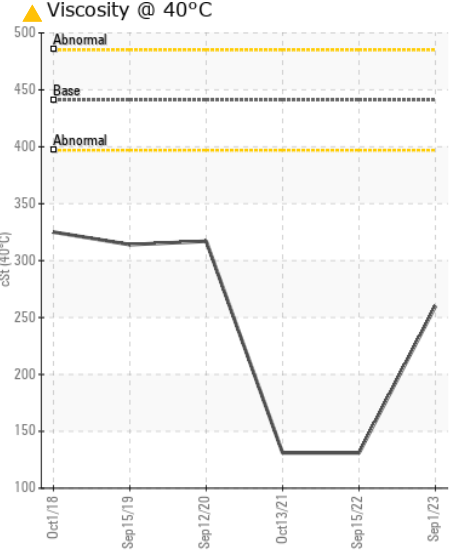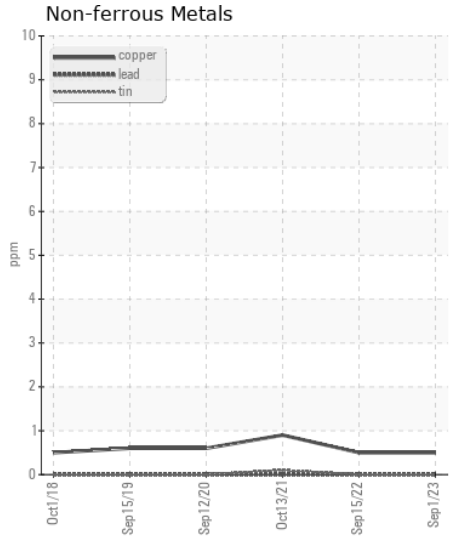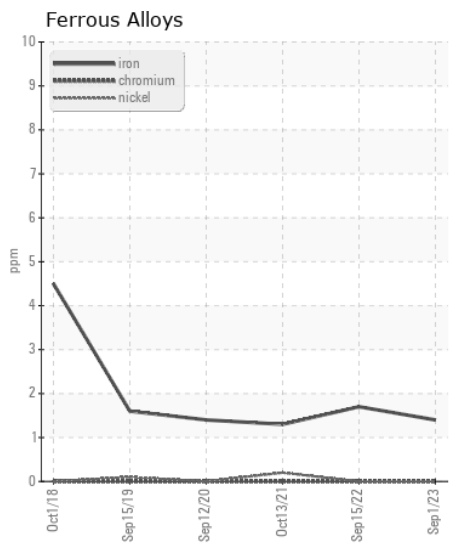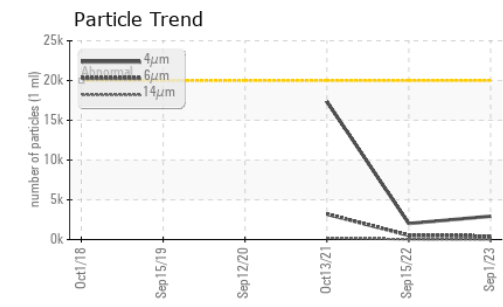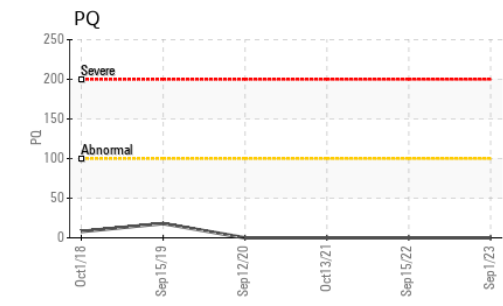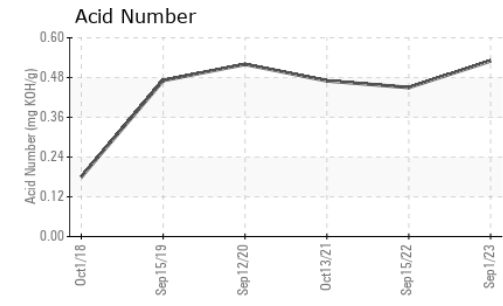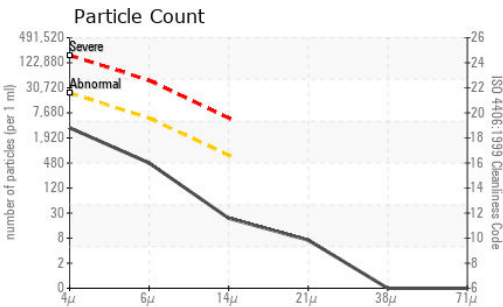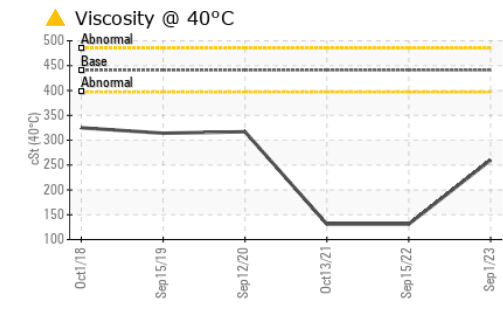

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : CB0031470 **Received** : 13 Sep 2023  
**Lab Number** : 02582303 **Tested** : 18 Sep 2023  
**Unique Number** : 5643368 **Diagnosed** : 18 Sep 2023 - Bill Quesnel  
**Test Package** : IND 2 ( Additional Tests: PRTCOUNT, TAN Man )

**Synovos/Apotex**  
 50 Steinway Blvd.  
 Etobicoke, ON  
 CA M9W 6Y3  
 Contact: Emmanuel Okelue  
 eokelue@apotex.com

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.