



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR LH26M 124532-1252**  
Component  
**Rear Left Wheel Hub**  
Fluid  
**GEAR OIL SAE 75W90 (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0181023</b>	LH0181010	LH0214968
Sample Date		Client Info		<b>08 Sep 2023</b>	10 Jan 2023	04 Apr 2022
Machine Age	hrs	Client Info		<b>4078</b>	3035	1978
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>Changed</b>	Changed	Changed
Filter Changed		Client Info		<b>None</b>	None	None
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>650	<b>8</b>	7	7
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>4	<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>25	<b>&lt;1</b>	0	<1
Lead	ppm	ASTM D5185(m)	>4	<b>&lt;1</b>	0	0
Copper	ppm	ASTM D5185(m)	>60	<b>3</b>	2	3
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>75	<b>&lt;1</b>	1	1
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>2</b>	2	1
Boron	ppm	ASTM D5185(m)	400	<b>300</b>	317	294
Barium	ppm	ASTM D5185(m)	200	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	12	<b>&lt;1</b>	0	0
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)	12	<b>2</b>	2	2
Calcium	ppm	ASTM D5185(m)	150	<b>83</b>	76	140
Phosphorus	ppm	ASTM D5185(m)	1650	<b>1287</b>	1346	1224
Zinc	ppm	ASTM D5185(m)	125	<b>28</b>	27	83
Sulfur	ppm	ASTM D5185(m)	22500	<b>20671</b>	21138	19526
Visc @ 40°C	cSt	ASTM D7279(m)	109	<b>97.7</b>	98.2	93.6

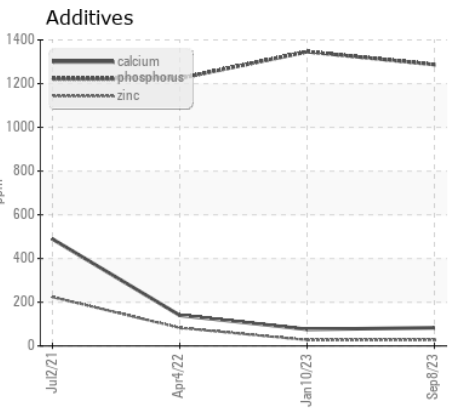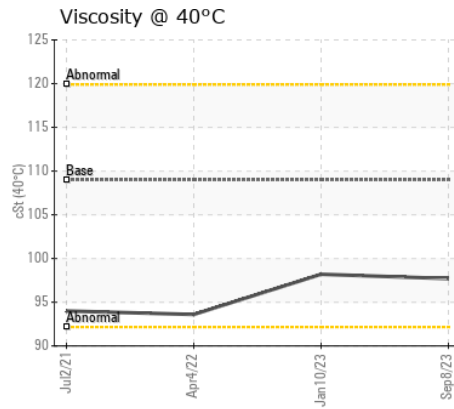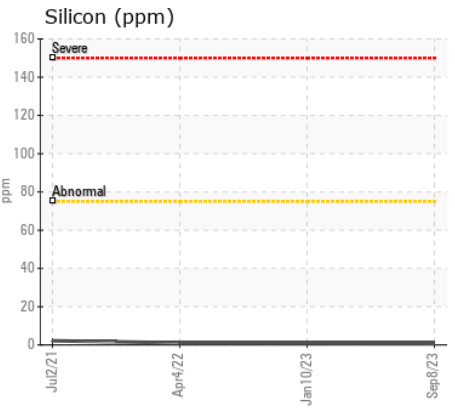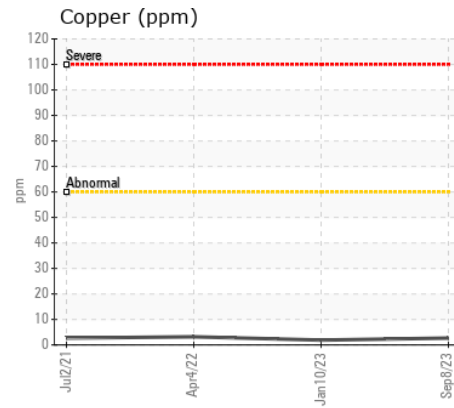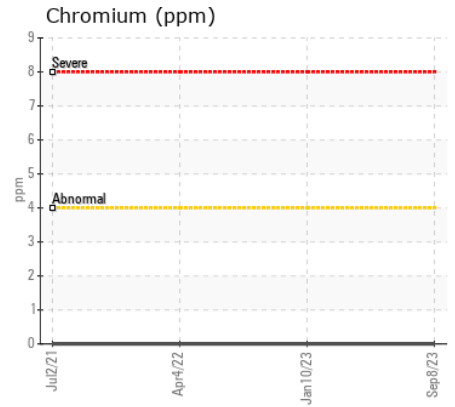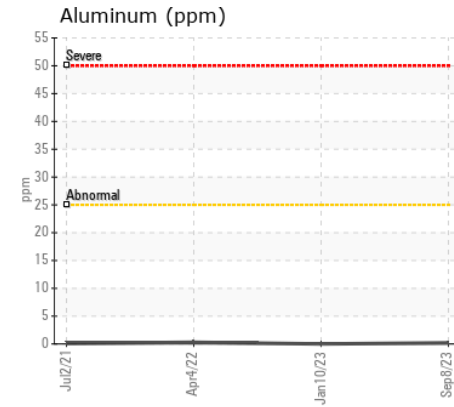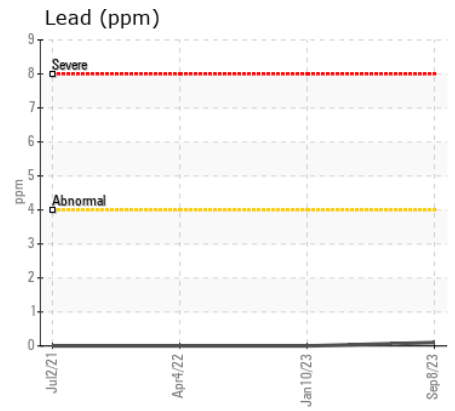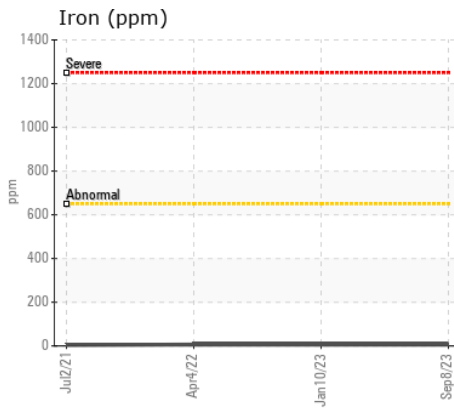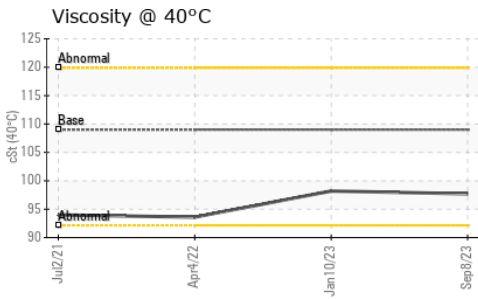

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0181023 **Received** : 20 Sep 2023  
**Lab Number** : 02584091 **Tested** : 20 Sep 2023  
**Unique Number** : 5645156 **Diagnosed** : 20 Sep 2023 - Wes Davis  
**Test Package** : MOBCE ( Additional Tests: Visual )

**Amix Recycling**  
 11698 140 Street  
 Surrey, BC  
 CA V3R 2V4  
 Contact: Kenji Wong  
 kwong@amixgroup.ca  
 T:  
 F: (250)802-1002

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.