



OIL ANALYSIS REPORT

| | |
|-----------------|---------------|
| WEAR | NORMAL |
| CONTAMINATION | NORMAL |
| FLUID CONDITION | NORMAL |

Area
360 MARINE LTD
 Machine Id
FEED CARRIER MV 360 SUPPLIER
 Component
2 Genset
 Fluid
CASTROL TECTION EXTRA SAE 15W-40 (20 LTR)

RECOMMENDATION

Resample at the next service interval to monitor.

| Test | UOM | Method | Limit/Abn | Current | History1 | History2 |
|----------------|-----|-------------|-----------|--------------------|-------------|-------------|
| Sample Number | | Client Info | | OF0000561 | OF0000558 | OF0000553 |
| Sample Date | | Client Info | | 24 Nov 2023 | 24 Dec 2022 | 29 Oct 2022 |
| Machine Age | hrs | Client Info | | 0 | 11000 | 10184 |
| Oil Age | hrs | Client Info | | 750 | 1500 | 184 |
| Filter Age | hrs | Client Info | | 250 | 1500 | 184 |
| Oil Changed | | Client Info | | Changed | Changed | Not Changd |
| Filter Changed | | Client Info | | Changed | Not Changd | None |
| Sample Status | | | | NORMAL | NORMAL | NORMAL |

WEAR

All component wear rates are normal.

| | | | | | | |
|----------|-----|---------------|-----|--------------|----|----|
| PQ | | ASTM D8184* | | 0 | 0 | 0 |
| Iron | ppm | ASTM D5185(m) | >50 | 6 | 19 | 4 |
| Chromium | ppm | ASTM D5185(m) | >4 | 0 | 0 | 0 |
| Nickel | ppm | ASTM D5185(m) | >2 | <1 | <1 | <1 |
| Titanium | ppm | ASTM D5185(m) | | 0 | <1 | <1 |
| Silver | ppm | ASTM D5185(m) | >5 | <1 | 0 | 0 |
| Aluminum | ppm | ASTM D5185(m) | >12 | 1 | <1 | 1 |
| Lead | ppm | ASTM D5185(m) | >17 | 4 | 0 | <1 |
| Copper | ppm | ASTM D5185(m) | >70 | <1 | 1 | 0 |
| Tin | ppm | ASTM D5185(m) | >15 | 0 | 0 | 0 |
| Vanadium | ppm | ASTM D5185(m) | | 0 | 0 | 0 |

CONTAMINATION













There is no indication of any contamination in the oil.

| | | | | | | |
|------------------|----------|---------------|------|----------------|------|------|
| Silicon | ppm | ASTM D5185(m) | >25 | 2 | 6 | 3 |
| Potassium | ppm | ASTM D5185(m) | >20 | 0 | <1 | <1 |
| Fuel | | WC Method | >4.0 | <1.0 | <1.0 | <1.0 |
| Water | | WC Method | >0.1 | NEG | NEG | NEG |
| Glycol | | WC Method | | NEG | NEG | NEG |
| Soot % | % | ASTM D7844* | | 0.1 | 0.1 | 0 |
| Nitration | Abs/cm | ASTM D7624* | >20 | 9.5 | 7.8 | 6.1 |
| Sulfation | Abs/.1mm | ASTM D7415* | >30 | 20.0 | 20.9 | 17.8 |
| Emulsified Water | scalar | Visual* | >0.1 | NEG | NEG | NEG |

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| | | | | | | |
|------------------|----------|---------------|------|--------------|------|-------|
| Sodium | ppm | ASTM D5185(m) | | 2 | 2 | 2 |
| Boron | ppm | ASTM D5185(m) | 30 | 19 | 10 | 1 |
| Barium | ppm | ASTM D5185(m) | | <1 | 0 | 0 |
| Molybdenum | ppm | ASTM D5185(m) | | 1 | <1 | <1 |
| Manganese | ppm | ASTM D5185(m) | | 0 | <1 | <1 |
| Magnesium | ppm | ASTM D5185(m) | 110 | 14 | 9 | 9 |
| Calcium | ppm | ASTM D5185(m) | 2740 | 2764 | 3466 | 3705 |
| Phosphorus | ppm | ASTM D5185(m) | 1240 | 999 | 1004 | 1025 |
| Zinc | ppm | ASTM D5185(m) | 1350 | 1173 | 1093 | 1080 |
| Sulfur | ppm | ASTM D5185(m) | 3520 | 3333 | 3658 | 3730 |
| Oxidation | Abs/.1mm | ASTM D7414* | >25 | 16.0 | 13.3 | 11.0 |
| Base Number (BN) | mg KOH/g | ASTM D2896* | 10.0 | 9.99 | 8.59 | 10.40 |
| Visc @ 100°C | cSt | ASTM D7279(m) | 15.2 | 15.1 | 14.7 | 14.0 |

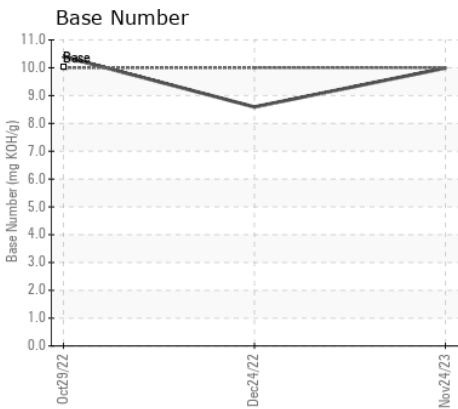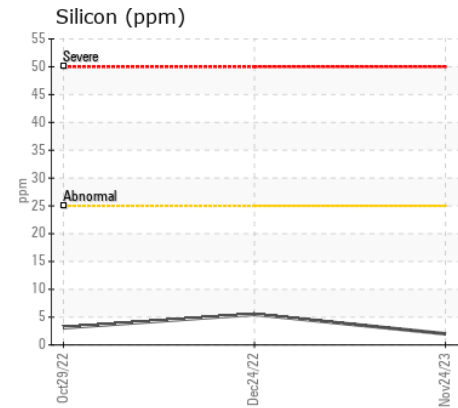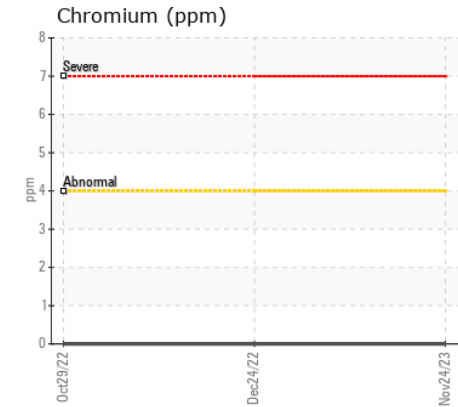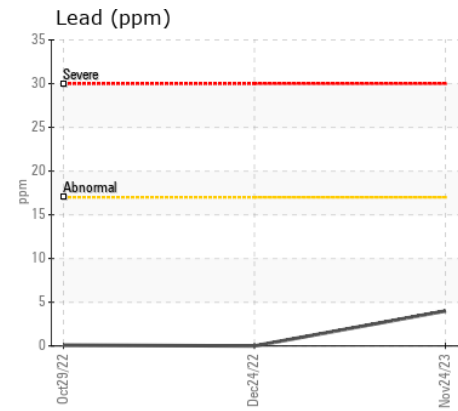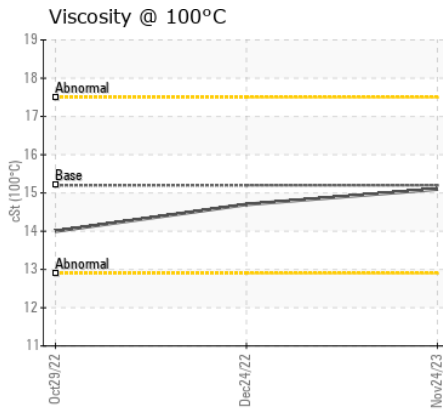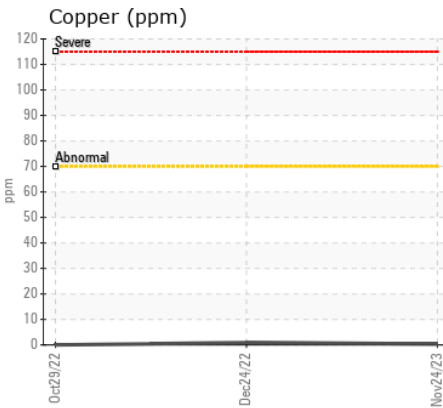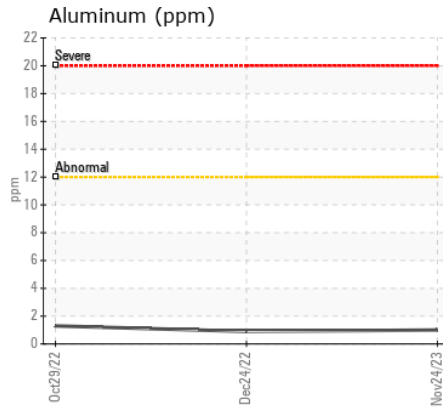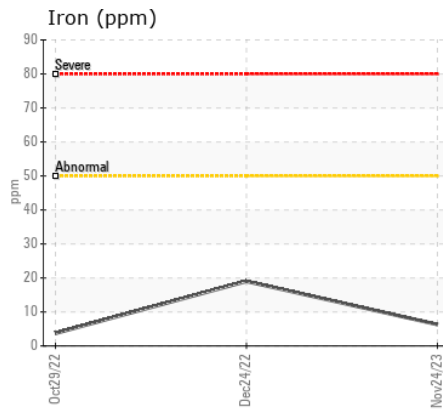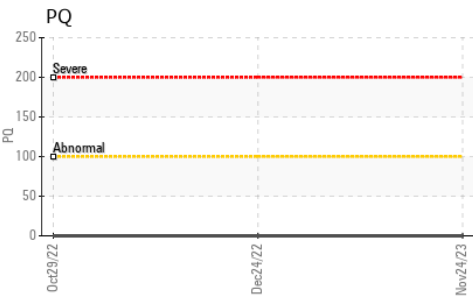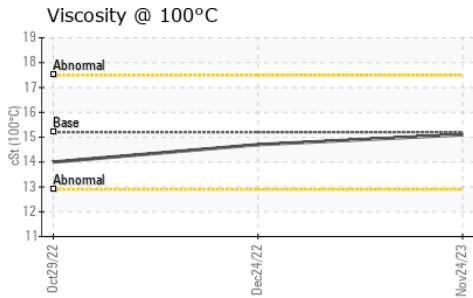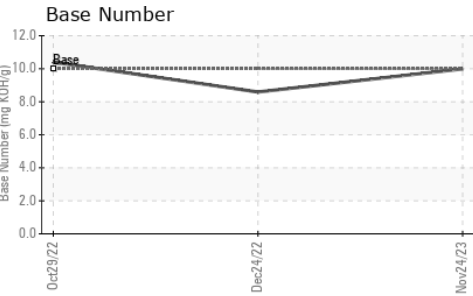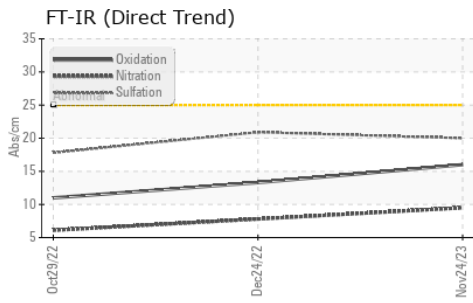

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : OF0000561 **Received** : 15 Dec 2023
Lab Number : 02603373 **Tested** : 20 Dec 2023
Unique Number : 5696458 **Diagnosed** : 20 Dec 2023 - Kevin Marson
Test Package : MOB 2 (Additional Tests: PQ)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Oil Filtration Solutions Ltd.
 PO BOX 16125
 CONCEPTION BAY SOUTH, NL
 CA A1X 2E2
 Contact: BILL BUTLER
 BBUTLER@OILFILTRATIONSOLUTIONS.COM
 T: (709)834-8433
 F: (709)834-8435