



OIL ANALYSIS REPORT

WEAR	MARGINAL
CONTAMINATION	ABNORMAL
FLUID CONDITION	NORMAL

Area
SAB1
Machine Id
SAB1 G6 Governor
Component
Hydraulic System
Fluid
ESSO TERESSO ISO 46 (1600 LTR)

RECOMMENDATION

We advise that you check for visible metal particles in the oil. We recommend you service the filters on this component. We recommend an early resample to monitor this condition. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0642848	WC0828624	WC0642876
Sample Date		Client Info		21 Dec 2023	27 Aug 2023	27 Mar 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL

WEAR

Light concentration of visible metal present.

Iron	ppm	ASTM D5185(m)	>20	<1	<1	<1
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	0	0	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<1	0	0
Lead	ppm	ASTM D5185(m)	>20	0	0	<1
Copper	ppm	ASTM D5185(m)	>20	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	▲ VLITE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION










There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The system cleanliness is above the acceptable limit for the target ISO 4406 cleanliness code.

Silicon	ppm	ASTM D5185(m)	>15	<1	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	<1
Water		WC Method	>0.05	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>2500	▲ 8493	351	176
Particles >6µm		ASTM D7647	>640	▲ 1210	76	67
Particles >14µm		ASTM D7647	>80	21	7	7
Particles >21µm		ASTM D7647	>20	4	2	2
Particles >38µm		ASTM D7647	>4	1	0	0
Particles >71µm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>18/16/13	▲ 20/17/12	16/13/10	15/13/10
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

Sodium	ppm	ASTM D5185(m)		0	0	0
Boron	ppm	ASTM D5185(m)	0	0	<1	<1
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	0	0	0	<1
Calcium	ppm	ASTM D5185(m)	0	<1	<1	0
Phosphorus	ppm	ASTM D5185(m)	2.4	6	7	7
Zinc	ppm	ASTM D5185(m)	0	<1	2	<1
Sulfur	ppm	ASTM D5185(m)		742	700	733
Acid Number (AN)	mg KOH/g	ASTM D974*	0.02	0.10	0.09	0.09
Visc @ 40°C	cSt	ASTM D7279(m)	46	45.7	45.6	45.8

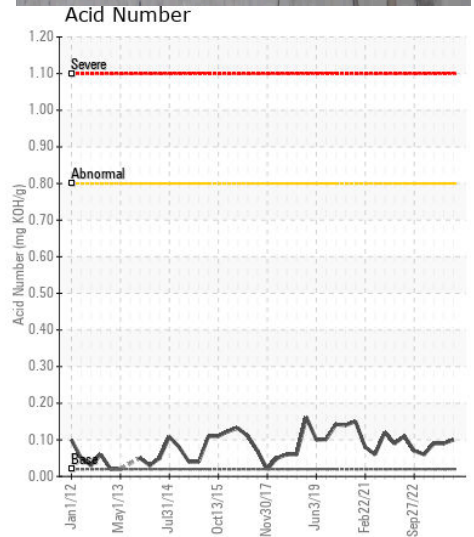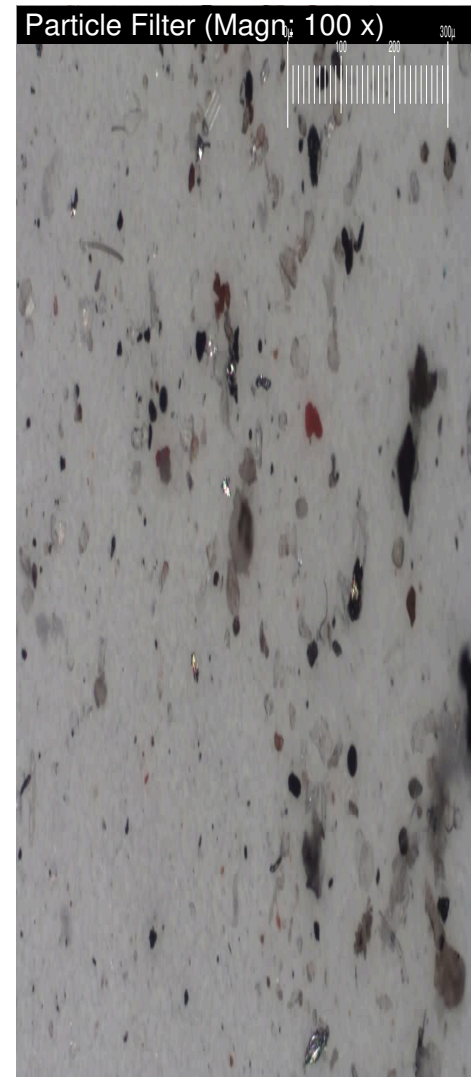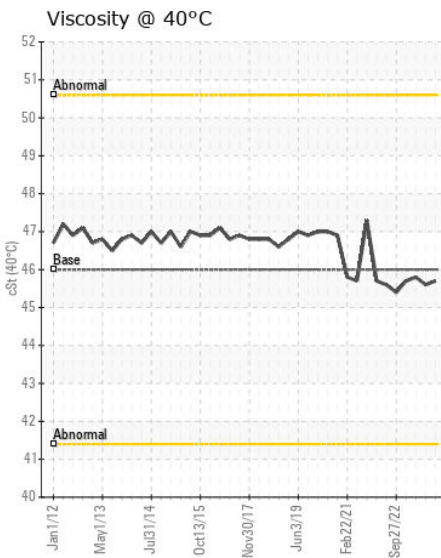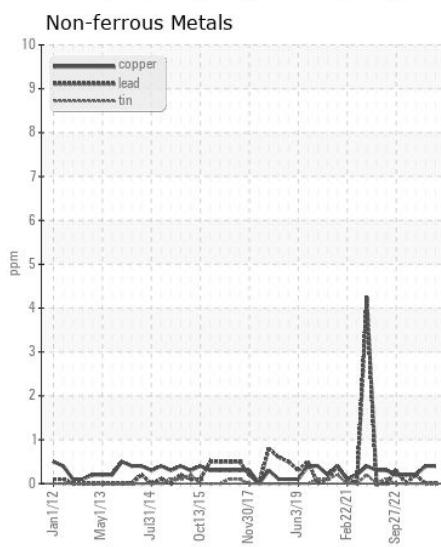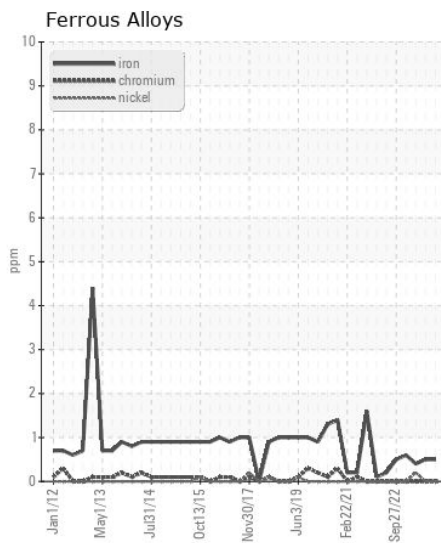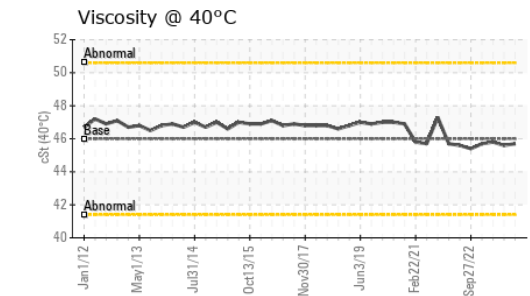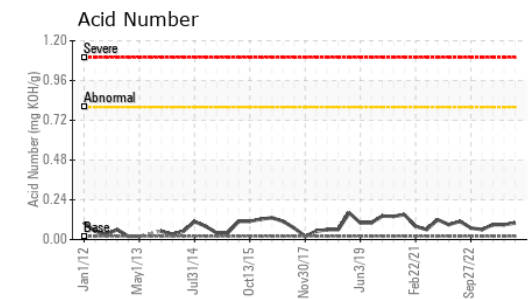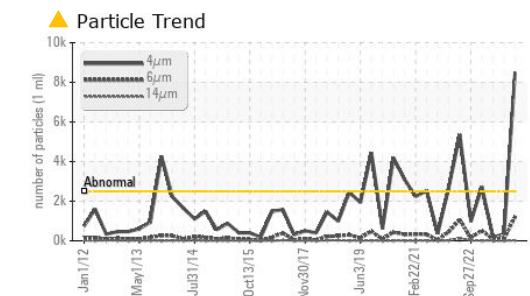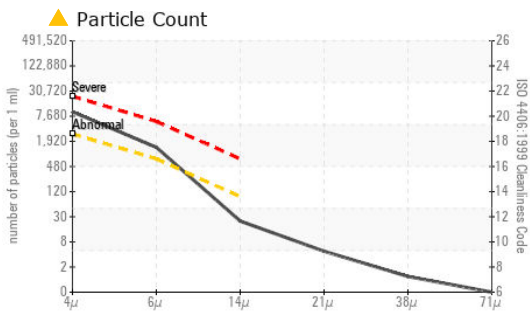

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0642848
Lab Number : 02604967
Unique Number : 5698052
Test Package : IND 2 (Additional Tests: Bottom, BottomAnalysis, FilterPatch, PrtFilter, TAN Man)

Ontario Power Generation
 NIAGARA PLANT GROUP, 14000 NIAGARA PKWY
 NIAGARA ON THE LAKE, ON
 CA L0S 1J0
 Contact: Michael Brochu
 mike.brochu@opg.com
 T: (905)357-0322
 F: (905)374-5466

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.