



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	ATTENTION
FLUID CONDITION	NORMAL

Area
SAB1
Machine Id
SAB1 G10
Component
Thrust Bearing
Fluid
ESSO TERESSO ISO 46 (4250 LTR)

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service.
NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0864658	WC0828608	WC0642832
Sample Date		Client Info		21 Dec 2023	27 Aug 2023	27 Mar 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>85	2	2	2
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>40	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>60	<1	<1	1
Copper	ppm	ASTM D5185(m)	>7	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>40	<1	0	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	VLITE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION









There is a light amount of silt (particulates < 14 microns in size) present in the oil.

Silicon	ppm	ASTM D5185(m)	>20	6	6	5
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	0
Water		WC Method	>2	NEG	NEG	NEG
Particles >4µm		ASTM D7647	>10000	▲ 11902	6245	4772
Particles >6µm		ASTM D7647	>1300	240	341	121
Particles >14µm		ASTM D7647	>320	3	13	7
Particles >21µm		ASTM D7647	>80	1	3	2
Particles >38µm		ASTM D7647	>20	0	0	1
Particles >71µm		ASTM D7647	>4	0	0	1
Oil Cleanliness		ISO 4406 (c)	>20/17/15	▲ 21/15/9	20/16/11	19/14/10
Silt	scalar	Visual*	NONE	NONE	VLITE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	NEG	NEG	NEG

FLUID CONDITION

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185(m)		0	0	0
Boron	ppm	ASTM D5185(m)	0	0	<1	<1
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	<1
Magnesium	ppm	ASTM D5185(m)	0	0	0	0
Calcium	ppm	ASTM D5185(m)	0	<1	1	0
Phosphorus	ppm	ASTM D5185(m)	2.4	9	9	9
Zinc	ppm	ASTM D5185(m)	0	2	2	2
Sulfur	ppm	ASTM D5185(m)		1451	1373	1403
Acid Number (AN)	mg KOH/g	ASTM D974*	0.02	0.13	0.15	0.12
Visc @ 40°C	cSt	ASTM D7279(m)	46	45.6	45.7	45.7

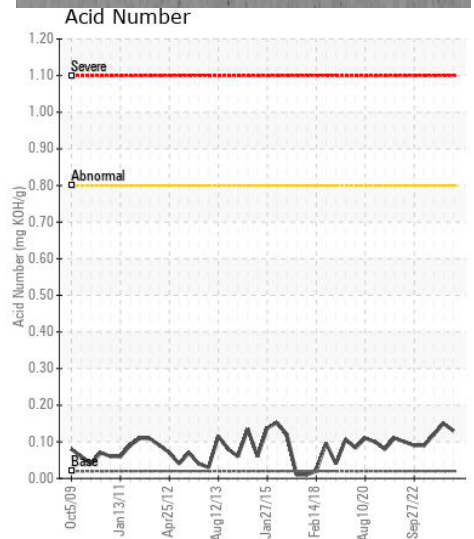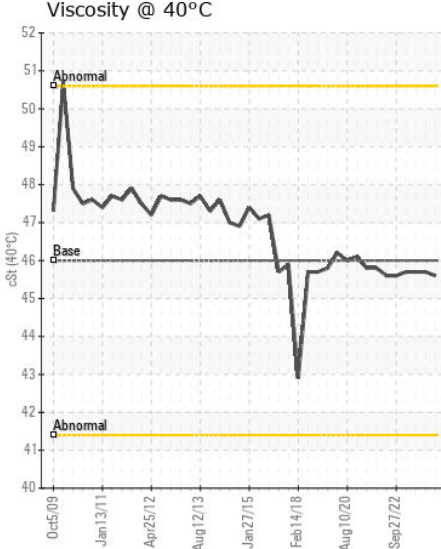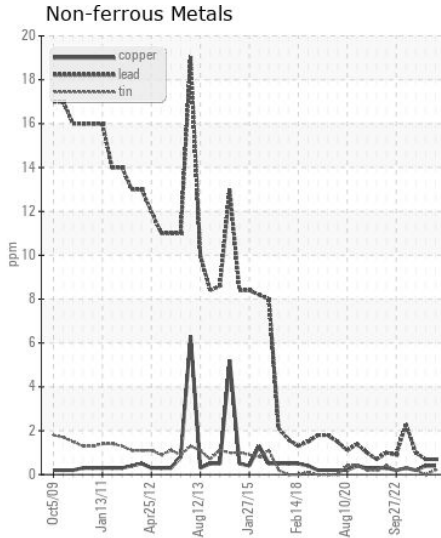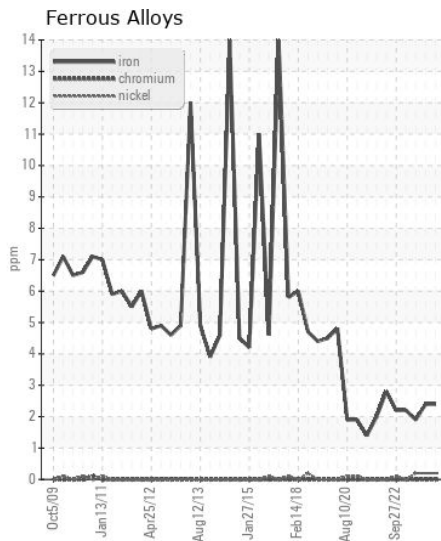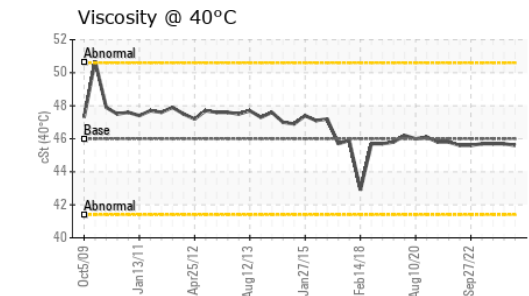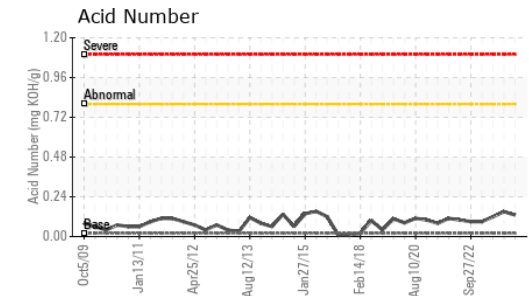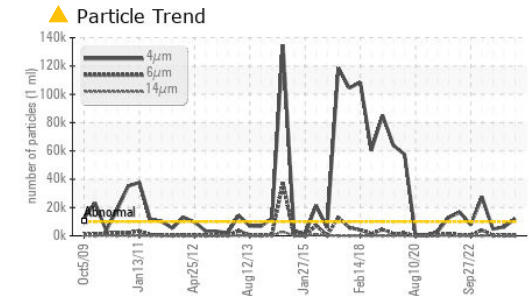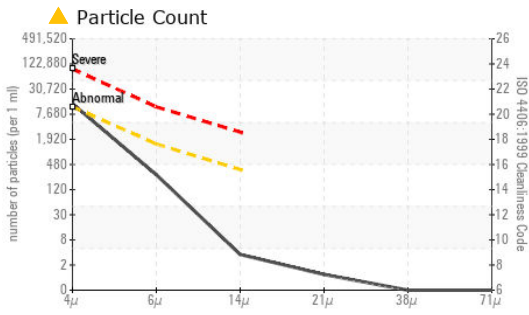

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0864658 **Received** : 22 Dec 2023
Lab Number : 02604984 **Diagnosed** : 27 Dec 2023
Unique Number : 5698069 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: BottomAnalysis, FilterPatch, PrtFilter, TAN Man)

Ontario Power Generation
 NIAGARA PLANT GROUP, 14000 NIAGARA PKWY
 NIAGARA ON THE LAKE, ON
 CA L0S 1J0
 Contact: Michael Brochu
 mike.brochu@opg.com
 T: (905)357-0322
 F: (905)374-5466

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.