



WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>

Machine Id  
**F9021**  
 Component  
**Diesel Engine**  
 Fluid  
**{not provided} (--- GAL)**

**RECOMMENDATION**

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is SAE 15W40 Diesel Engine Oil. Please confirm the oil type and grade, and specify the brand of the oil on your next sample. Please specify the component make and model with your next sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>PC0083534</b>	---	---
Sample Date		Client Info		<b>07 Jan 2024</b>	---	---
Machine Age	hrs	Client Info		<b>0</b>	---	---
Oil Age	hrs	Client Info		<b>0</b>	---	---
Filter Age	hrs	Client Info		<b>0</b>	---	---
Oil Changed		Client Info		<b>N/A</b>	---	---
Filter Changed		Client Info		<b>N/A</b>	---	---
Sample Status				<b>NORMAL</b>	---	---

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>100	<b>40</b>	---	---
Chromium	ppm	ASTM D5185(m)	>20	<b>6</b>	---	---
Nickel	ppm	ASTM D5185(m)	>4	<b>&lt;1</b>	---	---
Titanium	ppm	ASTM D5185(m)		<b>0</b>	---	---
Silver	ppm	ASTM D5185(m)	>3	<b>0</b>	---	---
Aluminum	ppm	ASTM D5185(m)	>20	<b>6</b>	---	---
Lead	ppm	ASTM D5185(m)	>40	<b>&lt;1</b>	---	---
Copper	ppm	ASTM D5185(m)	>330	<b>2</b>	---	---
Tin	ppm	ASTM D5185(m)	>15	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	---	---
White Metal	scalar	Visual*	NONE	<b>LIGHT</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---

**CONTAMINATION**











There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>25	<b>6</b>	---	---
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	---	---
Fuel		WC Method	>5	<b>&lt;1.0</b>	---	---
Water		WC Method	>0.2	<b>NEG</b>	---	---
Glycol		WC Method		<b>NEG</b>	---	---
Soot %	%	ASTM D7844*	>3	<b>0</b>	---	---
Nitration	Abs/cm	ASTM D7624*	>20	<b>7.5</b>	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>20.0</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	---	---

**FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>2</b>	---	---
Boron	ppm	ASTM D5185(m)		<b>27</b>	---	---
Barium	ppm	ASTM D5185(m)		<b>0</b>	---	---
Molybdenum	ppm	ASTM D5185(m)		<b>66</b>	---	---
Manganese	ppm	ASTM D5185(m)		<b>0</b>	---	---
Magnesium	ppm	ASTM D5185(m)		<b>917</b>	---	---
Calcium	ppm	ASTM D5185(m)		<b>1376</b>	---	---
Phosphorus	ppm	ASTM D5185(m)		<b>1084</b>	---	---
Zinc	ppm	ASTM D5185(m)		<b>1291</b>	---	---
Sulfur	ppm	ASTM D5185(m)		<b>2847</b>	---	---
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>16.3</b>	---	---
Visc @ 40°C	cSt	ASTM D7279(m)		<b>108</b>	---	---
Visc @ 100°C	cSt	ASTM D7279(m)		<b>15.1</b>	---	---
Viscosity Index (VI)	Scale	ASTM D2270*		<b>146</b>	---	---

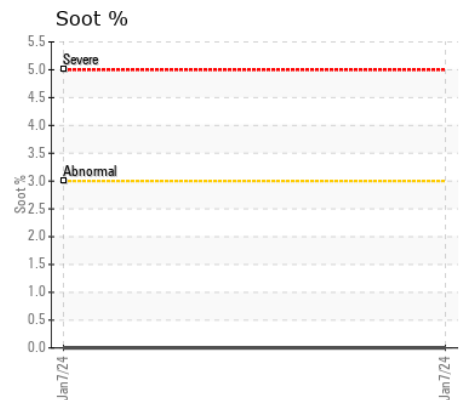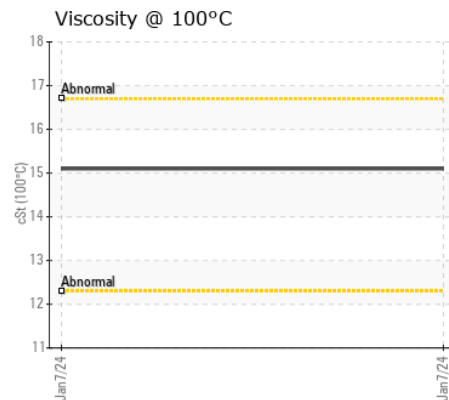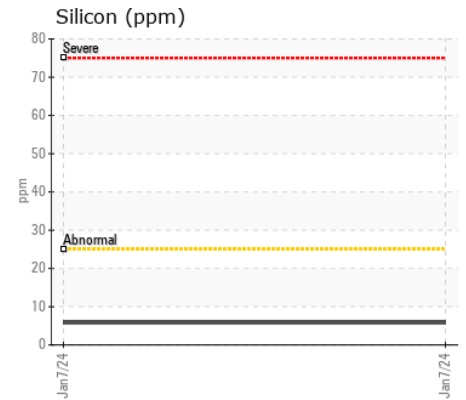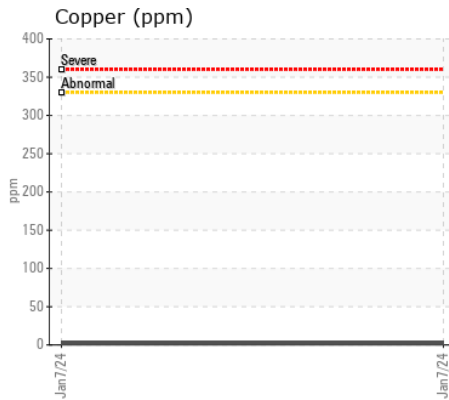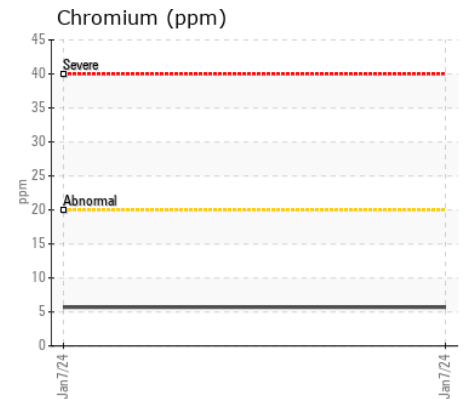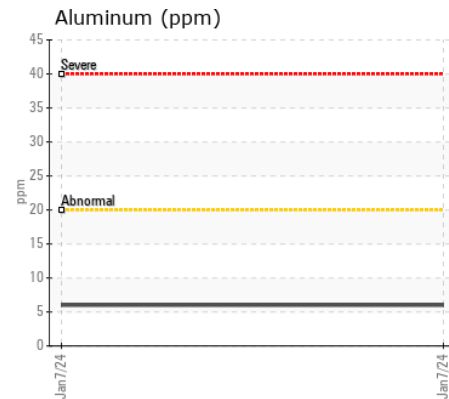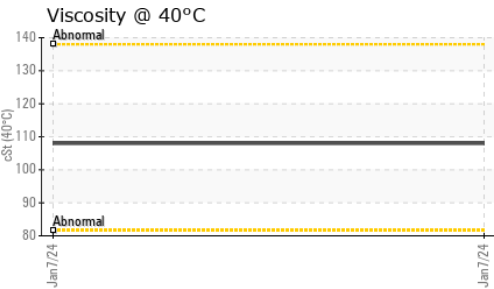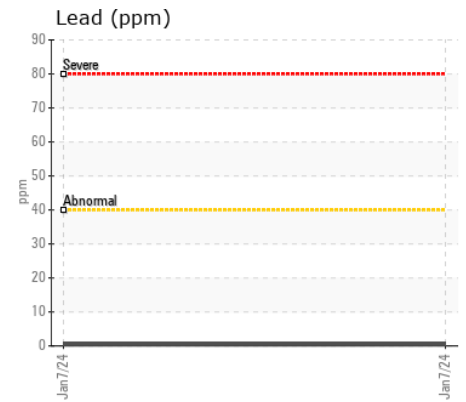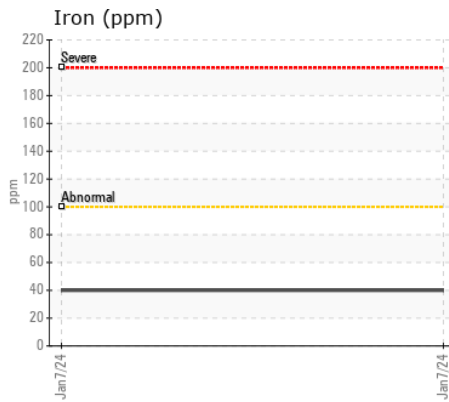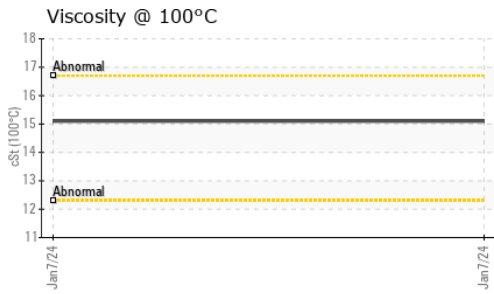

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 LES ENTREPRISES MICHAUVILLE INC.  
**Sample No.** : PC0083534 **Received** : 08 Jan 2024 270 RUE BRUNET  
**Lab Number** : 02606955 **Diagnosed** : 09 Jan 2024 MONT ST-HILAIRE, QC  
**Unique Number** : 5708041 **Diagnostician** : Wes Davis CA J3H 0M6  
**Test Package** : MOB 1 ( Additional Tests: KV40, VI, Visual ) Contact: Martin Trudel

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

mtrudel@michaudville.com  
 T:  
 F: