



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINANTS	NORMAL
OIL CONDITION	NORMAL

Area
ENGINE ROOM 3RD DECK
 Machine Id
77-G-6582 ESSENTIAL SERVICES GENERATOR (S/N Maint Plan 22480)

Component
Diesel Engine
 Fluid
MOBIL MOBILGARD 412 (1300 LTR)

RECOMMENDATION




Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		PP	PP	PP
Sample Date		Client Info		27 Nov 2023	14 Nov 2023	11 Sep 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal. The ferrography results are normal indicating no abnormal wear in the system.

PQ		ASTM D8184*		0	0	0
Iron	ppm	ASTM D5185(m)	>25	3	3	3
Chromium	ppm	ASTM D5185(m)	>5	0	0	0
Nickel	ppm	ASTM D5185(m)	>5	<1	<1	0
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	<1	<1
Aluminum	ppm	ASTM D5185(m)	>10	2	1	1
Lead	ppm	ASTM D5185(m)	>5	0	0	0
Copper	ppm	ASTM D5185(m)	>5	<1	1	<1
Tin	ppm	ASTM D5185(m)	>5	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Large Particles		DR-Ferr*		23.4	11.5	8.6
Small Particles		DR-Ferr*		12.4	7.4	3.7
Total Particles		DR-Ferr*	>---	35.8	18.9	12.3
Large Particles Percentage	%	DR-Ferr*		30.7	21.7	39.8
Severity Index		DR-Ferr*		257	47	42
Ferrous Rubbing	Scale 0-10	ASTM D7684*		3	2	2
Ferrous Sliding	Scale 0-10	ASTM D7684*				1
Ferrous Cutting	Scale 0-10	ASTM D7684*				
Ferrous Rolling	Scale 0-10	ASTM D7684*		1	1	1
Ferrous Break-in	Scale 0-10	ASTM D7684*				
Ferrous Spheres	Scale 0-10	ASTM D7684*				
Ferrous Black Oxides	Scale 0-10	ASTM D7684*				1
Ferrous Red Oxides	Scale 0-10	ASTM D7684*				
Ferrous Corrosive	Scale 0-10	ASTM D7684*				
Ferrous Other	Scale 0-10	ASTM D7684*				
Nonferrous Rubbing	Scale 0-10	ASTM D7684*				
Nonferrous Sliding	Scale 0-10	ASTM D7684*				
Nonferrous Cutting	Scale 0-10	ASTM D7684*				
Nonferrous Rolling	Scale 0-10	ASTM D7684*				
Nonferrous Other	Scale 0-10	ASTM D7684*				

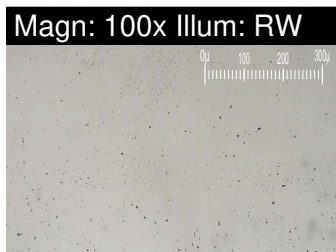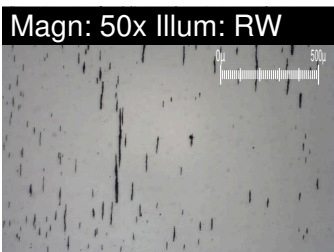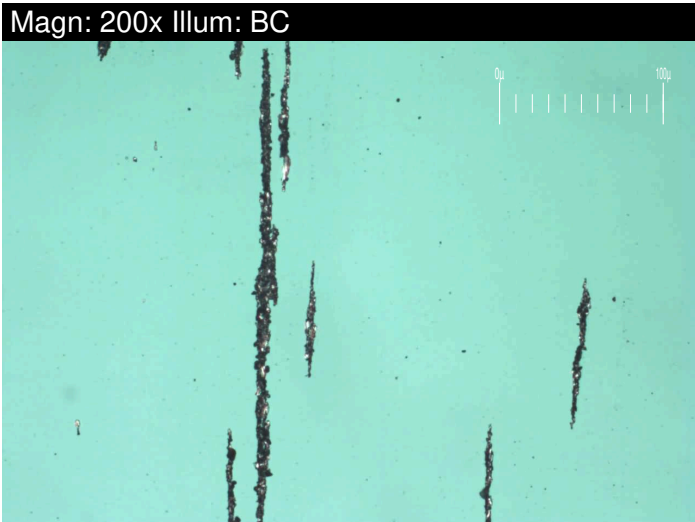

CONTAMINANTS

There is no indication of any contamination in the oil.


Silicon	ppm	ASTM D5185(m)	>20	13	6	10
Potassium	ppm	ASTM D5185(m)	>20	<1	0	0
Fuel		WC Method	>4.0	<1.0	<1.0	<1.0
Water		WC Method	>0.1	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
Soot %	%	ASTM D7844*	>2	0	0	0
Nitration	Abs/cm	ASTM D7624*	>20	6.4	7.0	6.8
Sulfation	Abs/.1mm	ASTM D7415*	>30	15.0	15.4	14.9
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG
Carbonaceous Material	Scale 0-10	ASTM D7684*		1	1	1
Sand/Dirt	Scale 0-10	ASTM D7684*		1	1	1
Fibres	Scale 0-10	ASTM D7684*				
Spheres	Scale 0-10	ASTM D7684*				
Other	Scale 0-10	ASTM D7684*		1	1	2

OIL CONDITION


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185(m)		<1	0	1
Boron	ppm	ASTM D5185(m)	0	<1	1	1
Barium	ppm	ASTM D5185(m)	0	0	<1	<1
Molybdenum	ppm	ASTM D5185(m)	0	0	0	<1
Manganese	ppm	ASTM D5185(m)	0	0	0	0
Magnesium	ppm	ASTM D5185(m)	18	17	16	17
Calcium	ppm	ASTM D5185(m)	6350	6017	6199	6352
Phosphorus	ppm	ASTM D5185(m)	200	212	213	214
Zinc	ppm	ASTM D5185(m)	380	351	358	369
Sulfur	ppm	ASTM D5185(m)	6950	5281	5136	5326
Oxidation	Abs/.1mm	ASTM D7414*	>25	4.6	5.0	4.7
Base Number (BN)	mg KOH/g	ASTM D2896*	15	15.99	15.00	15.86
Visc @ 100°C	cSt	ASTM D7279(m)	14.5	13.8	13.8	13.8
Lubricant Degradation	Scale 0-10	ASTM D7684*				


Ferrous Alloys

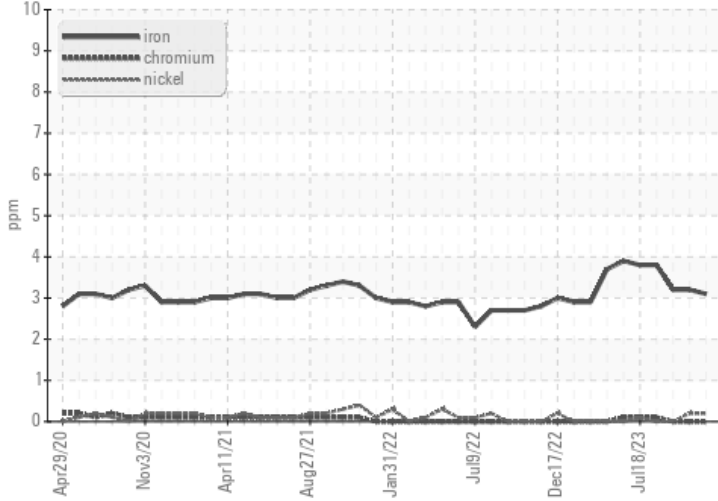


Non-ferrous Metals

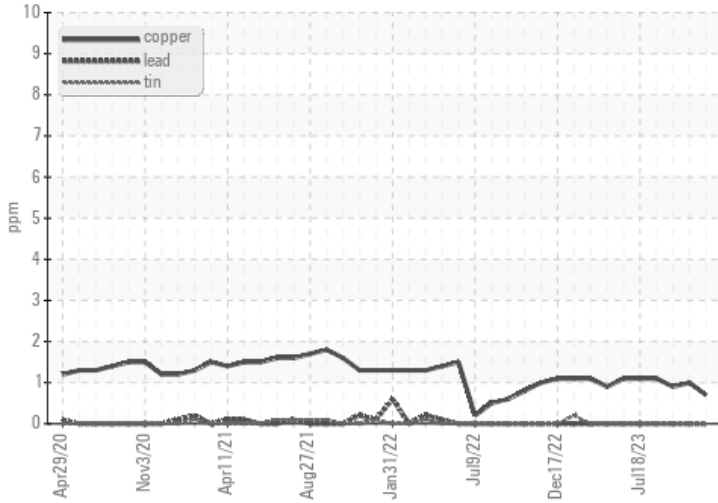


Viscosity @ 100°C

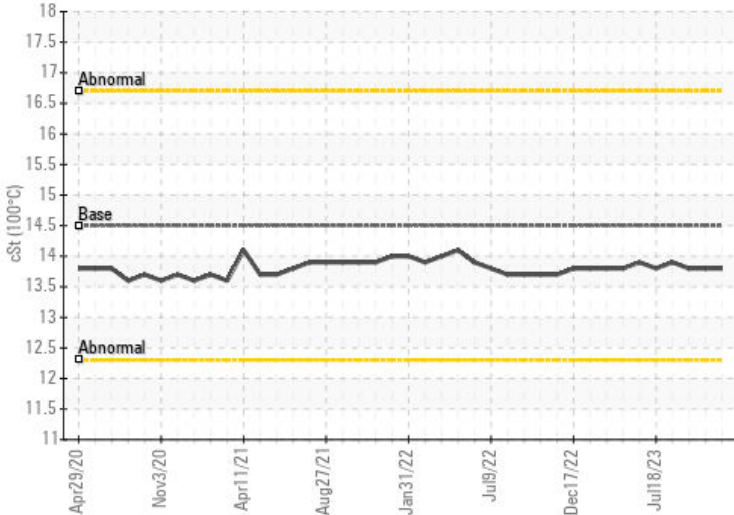

PQ

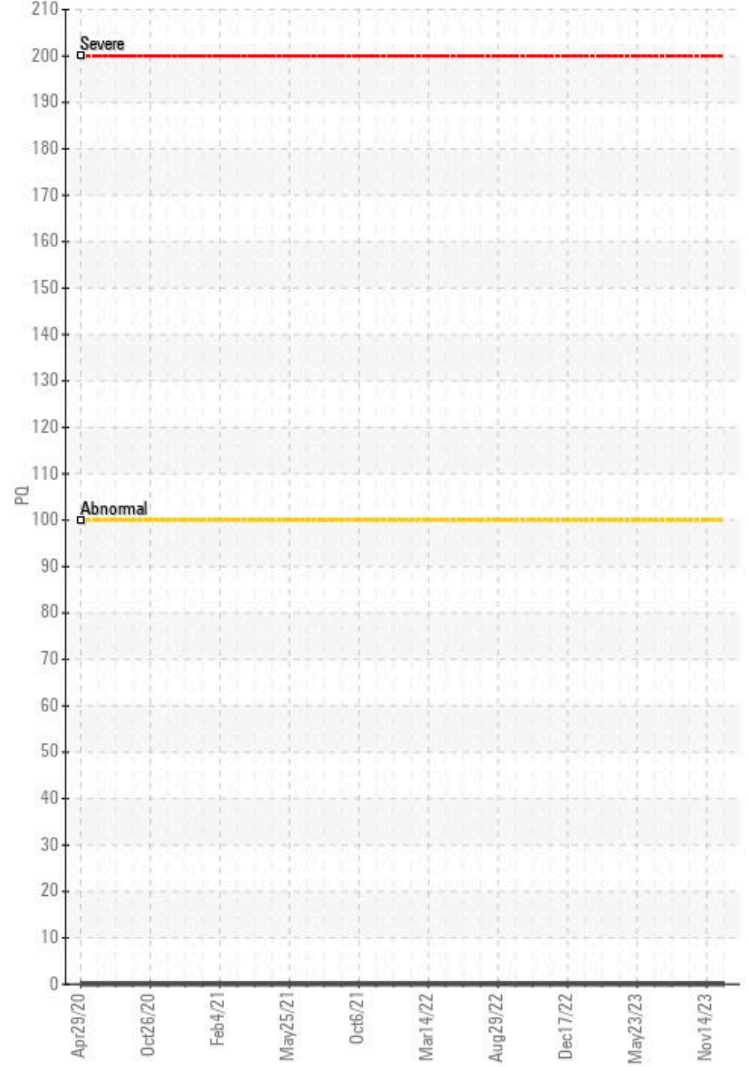

Base Number

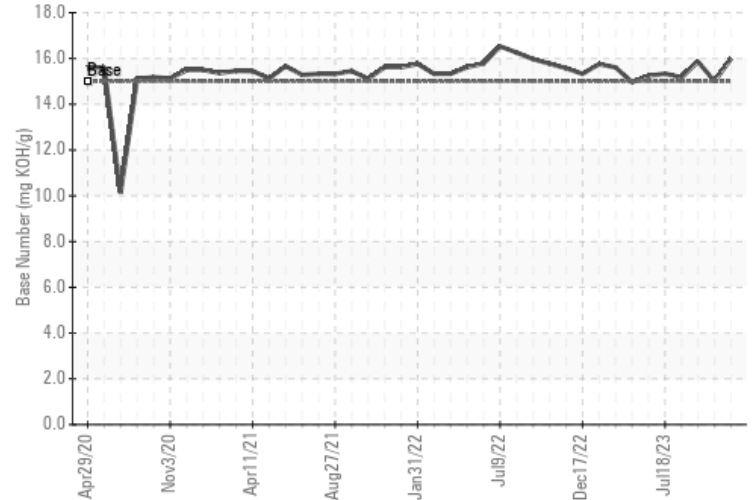

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 HUSKY SEA ROSE /AKER SOLUTIONS
Sample No. : PP **Received** : 09 Jan 2024
Lab Number : 02607415 **Diagnosed** : 16 Jan 2024
Unique Number : 5708501 **Diagnostician** : Kevin Marson
Test Package : MAR 3

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

PO BOX 20
 ST. JOHN'S, NL
 CA A1C 6C9
 Contact: Maintenance Supervisor
 maintsuper.searose@huskyenergy.ca
 T: x:
 F: x:

This page left intentionally blank