

OIL ANALYSIS REPORT

WEAR CONTAMINATION FLUID CONDITION

NORMAL NORMAL


Area

(CGKPX) SKYCARE AIR AMBULANCE [52882] Machine Id [CGKPX] FAIRCHILD SA226 P-54155 (S/N TC-264)

Left Jet Turbine

EASTMAN TURBO OIL 2380 (--- GAL)

//							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
This is a baseline read-out on the submitted sample.	Sample Number		Client Info		GT57380	GT57377	GT57374
	Sample Date		Client Info		11 Jan 2024	03 Dec 2023	17 Nov 2023
	Machine Age	hrs	Client Info		0	0	0
	Oil Age	hrs	Client Info		708	581	517
	Filter Age	hrs	Client Info		59	64	64
	Oil Changed		Client Info		N/A	N/A	N/A
	Filter Changed		Client Info		N/A	N/A	N/A
	Sample Status				NORMAL		
WEAR	Iron	ppm	ASTM D5185(m)	>8	0	0	0
	Chromium	ppm	ASTM D5185(m)	>2	0	0	0
	Nickel	ppm	ASTM D5185(m)	>2	0	0	0
	Silver	ppm	ASTM D5185(m)	>2	0	0	0
	Aluminum	ppm	ASTM D5185(m)	>2	<1	<1	<1
	Lead	ppm	ASTM D5185(m)	>3	0	0	0
	Copper	ppm	ASTM D5185(m)	>3	0	0	0
CONTAMINATION	Water		WC Method	>0.1	NEG	NEG	NEG
FLUID CONDITION	Magnesium	ppm	ASTM D5185(m)	0	0	0	0
	Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	0.47	0.62	0.57
	Visc @ 40°C	cSt	ASTM D7279(m)	24.2	24.4		

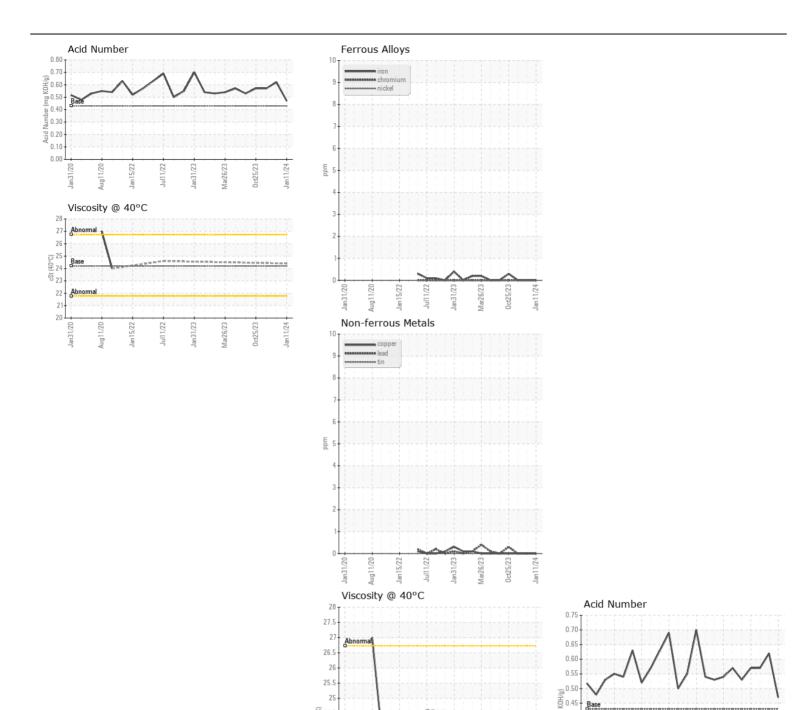





Laboratory Sample No. Lab Number Unique Number : 5709930

: GT57380 : 02608844

St (40°C)

23.

22.

22

21.

20.5

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Recieved : 15 Jan 2024 Diagnosed Diagnostician : Wes Davis

Jul11/22

: 15 Jan 2024

Oct25/23

Jan11/24 -

E 0.40 를 0.35

> 0.30 0.25

> 0.20

0.15

0.10 0.05

0.00

Aug11/20.

Honeywell Engines 111 S. 34th Street, 301 Receiving, Attn: SOAP Program

Jul11/22

PHOENIX, AZ US 85034

Contact: GARRETT

Test Package : G331 (Additional Tests: ICP) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Aug11/20

T: F: (602)365-2676

Jan11/24