



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area

STRATH

Machine Id

BABBIT BRG PEDESTAL A ROD MILL DRIVE END

Component

Drive End Bearing

Fluid

PETRO CANADA TURBOFLO R&O 68 (8 GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0878477	WC0878486	WC0878485
Sample Date		Client Info		09 Jan 2024	14 Nov 2023	14 Nov 2023
Machine Age	mths	Client Info		0	0	0
Oil Age	mths	Client Info		0	0	0
Filter Age	mths	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>20	5	4	1
Chromium	ppm	ASTM D5185(m)	>20	<1	0	0
Nickel	ppm	ASTM D5185(m)	>20	<1	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	<1	<1
Aluminum	ppm	ASTM D5185(m)	>20	<1	0	0
Lead	ppm	ASTM D5185(m)	>20	4	4	1
Copper	ppm	ASTM D5185(m)	>20	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>20	1	1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION





There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>15	0	<1	0
Potassium	ppm	ASTM D5185(m)	>20	0	0	0
Water		WC Method	>2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		0	0	0
Boron	ppm	ASTM D5185(m)		0	<1	<1
Barium	ppm	ASTM D5185(m)		0	<1	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		<1	0	0
Calcium	ppm	ASTM D5185(m)	0	<1	<1	<1
Phosphorus	ppm	ASTM D5185(m)	4	10	9	9
Zinc	ppm	ASTM D5185(m)	0	1	1	<1
Sulfur	ppm	ASTM D5185(m)		137	138	138
Visc @ 40°C	cSt	ASTM D7279(m)	64.9	64.4	64.4	64.3

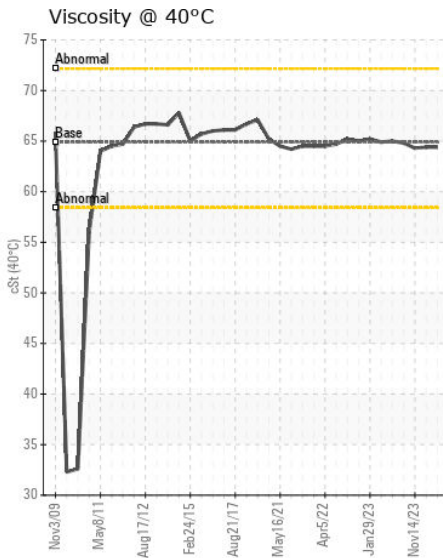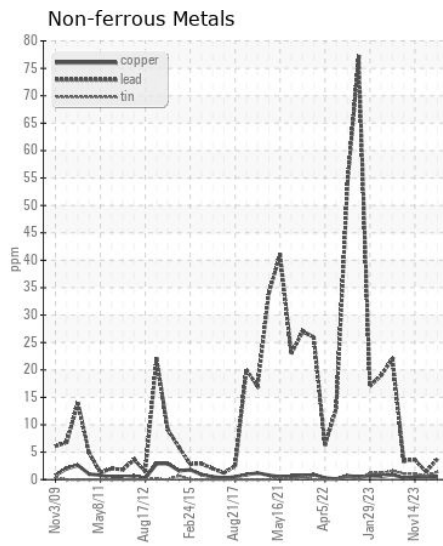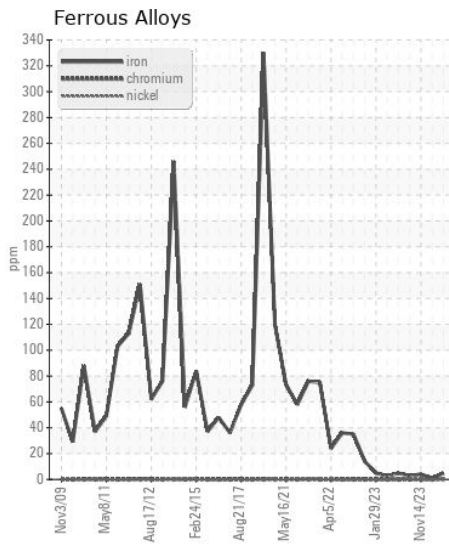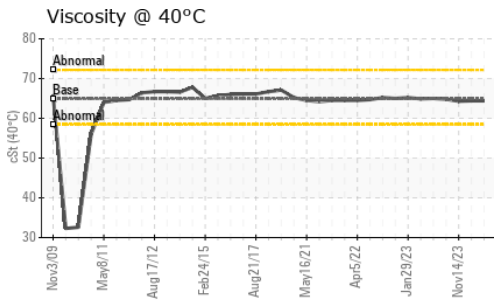

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Wajax - Northpoint Technical Services
Sample No. : WC0878477 **Received** : 16 Jan 2024 1108 WebbWood Drive.
Lab Number : 02609003 **Diagnosed** : 16 Jan 2024 Sudbury, ON
Unique Number : 5710089 **Diagnostician** : Kevin Marson CA P3C 3B7
Test Package : IND 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Contact: Nick Walker
 nwalker@northpoints.com
 T: (705)499-2387
 F: (795)690-9010