



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Machine Id
SENNEBOGEN 830E 3309
 Component
Rear Gearbox
 Fluid
IRVING 15W40 (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WC0849308	WC0849223	WC0849275
Sample Date		Client Info		08 Jan 2024	01 Nov 2023	21 Aug 2023
Machine Age	hrs	Client Info		9000	8000	7000
Oil Age	hrs	Client Info		1000	1000	1000
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>200	38	35	30
Chromium	ppm	ASTM D5185(m)	>10	<1	0	<1
Nickel	ppm	ASTM D5185(m)	>10	<1	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	<1	0
Aluminum	ppm	ASTM D5185(m)	>25	2	2	2
Lead	ppm	ASTM D5185(m)	>50	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>200	13	16	17
Tin	ppm	ASTM D5185(m)	>10	<1	1	1
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>50	5	2	5
Potassium	ppm	ASTM D5185(m)	>20	<1	0	<1
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	VLITE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)	>101	2	1	3
Boron	ppm	ASTM D5185(m)		70	81	77
Barium	ppm	ASTM D5185(m)		0	<1	0
Molybdenum	ppm	ASTM D5185(m)		4	4	4
Manganese	ppm	ASTM D5185(m)		5	6	8
Magnesium	ppm	ASTM D5185(m)		31	31	30
Calcium	ppm	ASTM D5185(m)		1943	2039	2093
Phosphorus	ppm	ASTM D5185(m)		982	1021	1098
Zinc	ppm	ASTM D5185(m)		1065	1113	1142
Sulfur	ppm	ASTM D5185(m)		3687	3667	3588
Visc @ 40°C	cSt	ASTM D7279(m)		61.6	64.5	64.5

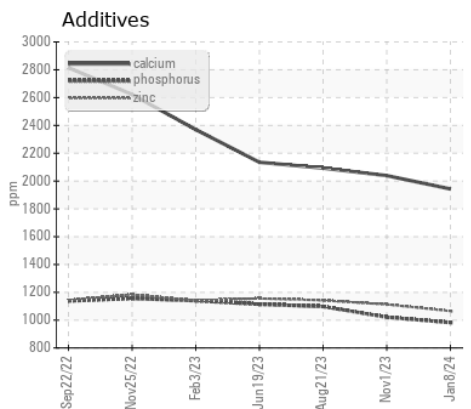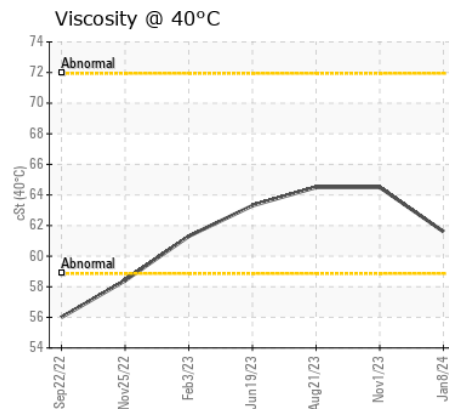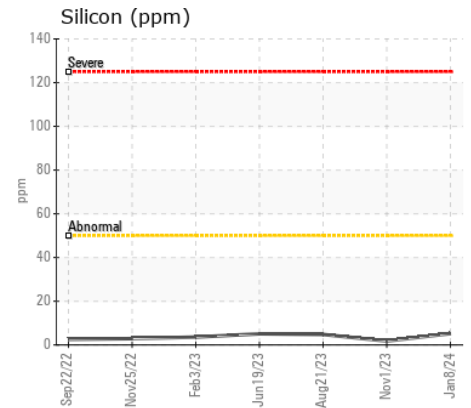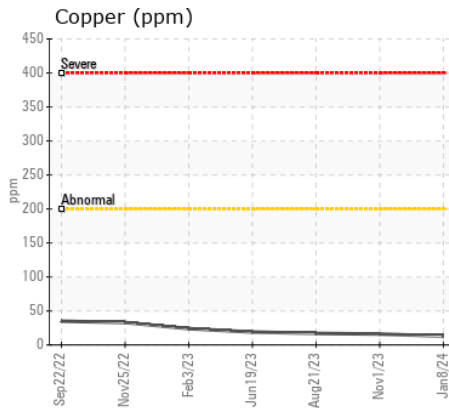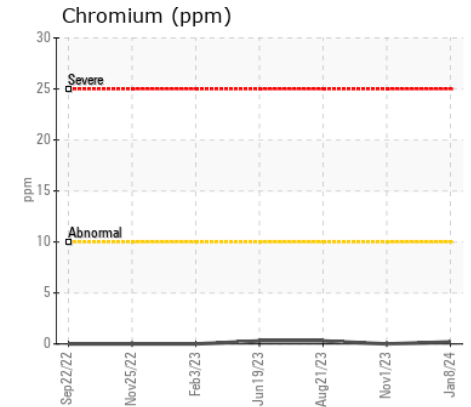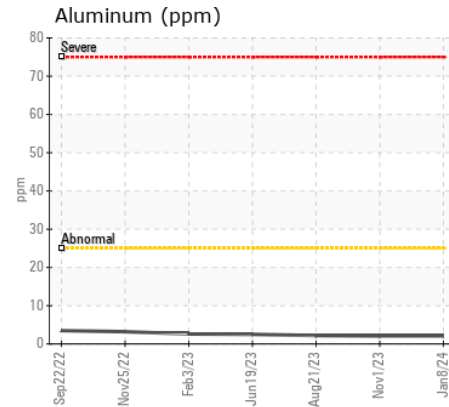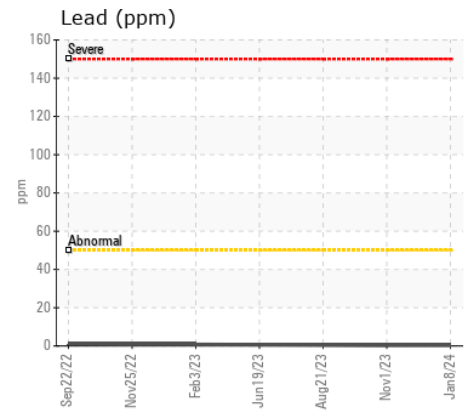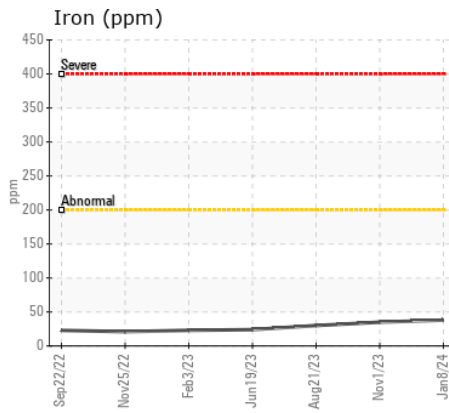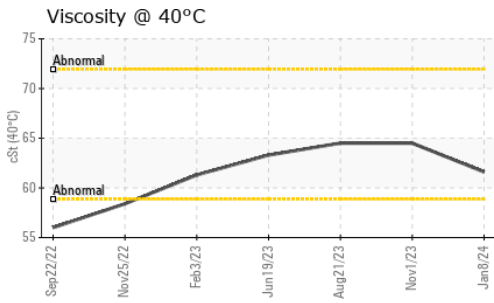

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0849308 **Received** : 16 Jan 2024
Lab Number : 02609081 **Diagnosed** : 16 Jan 2024
Unique Number : 5710167 **Diagnostician** : Wes Davis
Test Package : MOB 1

INTERFOR CORP
 5060 RTE 430
 BRUNSWICK MINE, NB
 CA E2A 6W6
 Contact: Daniel Hachey
 daniel.hachey@interfor.com
 T: (506)547-8700
 F: (506)548-1892

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.