



LIEBHERR

OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL



Machine Id
LIEBHERR LH80M 120282-1218

Component
Rear Left Wheel Hub

Fluid
PETRO CANADA TRAXON 75W90 SYNTHETIC (9 LTR)

RECOMMENDATION

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		LH0279400	LH0280272	LH0269982
Sample Date		Client Info		12 Jan 2024	02 Dec 2023	27 Sep 2023
Machine Age	hrs	Client Info		12934	12550	11869
Oil Age	hrs	Client Info		0	0	0
Filter Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR

Les taux d'usure de tous les composants sont normaux.

Iron	ppm	ASTM D5185(m)	>650	11	26	24
Chromium	ppm	ASTM D5185(m)	>4	0	0	0
Nickel	ppm	ASTM D5185(m)	>4	0	<1	<1
Titanium	ppm	ASTM D5185(m)	>4	0	0	0
Silver	ppm	ASTM D5185(m)		0	<1	<1
Aluminum	ppm	ASTM D5185(m)	>25	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>4	0	<1	<1
Copper	ppm	ASTM D5185(m)	>60	1	3	3
Tin	ppm	ASTM D5185(m)	>4	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE

CONTAMINATION










Il n'y a aucun indice de contamination dans l'huile.

Silicon	ppm	ASTM D5185(m)	>75	2	3	4
Potassium	ppm	ASTM D5185(m)	>20	<1	0	<1
Water		WC Method	>0.2	NEG	NEG	NEG
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG

FLUID CONDITION

L'état de l'huile est acceptable pour la durée de service.

Sodium	ppm	ASTM D5185(m)		1	4	5
Boron	ppm	ASTM D5185(m)	328	256	251	239
Barium	ppm	ASTM D5185(m)	1	0	<1	<1
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	<1	<1
Magnesium	ppm	ASTM D5185(m)	1	<1	1	1
Calcium	ppm	ASTM D5185(m)	7	25	8	8
Phosphorus	ppm	ASTM D5185(m)	1145	1367	1390	1421
Zinc	ppm	ASTM D5185(m)	3	15	13	14
Sulfur	ppm	ASTM D5185(m)	17909	22165	22789	23482
Visc @ 40°C	cSt	ASTM D7279(m)	99.6	104	104	104

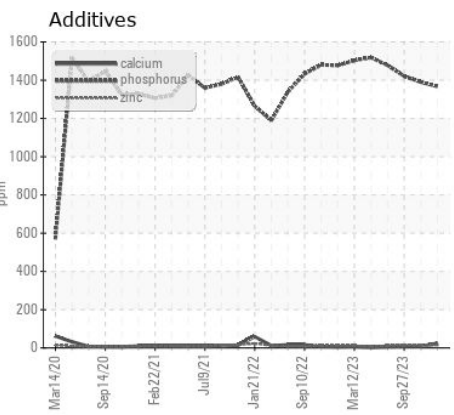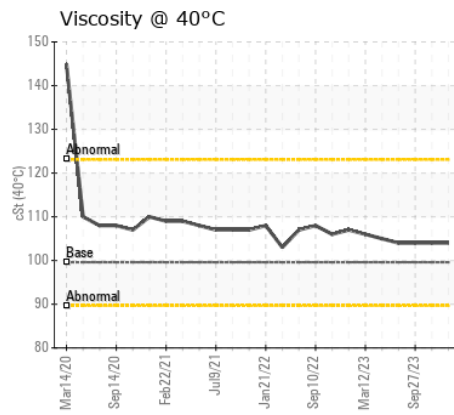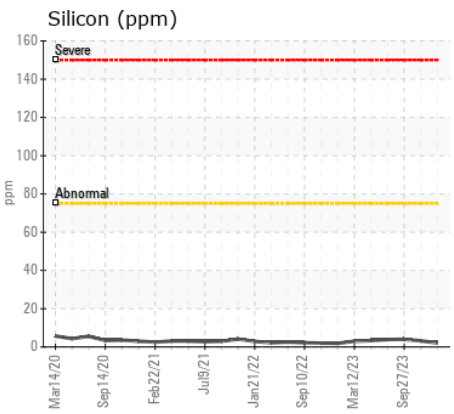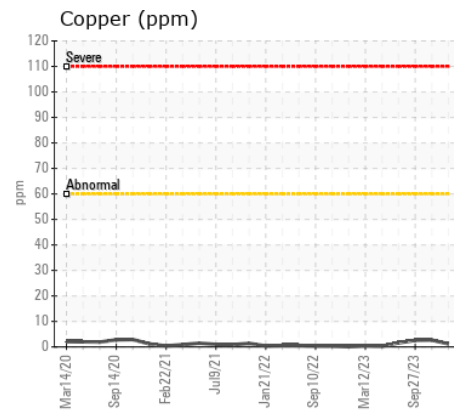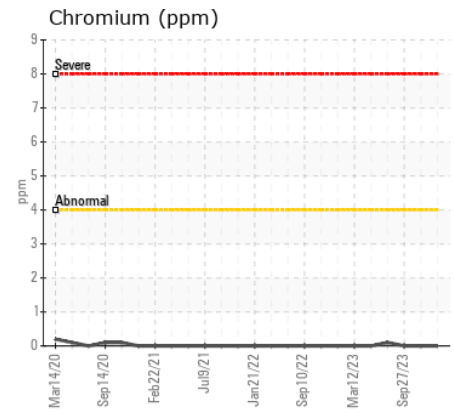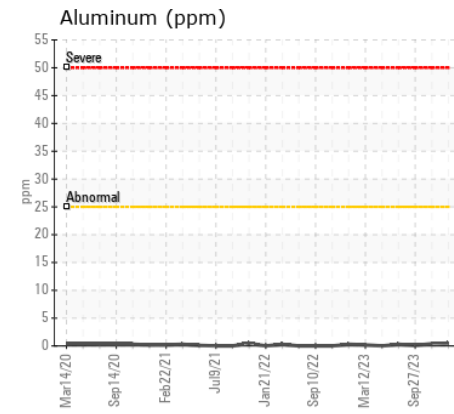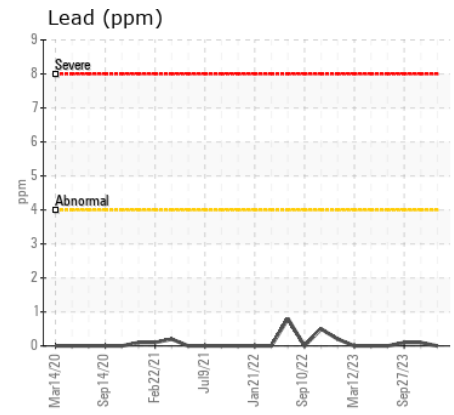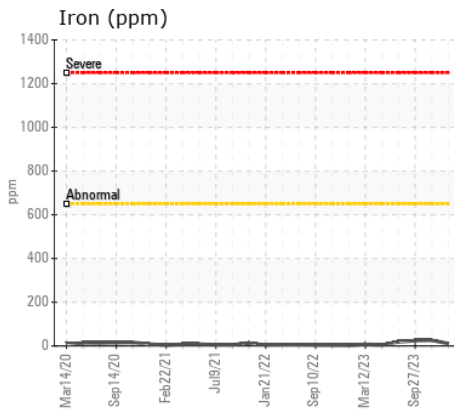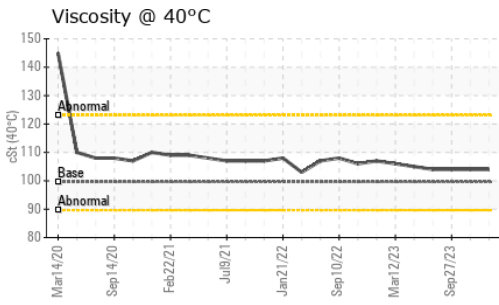

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 ARCELORMITTAL LONG PRODUITS CANADA
Sample No. : LH0279400 **Received** : 16 Jan 2024 3185 ROUTE MARIE-VICTORIN
Lab Number : 02609100 **Diagnosed** : 16 Jan 2024 CONTRECOEUR, QC
Unique Number : 5710186 **Diagnostician** : Wes Davis CA J0L 1C0
Test Package : MOB 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Contact: Danny Drouin
 danny.drouin@arcelormittal.com
 T:
 F: