



# LIEBHERR

## OIL ANALYSIS REPORT

WEAR	<b>NORMAL</b>
CONTAMINATION	<b>NORMAL</b>
FLUID CONDITION	<b>NORMAL</b>



Machine Id  
**LIEBHERR LH30M 139284-1253**  
Component  
**Rear Right Wheel Hub**  
Fluid  
**LIEBHERR GEAR BASIC 90 LS (--- GAL)**

### RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>LH0241891</b>	LH0241879	LH0239960
Sample Date		Client Info		<b>05 Jan 2024</b>	31 Oct 2023	04 Sep 2023
Machine Age	hrs	Client Info		<b>3235</b>	2739	2265
Oil Age	hrs	Client Info		<b>0</b>	0	0
Filter Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed		Client Info		<b>N/A</b>	Changed	Changed
Filter Changed		Client Info		<b>N/A</b>	None	None
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

### WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185(m)	>450	<b>9</b>	6	6
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	>2	<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185(m)	>15	<b>&lt;1</b>	<1	0
Lead	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m)	>75	<b>&lt;1</b>	<1	1
Tin	ppm	ASTM D5185(m)		<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE

### CONTAMINATION










There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185(m)	>60	<b>3</b>	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	0	0
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	VLITE
Debris	scalar	Visual*	NONE	<b>VLITE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG

### FLUID CONDITION

The condition of the oil is acceptable for the time in service.

Sodium	ppm	ASTM D5185(m)		<b>2</b>	1	2
Boron	ppm	ASTM D5185(m)	0	<b>&lt;1</b>	2	6
Barium	ppm	ASTM D5185(m)	0	<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)	0	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	<1	<b>&lt;1</b>	<1	<1
Calcium	ppm	ASTM D5185(m)	<1	<b>20</b>	22	30
Phosphorus	ppm	ASTM D5185(m)	2143	<b>2295</b>	2288	2299
Zinc	ppm	ASTM D5185(m)	<1	<b>5</b>	5	8
Sulfur	ppm	ASTM D5185(m)	23468	<b>24663</b>	25591	26784
Visc @ 40°C	cSt	ASTM D7279(m)	170	<b>192</b>	181	179

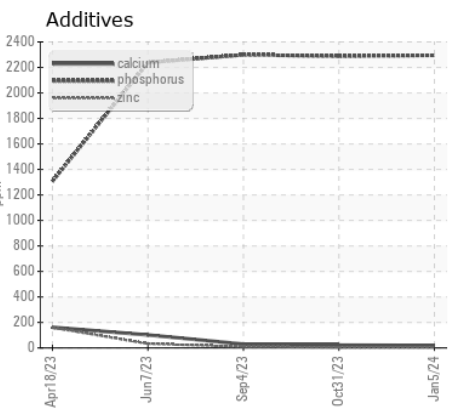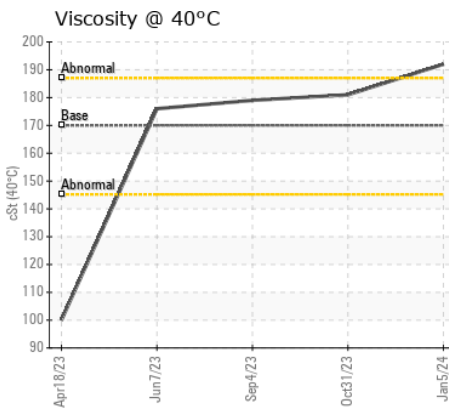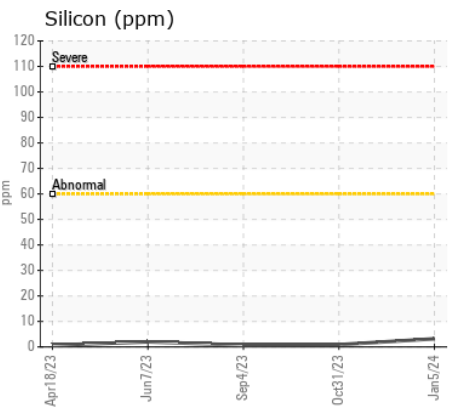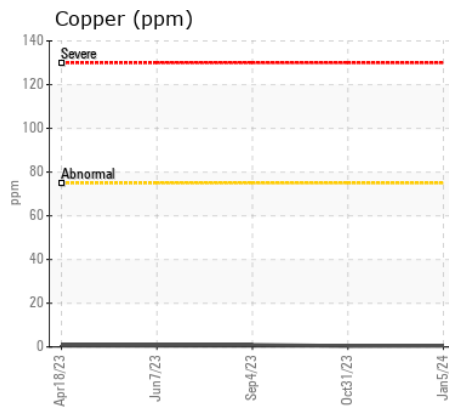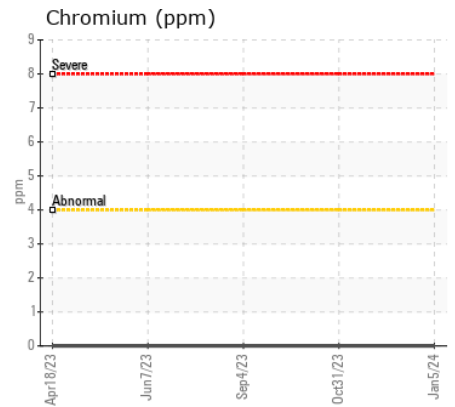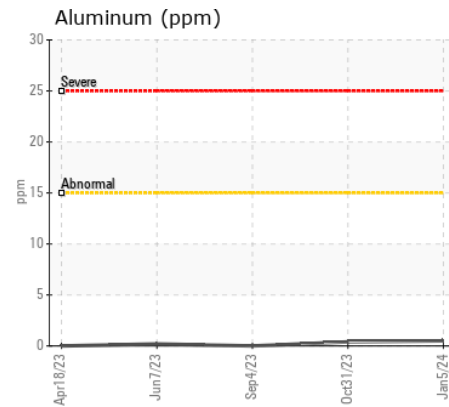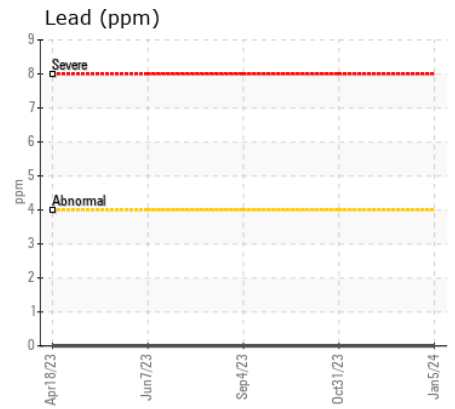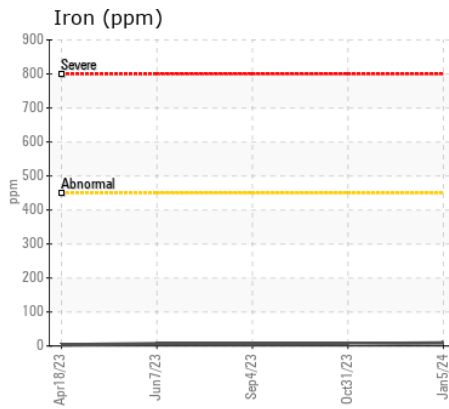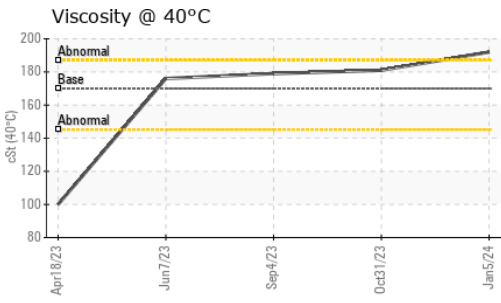

ISO 17025:2017  
Accredited  
Laboratory

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : LH0241891 **Received** : 16 Jan 2024  
**Lab Number** : 02609124 **Diagnosed** : 16 Jan 2024  
**Unique Number** : 5710210 **Diagnostician** : Kevin Marson  
**Test Package** : MOBCE ( Additional Tests: Visual )

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

**HUBERT & FILS**  
 474 ROUTE 105  
 BOIS-FRANC, QC  
 CA J9E 3A9  
 Contact: Eric Brisebois  
 ericbrisebois99@gmail.com

T:  
F: