



CORROSION	NORMAL
CONTAMINANTS	ABNORMAL
FUEL CONDITION	NORMAL

Machine Id  
**515543 FRESHSTART**

Component  
**Diesel Fuel**

Fluid  
**{not provided} (--- LTR)**

### RECOMMENDATION

This is a baseline read-out on the submitted sample.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>IL0019065</b>	---	---
Sample Date		Client Info		<b>15 Jan 2024</b>	---	---
Machine Age	kms	Client Info		<b>315877</b>	---	---
Sample Status				<b>ABNORMAL</b>	---	---

### CORROSION


{not applicable}

White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---

### CONTAMINANTS

Water contamination levels are abnormal. The bottom layer is 100% water.

Water	%	ASTM D6304*	>0.05	<b>▲ 100</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>▲ WGOIL</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---

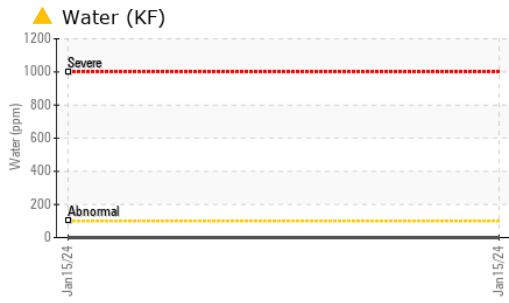

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : IL0019065 **Recieved** : 16 Jan 2024  
**Lab Number** : **02609153** **Diagnosed** : 16 Jan 2024  
**Unique Number** : 5710239 **Diagnostician** : Kevin Marson  
**Test Package** : TEST ( Additional Tests: KF )

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

**ALTRUCK IDEALEASE**  
 120 MCGOVERN DRIVE  
 CAMBRIDGE, ON  
 CA N3H 4R7  
 Contact: Tom Heeley  
 tom.heeley@altruck.com  
 T: (519)650-3670  
 F: (519)650-2050