



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	ABNORMAL

Area
(CGVH) PERIMETER AVIATION [52898]
Machine Id
[CGVH] FAIRCHILD SA227AC P-44495 (S/N 739B)
Component
1 Jet Turbine
Fluid
EASTMAN TURBO OIL 2380 (--- LTR)

RECOMMENDATION

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		GT57414	GT57407	GT56966
Sample Date		Client Info		16 Jan 2024	04 Dec 2023	19 Oct 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		817	720	622
Filter Age	hrs	Client Info		98	98	96
Oil Changed		Client Info		N/A	N/A	N/A
Filter Changed		Client Info		N/A	N/A	N/A
Sample Status				---	---	---

WEAR







Iron	ppm	ASTM D5185(m)	>8	<1	1	1
Chromium	ppm	ASTM D5185(m)	>2	0	0	0
Nickel	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	0	0	0
Aluminum	ppm	ASTM D5185(m)	>2	1	<1	1
Lead	ppm	ASTM D5185(m)	>3	<1	1	1
Copper	ppm	ASTM D5185(m)	>3	<1	<1	<1

CONTAMINATION

Water		WC Method	>0.1	NEG	NEG	NEG
-------	--	-----------	------	------------	-----	-----

FLUID CONDITION

Magnesium	ppm	ASTM D5185(m)	0	0	0	0
Acid Number (AN)	mg KOH/g	ASTM D974*	0.43	▲ 1.84	▲ 1.86	▲ 1.91

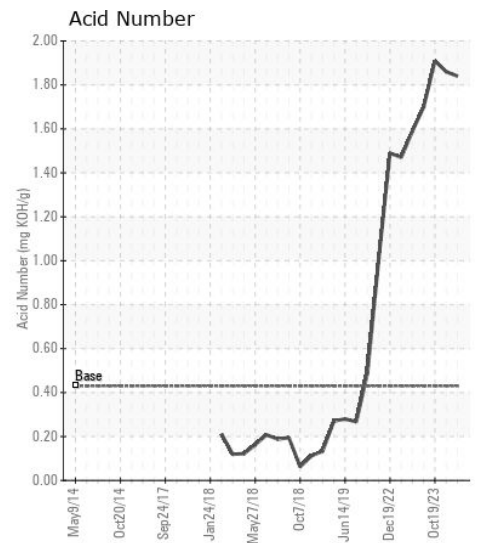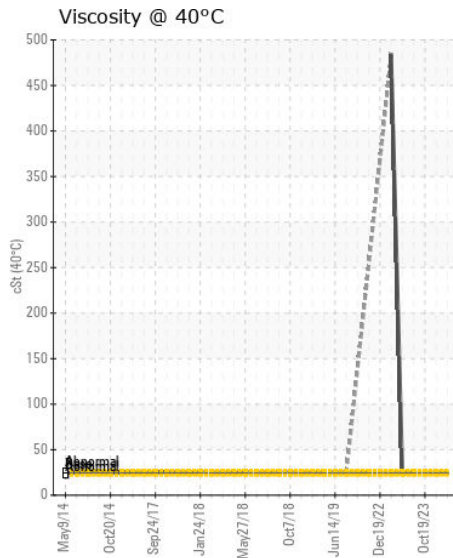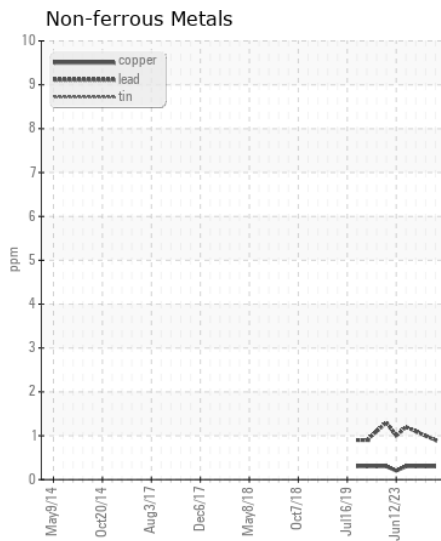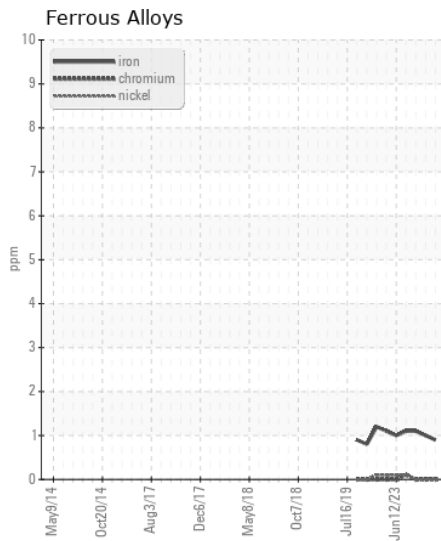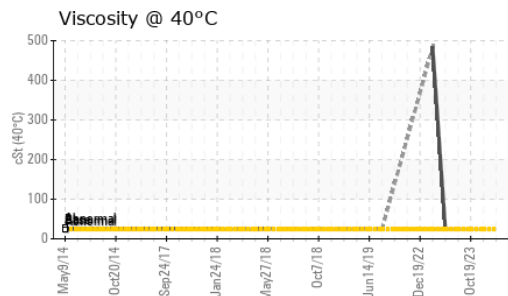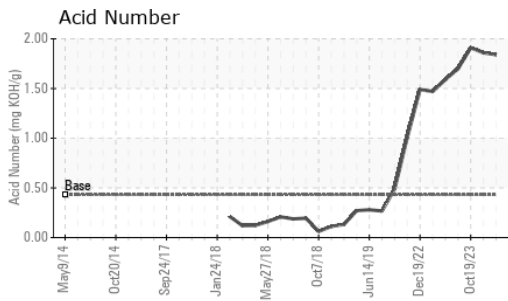

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GT57414 **Received** : 18 Jan 2024
Lab Number : 02609831 **Diagnosed** : 18 Jan 2024
Unique Number : 5710917 **Diagnostician** :
Test Package : G331 (Additional Tests: ICP)

Honeywell Engines
 111 S. 34th Street, 301 Receiving, Attn: SOAP Program
 PHOENIX, AZ
 US 85034
 Contact: GARRETT

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T:
 F: (602)365-2676